

C A P E ENVIRONMENTAL MANAGEMENT I N C

Final Project Closeout Report Lead-based Paint Abatement (LBPA) and Refinishing Officer Single Family Housing, Quarters J & B Charleston Naval Shipyard Complex Charleston, SC

Contract # N62467-99-D-1035 Work Order No.: 0007 CAPE Project # 90033.103.000

Prepared for:
Southern Division
Naval Facilities Engineering Command
2155 Eagle Drive, P.O. Box 190010
North Charleston, SC 29419-9010

Prepared by:

Cape Environmental Management Inc 2302 Parklake Drive, Suite 200 Atlanta, Georgia 30345 (770) 908-7200

BOOK 1

Contacts:

Herman Kitt, Vice-President Michael D. Mount, CIH

FEBRUARY 2000

CAPE ENVIRONMENTAL MANAGEMENT INC

Final Project Closeout Report Lead-based Paint Abatement (LBPA) and Refinishing Officer Single Family Housing, Quarters J & B Charleston Naval Shipyard Complex Charleston, SC

Contract # N62467-99-D-1035 Work Order No.: 0007 CAPE Project # 90033.103.000

Prepared for:

Southern Division Naval Facilities Engineering Command 2155 Eagle Drive, P.O. Box 190010 North Charleston, SC 29419-9010

Prepared by:

Cape Environmental Management Inc 2302 Parklake Drive, Suite 200 Atlanta, Georgia 30345 (770) 908-7200

Contacts:

Herman Kitt, Vice-President Michael D. Mount, CIH

FEBRUARY 2000

CONTENTS

EXECUTIVE SUMMARY

SECTION 1	Technical Specification for Lead-Based Paint Abatement and Disposal
SECTION 2	Submittals and Statements
SECTION 3	Air Monitoring and Analytical Results
SECTION 4	Field Test Reports, Certificates and Records

Cape Environmental Management Inc

EXECUTIVE SUMMARY

Cape Environmental Management Inc (CAPE) was retained by Southern Division of the Naval Facilities Engineering Command (SouthDiv NAVFACENGCOM) to furnished all labor, supervision, materials where required, equipment and special services necessary to complete the removal, packaging and disposal of lead-based paint (LBP) as well as corresponding repair, encapsulation, and refinishing of designated surfaces and components located in Units J and B, Charleston Naval Shipyard Complex. The objective of this project is to eliminate deteriorated, friction, impact and accessible (chewable) lead based paint surfaces in the referenced housing units.

These services encompasses all coordination, documentation, air monitoring, environmental testing and disposal of general construction waste necessary to complete the abatement of lead-based paint from designated surfaces and components as outlined in the interior treatment work list. CAPE also remove exterior deteriorated paint and provide the corresponding surface preparation and refinishing. This final project report documents, lead abatement services and refinishing was completed between the dates of October 18, 1999 and January 10, 2000.

Client Activity: Charleston Naval Shipyard Complex

Officer Single Family Housing – Units J & B

Navy Consultant (NC): Cape Environmental Management Inc

Project Manager: Herman Kitt

Certified Industrial Hygienist (CIH) Michael D. Mount, CIH

On-site Industrial Hygienist: Robert Beasley Jr.,

Asbestos Environmental Consultants

Contractor: Cape Environmental Management Inc

Contractor's Project Manager: Jeffrey P. Shannon

On-Site Project Manager: Howard Frost

Scope of Work

The scope of work for this project included the lead based paint abatement and refinishing of the following surface areas and components from the buildings indicated: Units J and B

Interior Treatment:

Surface Area/Components	Treatment Method
Walls	Remove any flaking or peeling LBP. Surface preparation shall include
	Removing flaking or peeling and encapsulate 5 feet up from the floor
	(impact surface).
Baseboards	Perform surface preparation and paint only as required. Surface preparation
	shall include removing flaking or peeling LBP and encapsulate (impact
	surfaces).
Windows	Plane sash edges, remove LBP only on chewable or chewable window
	surfaces. Replacing in kind an entire window that is too deteriorated to
	repair if the overall form and detailing are still evident using the physical
	evidence to guide the new work. It using the same kind of material is not
	technically or economically feasible, then a compatible substitute material
	may be considered.
Doors	Plane door edge and remove LBP 2 inches around edge on front and back.
	Feather and repaint, this eliminates chewable, friction and impact surfaces.
Bathroom Vanity	Strip LBP 2 inches from edge of vanity and encapsulate.
Ceiling	Remove any flaking or peeling LBP and repaint with regular paint

Exterior Treatment

Surface Area/Components	Treatment Method
Eaves	Remove any flaking or peeling LBP and paint only as necessary eaves
	with regular paint.
Windows/Doors	Same as noted for the interior.

Garage exterior	Perform surface preparation and paint only as necessary exterior with regular paint.
Screen Porches	Remove any flaking or peeling LBP and repaint with regular paint.
Exterior screen door	Remove or replace unless door has historic features.

1.0 Gross Removal

The work area enclosures consisted of a three-stage decontamination unit (de-con), polyethylene barriers, and two negative air units. All vents and penetrations were sealed with polyethylene and duct tape. "Danger Lead" signs were posted outside the work area as required by OSHA.

Negative pressure of 0.02 inches of water was maintained before, during, and after removal. The critical barriers remained in place and work area was kept under negative pressure until the "Release Criteria" was met by the Contractor.

As part of the gross removal all lead contaminated materials removed were disposed of in 6 mil plastic waste bags and reinforced by placing a second polyethylene bag over the initial bag (double bagging).

2.0 Cleaning and Visual Evaluation

Final cleaning of the area was conducted using a water solution of LEDISOLV. All surfaces were wiped until visible dust, dirt, and debris was removed. The cleaning rags and waste water generated during cleaning process were segregated and sampled for TCLP analysis. The final visual evaluation of the work areas was performed by both the On-site Contractor's Project Supervisor and (third party) on-site Industrial Hygiemist. The Contractor's crew re-cleaned designated areas where any visible residue was noted during previous inspections.

Final clearance testing was conducted after final cleaning inspection with full containment remaining in place. The final clearance samples consisted of area air samples and surface wipe samples. The results of the clearance air samples indicated lead concentrations below the final clearance air concentration of 30 ug/m³ and the wipe samples resulted in less than the clearance criteria of 100 ug/ft² feet of surface area.

Aggressive air sampling techniques were achieved by employing a 1.5 power leaf blower to entrain settled dust from the work area surfaces.

The work area was released to the Owner upon a successful visual evaluation of work area and air sampling and dust wipe sampling results indicated lead concentrations below allowable limits. The "Release" criteria was met by the Contractor on January 10, 2000.

3.0 Worker Protection

Powered Air Purifying Respirator (PAPR) and half-face respirators equipped with HEPA filters and full body disposable coveralls were utilized by all workers while inside the work areas. CAPE conducted personal air sampling to document worker exposure during each phase of work. All personal sample collected during the project indicated a lead concentration equal or below 30 micrograms per cubic meter (ug/m³) in all phases of the work area.

4.0 Summary of Analytical Results

A total of 36 air samples, 3 water samples, 21 dust wipe samples, 8 composite soil samples and 4 TCLP samples were collected during this project. All samples were analyzed in accordance with NIOSH Method 7082 and EPA protocols and are presented in Section 3 of this report. Air sample analysis results with their corresponding chain of custody are presented in Section 3, Appendix B. Dust wipe and soil sample analysis are presented in Section 3, Appendix B. Dust wipe and soil sample analysis are presented in Section 3, Appendix C. TCLP sample analysis are presented in Section 3, Appendix C. TCLP sample analysis are presented in Section 3, Appendix E.

5.0 Closure

Cape has successfully eliminated all deteriorated, friction, impact and accessible (chewable) lead-based paint surfaces in Units J and B located at Charleston Naval Shipyard Complex, Charleston, South Carolina. All lead contaminated waste water generated during the abatement were removed from the work areas upon receipt of passing TCLP results and were disposed of non-hazardous waste. TCLP results from solid waste generated which consists of disposable suits, rags, polyethene sheets and paint chips debris were above the clearance criteria of 5 ppm and therefore, were subsequently disposed of as hazardous waste. A total of 68 drums were disposed of as hazardous waste. Copies of waste manifest are presented in Section 4 of this report. Repainting and other necessary refinishing was performed by PC Painting of Mt. Pleasant South, Carolina.

TECHNICAL SPECIFICATION FOR

LEAD-BASED PAINT ABATEMENT AND DISPOSAL CHARLESTON NAVAL SHIPYARD COMPLEX OFFICER SINGLE FAMILY HOUSING

1.0 GENERAL

1.1 SCOPE

The work covered by this specification includes furnishing all labor, equipment, materials, tools, services, testing, supervision, transportation, and incidentals necessary to perform the work of Lead-based Paint Abatement (LBPA) in Officer Single Family Housing, Charleston Naval Shipyard Complex. Paint preparation includes removal of deteriorated, loose and flaking paint and debris by wet scraping only/ cleaning etc. per HUD Guidelines, OSHA Lead in Construction Standard 29 CFR-1926-62, The Standards for Rehabilitation and Guidelines for Rehabilitating Historic Buildings and NAVFAC MO-913 Historic Structures Preservation Manual, dated September 1991; perform minor repairs as necessary to ensure compliance with manufacturer's specifications for surface preparation to accept 20-year paint. Painting includes 20 year paint unless indicated as "regular" paint.

After all abatement work is complete the entire area will be cleaned in accordance with HUD guidelines to ensure the elimination of any lead based paint (LBP) dust hazards.

Clearance testing (wipe samples) for LBP dust will also be performed after abatement is complete.

Abatement shall be conducted only on components that have been indicated to have LBP in the survey conducted by Supervisor of Shipbuilding, Conversion and Repair, Portsmouth, Environmental Detachment, Charleston (SPORTENVDETCHASN) for the Single Family Officer Housing and the PWC NORFOLK reports. Soil Abatement shall be based on the sampling results from the Supervisor of Shipbuilding, Conversion and Repair, Portsmouth, Environmental Detachment, Charleston (SPORTENVDETCHASN) and PWC NORFOLK reports.

Not all work defined herein is not necessarily required.

Important Definitions:

Deteriorated paint- any interior or exterior paint that is peeling, chipping, chalking, or cracking, or is located on an interior or exterior surface or fixture that is damaged or deteriorated.

Impact Surface- an interior or exterior surface that is subject to damage from repeated impacts (e.g., certain parts of door frames).

Friction Surface- an interior or exterior surface that is subject to abrasion or friction (e.g., certain window, floor, and stair surfaces).

Accessible Surface- surface that mouthing or chewing by children if it protrudes from the surrounding area to the extent that a child can chew the surface and is within 3 feet of the floor or ground (e.g., window sills, railing, and edges of stair treads).

Officer Housing

Exterior Treatment:

	Eaves: Remove any flaking or peeling LBP and paint only as necessary eaves with regular paint.
G	Windows/doors: Same as noted for the interior.
0	Garage exterior: Perform surface preparation and paint only as necessary exterior with regular paint.
0	Screen Porches: Remove flaking or peeling LBP paint and repaint with regular paint.
0	Exterior Screen Doors: Remove and replace unless door has historic features.
Int	erior Treatment:
	Walls: Remove any flaking or peeling LBP. Surface preparation shall include removing flaking or peeling LBP and encapsulate 5 feet up from floor (impact surface).
	Baseboards: Perform surface preparation and paint only as required. Surface preparation shall include removing flaking or peeling LBP and encapsulate (impact surface).
0	Windows: Plane sash edges, remove LBP only on chewable or chewable window surfaces. Replacing in kind an entire window that is too deteriorated to repair if the overall form and detailing are still evident using the physical evidence to guide the new work. It using the same kind of material is not technically or economically feasible, then a compatible substitute material may be considered.
0	Doors: Plane door edge and remove LBP 2 inches around edge on front and back. Feather and repaint This eliminates chewable, friction and impact surfaces.
	Bathroom vanity: Strip LBP 2 inches from edge of vanity and encapsulate.
	Ceiling: Remove any flaking or peeling LBP and repaint with regular paint.
Fo	r this specification, LBPA is defined as stated in 1991 Consumer Product Safety Act and as

addressed in 16 CFR 1303, "Ban of Lead-Containing Paint and Certain Consumer Products Bearing, Lead-Containing Paint.

Abatement, storage, transportation, and disposal work shall be performed without damaging or contaminating adjacent work or areas. Where such work or areas are damaged or contaminated, The SPORTENVDETCHASN shall restore work or areas to the original condition.

1.2 QUALITY CODES AND STANDARDS

The following publications form a part of this specification to the extent referenced. The publications are referred to in the text by basic designation only.

AMERICAN NATIONAL STANDARDS INSTITUTE (ANSI) STANDARDS

Z88.2 Practice for Respiratory Protection

TITLE 29, CODE OF FEDERAL REGULATIONS (CFR), U.S. DEPARTMENT OF LABOR OCCUPATIONAL SAFETY AND HEALTH ADMINISTRATION (OSHA) STANDARDS

Part 1910 Occupational Safety and Health Standards

Part 1926 Safety and Health Regulations for Construction

OSHA Booklet 3126 Working with Lead in the Construction Industry

TITLE 40. CODE OF FEDERAL REGULATIONS (CFR), U.S. ENVIRONMENTAL PROTECTION AGENCY (EPA) STANDARDS

Part 50	Ambient Air Standards
Part 260	Hazardous Waste Management System: General
Part 261	Identification and Listing of Hazardous Waste
Part 262	Standards Applicable to Generators of Hazardous Waste
Part 263	Standards Applicable to Transporters of Hazardous Waste
Part 264	Standards for Owners and Operators of Hazardous Waste Treatment, Storage, and Disposal Facilities
Part 265	Interim Status Standards for Owners and Operators of Hazardous Waste treatment, Storage, and Disposal Facilities
Part 268	Land Disposal Restrictions

Part 370 Hazardous Chemical Reporting: Community Right-to-know

TITLE 49, CODE OF FEDERAL REGULATIONS (CFR). U.S. DEPARTMENT OF TRANSPORTATION (DOT) STANDARDS

Part 172 Hazardous Material Table, Special Provisions, Hazardous Material Communications, Emergency Response Information, and Training Requirements

Part 173 Shippers - General Requirements Subpart M for Shipments and Packaging

Part 178 Specifications for Packaging

DEPARTMENT OF HOUSING AND URBAN DEVELOPMENT (HUD)

HUD ACCN-5646 (1990; Rev May 1991) Lead-Based Paint: Interim Guidelines for Hazard Identification and Abatement in Public and Indian Housing

THE SECRETARY OF THE INTERIOR

Standards for Rehabilitation and Guidelines for Rehabilitating Historic Buildings (Revised 1983)

DEPARTMENT OF THE NAVY

NAVFAC MO-913, Historic Structures Preservation Manual September 1991

CHARLESTON NAVAL SHIPYARD

Facility Layaway Standards

NATIONAL FIRE PROTECTION ASSOCIATION (NFPA)

NFPA 701 Methods of Fire Test for Flame-Resistant Textiles and Films

NFPA 70 National Electrical Code

NATIONAL INSTITUTE FOR OCCUPATIONAL SAFETY AND HEALTH (NIOSH)

NIOSH Booklet 3142 Lead in Construction

STEEL STRUCTURES PAINTING COUNCIL (SSPC)

SSPC 93-02 Industrial Lead Paint Removal Handbook, Kenneth A. Timber, Second edition, June 1993

UNDERWRITERS LABORATORIES (UL)

UL 586 High-Efficiency, Particulate, Air Filter Units

1.3 DEFINITIONS

Air monitoring - the process of measuring the lead content of a specified volume of air in a stated period of time. Personal air sampling results shall be calculated to reflect the employee's 8-hour time weighted average (TWA) exposure.

Encapsulate - A material that surrounds lead-based paint in a matrix to help prevent further deterioration of lead coatings and minimize human exposure to lead.

Hazardous waste - Lead paint debris may be characterized as hazardous, if after testing by the Toxicity Characteristic Leaching Procedures (TCLP), the leachate contains any of the following elements in concentrations equal to or greater than those listed below:

Barium 100 mg/L
Cadmium I mg/L
Chromium 5 mg/L
Lead 5 mg/L

Mercury 0.2 mg/L

these elements can cause a material to be hazardous as defined in 40 CFR 261. The above list only includes those elements associated with paints.

Lead containing paint - a paint containing 0.5% by weight lead or greater.

Personal monitoring - sampling of the airborne lead concentrations within the breathing zone of an employee.

Visible emissions - any emissions containing particulate lead material that are visually detectable without the aid of instruments.

Supervisor of Shipbuilding, Conversion and Repair, Portsmouth, Environmental Detachment, Charleston (SPORTENVDETCHASN)

1.4 SUBMITTALS

No submittals will be submitted to SOUTHDIV except LBPA Management Plan. The SPORTENVDETCHASN shall have trained personnel in National Historic Preservation Act Section 106 in the review process to the point that they know that there is a relatively tightly structured process through which they must work to establish a relationship with the S. C. SHPO.

Analytical support

The SPORTENVDETCHASN shall identify the analytical support laboratory for environmental and industrial hygiene samples analysis. All appropriate certifications from the laboratory shall kept on record by the SPORTENVDETCHASN.

Qualifications of personnel

Resumes shall be provided on all key personnel to work on the project. This shall include the project manger, project superintendent (Competent Person), foreman, safety and health representative, CIH, (Certified Industrial Hygienist) or any other environmental or industrial hygiene technicians. Training experience is required for each person assigned to the project who will be performing, work at the job site.

1.4.2 Submittals Required After Award

The following submittals shall be provided for approval:

Lead-Based Paint Abatement (LBPA) Management Plan

The SPORTENVDETCHASN shall visit and investigate the site, review drawings and specifications, assess the amount of lead-based paint, and become familiar with conditions that will affect the work tasks and abatement methods and shall prepare a detailed LBPA Management Plan that identifies the work procedures and safety and health measures to be used in LBPA. The plan shall be submitted to SOUTHDIV for review by the State Historic Preservation Office (SHPO). The plan shall have the approval of the CIH and shall address the various sources of lead and the methods to be undertaken to abate the lead hazards to include the following key elements:

- Abatement methods for each surface type, including provisions for the preservation of historical buildings and components.
- Training requirements as required by Federal, state, and local regulations and standards.
- Unique problems associated with the LBPA project.
- Personnel protective equipment; respiratory protection program and controls.
- Worker exposure assessment procedures, including exposure monitoring,
 Work Practice controls.
- Special requirements for work in historic structures.
- Sampling, testing, and analytical methods to include personal air sampling requirements
 of 29 CFR Part 1926 Section 62 and when specified or where required; environmental
 air sampling, in accordance with 40 CFR Part 50; dust wipe sampling, and toxicity

characteristic leaching procedure (TCLP) of the waste material in accordance with 40 CFR Part 261. Procedures shah include frequency, locations, and sampling and analytical methods to be used. In addition to those items noted above, the LBPA Management Plan shall also address the specific requirements of each of the following areas. Each of the plans described below shall be a section of the overall LBPA Management Plan.

Two copies of the LBPA Management Plan shall be submitted for approval to the Charleston Naval Shipyard Complex Preservation Officer.

PLANNING MEETING WITH THE FOLLOWING PARTIES BEFORE ANY WORK IS STARTED:

- Representative of SHPO Office
- Representative of RDA
- CSO Office
- Representative of SPORTENVDETCHASN
- Representative of SOUTHDIV

Hazardous Waste Management

A Hazardous Waste Management Plan shall be prepared that complies with applicable requirements of Federal, state, and local hazardous waste regulations and addresses:

- Identification or documentation of potential hazardous wastes associated with the work,.
- Estimated quantities of wastes to be generated and disposed of.
- Names and qualifications of each Subcontractor that will be transporting, storing, and disposing of the wastes; the facility location, and phone number shall be included. A copy of EPA, state, and local hazardous waste permits and EPA identification numbers.
- Names and qualifications (experience and training) of personnel who will be working, on site with hazardous waste.
- List of waste handling equipment to be used in performing the work to include cleaning, volume reduction, and transport equipment.
- List of materials, including Material Safety Data Sheets for supplies that may contain potentially hazardous or toxic chemical components.
- Spill prevention (plan for protection of the ambient air, soil, and water), containment,, and cleanup contingency measures to be implemented.

Work plan and schedule for waste containment, removal, and disposal.

Site Storage

• A Handling and Site Storage Plan shall be prepared that addresses the handling and storage of LBPA debris in accordance with hazardous waste requirements in 40 CFR Parts 262 and 265. An EPA identification number will be provided to the government so that proper manifesting of the hazardous waste can occur. Site storage limitations, including the time of storage, container requirements, and contingency plan must be described in the plan.

Waste Disposal

A Waste Disposal Plan shall be prepared after inspection of the work site and evaluation of disposal alternatives. The Waste Disposal Plan shall include but not be limited to the following:

- A written confirmation that the debris will be treated and disposed of in accordance with the, requirements of 40 CFR Parts 260, 261, 262, 264, and 2681 and state code equivalents.
- A written confirmation that transportation of the debris will be in accordance with 40 CFR Part 263.
- The disposal facility's name, address, telephone number, and landfill location, including copies of licenses permits, and authorizations for disposal of lead paint waste or related items.
- Detailed delivery tickets prepared, signed, and dated by an agent of the disposal facility, certifying the amount of LBPA containing materials delivered to the site within 3 days after delivery.

Emergency Response

Preparation and implementation. The Emergency Response Plan (ERP) shall be prepared to cover on site work by the contractor. The Competent Person shall be responsible for development, implementation, and quality control of the content and actions required in the ERP.

Acceptance and modifications. The ERP shall be prepared, signed, and dated by the SPORTENVDETCHASN's Competent Person and submitted 10 days prior to the reconstruction safety conference. Deficiencies in the ERP shall be discussed at the Preconstruction Safety Conference, and the ERP shall be revised to correct the deficiencies and resubmitted for acceptance. On site work shall not begin until the ERP has been accepted, unless otherwise authorized by government. As work proceeds, the ERP shall be adapted to new situations and conditions. Should an unforeseen hazard become evident during performance of the work, the contractor shall bring such hazard to the attention of the government, both verbally and in writing, for resolution as soon as possible.

1.5 QUALITY ASSURANCE

The following sections establish minimum requirements for personnel, analytical support facilities, respiratory protection equipment, and medical record keeping.

1.5.1 Qualifications

Supervisor of Shipbuilding, Conversion and Repair, Portsmouth, Environmental Detachment, Charleston (SPORTENVDETCHASN)

Workers shall comply with the appropriate federal, state, and local regulations which mandate training, requirements and work practices and shall be capable of performing the work.

Certified Industrial Hygienist (CIH)

The CIH may be not be employee of the SPORTENVDETCHASN, but a third party consultant contracted by the SPORTENVDETCHASN, with overall responsibility for the implementation and enforcement of the LBPA Management Plan, including the respiratory protection program. The CIH (American Board of Industrial Hygiene certified in the Comprehensive Practice) shall have a minimum of 2 years specialized experience in the lead paint abatement industry, demonstrable expertise in lead paint air monitoring techniques, and in the establishment of respiratory protection programs. The CIH shall have a working knowledge of applicable state and federal lead paint and occupational safety and health regulations and formal education and training, in occupational safety and health. The CIH is not required to be present at the work site on a full-time basis but shall be on site for a minimum of 8 hours per week. The CIH may delegate to IH(s) the on-going implementation and enforcement of the LBPA Management Plan, including the air monitoring program and final visual inspections of abatement areas.

Industrial Hygienist (DB)

The IH(s) shall be independent IH(s) assigned to the site on a full-time basis for the duration of the project with functional responsibility for implementation and enforcement of the LBPA Removal and Disposal Plan, including the air monitoring, and final visual inspections. The IH(s) shall have a minimum of one year working experience in the LBPA industry and shall have a sound working knowledge of applicable state and federal occupational safety and health regulations and formal training in occupational safety and health. The IH(s) shall also have demonstrable experience in lead paint air monitoring techniques and respiratory protection program implementations. The IH(s) shall be accepted by and work under the supervision of the CIH to implement and enforce the LBPA Management Plan.

Testing Laboratory

The name, address, and telephone number of the independent testing laboratory selected to perform analysis for air samples, lead dust wipes, and TCLP analysis shall be supplied. Documentation that the laboratory performing the analysis is in an EPA National Lead Laboratory Accreditation Program (NLLAP) and that it is rated proficient in the NIOSH/EPA Environmental Lead Proficiency Analytical Testing Program (ELPAT) shall be supplied. Certification shall include accreditation for heavy metal analysis, list of experience relevant to analysis of lead in air, and a Quality Assurance and Quality Control Program. Currently, the American Association for Laboratory Accreditation (ASLA) and the American Industrial Hygiene Association (AIHA) are the EPA recognized laboratory accreditors. Documentation shall include the date of accreditation or reaccredidation.

Blood Lead Testing Laboratory

The SPORTENVDETCHASN shall supply the name, address, and telephone number of the blood lead testing, laboratory, the laboratory's listing by OSHA and the U.S. Public Health Service Center for Disease Control (CDC), and documentation that the laboratory is certified in the state where the work site is located.

1.5.2 Respiratory Protection Devices

Manufacturer's certification of NIOSH or the Mine Safety and Health Administration (MSHA) approval for respiratory protection devices utilized on the site is required.

1.5.3 Cartridges, Filters, and Vacuum Systems

Manufacturer's certification of NIOSH approval of respirator cartridges (organic vapor, acid gas, mist, dust, high efficiency particulate) and High Efficiency Particulate Air (HEPA) filtration capabilities for all cartridges, filters, and HEPA vacuum systems shall be submitted.

1.5.4 Medical Records

Certification that employees who are involved in lead paint abatement work have received medical examinations shall consist of a physician's statement and bioassay results for lead in accordance with 29 CFR Part 1910.120. Records shall be retained, at contractor's expense, in accordance with 29 CFR Part 1910, Section 20.

1.5.5 Training

Training certification shall be required for all workers, supervisors, and IH/Competent Person(s) prior to the start of work involving LBPA. Training shall meet the requirements of 29 CFR Part 1926, Sections 62 and 59; 29 CFR Part 1910.120(e); and 49 CFR Part 172, and those required by EPA or the state LBPA course for the work to be performed. Training shall be provided prior to the time of job assignment and at least annually thereafter (if required by regulations). Training

may cover all abatement methods or focus only on those methods specified in the LBPA Management Plan. The project specific training shall, as a minimum, include the following:

- Specific nature of the operation which could result in exposure to lead.
- Purpose, proper selection, fitting, use, and limitations of respirators.
- Relevant engineering controls and good work practices.
- The contents of any compliance P13-n in effect.

1.6 SAFETY AND HEALTH REGULATORY REQUIREMENTS

Work shall be performed in accordance with requirements of applicable regulations including, but not limited to, 29 CFR Part 1910 and Part 1926. Matters of interpretation of the standards shall be submitted to the appropriate agency for resolution before starting work. Where these requirements vary, the most stringent shall apply.

1.7 PRECONSTRUCTION SAFETY AND PRESERVATION MEETING

A preconstruction safety and preservation meeting shall be held prior to starting any work involving LBPA. Attendees to the meeting shall include the contractor's project manager. CIH, and Competent Person as well as representatives from the government. Items required to be submitted will be reviewed for completeness, and where specified, for acceptance. The South Carolina Department of Archives and History shall be invited to attend the preconstruction safety and preservation meeting. Invitation shall be received at least fifteen (15) days prior to the schedule meeting date. The State Historic Preservation Office has the option of attending.

1.8 RESPIRATORY PROTECTION PROGRAM

A respiratory protection program shall be established as required by 29 CFR Pa-r-t 1926 Sections 103 and 62 and in accordance with 29 CFR Part 1910, Section 134. An approved respirator shall be furnished to each employee and visitors required to enter a LBPA work control area. A fit test shall be conducted in accordance with 29 CFR Part 1926, Section 62, Appendix D.

1.9 SAFETY AND HEALTH OVERSIGHT

The Competent Person shall be the on site person responsible for coordination, safety, security, and execution of The work. The Competent Person shall be able to identify existence, and predictable lead hazards and shall have the authority to take corrective measures to eliminate them. The Competent Person shall be responsible for dust wipe and soil sampling,

1.10 POSTED WARNINGS AND NOTICES

1.10.1 Warning Signs and Notices

The following warning, signs and notices shall be posted at the work site in accordance with 29 CFR Part 1926, Section 62. Warning signs shall be provided at building entrances and approaches to LBPA control areas continent, airborne lead-based paint debris. Signs shall be located at a distance from the LBPA control area that will allow personnel to read the sign and take the necessary protective actions required before entering the LBPA control area. Warning signs shall be of sufficient size to be clearly legible and display the following:

WARNING
LEAD WORK AREA
POISON
NO SMOKING OR EATING
AUTHORIZED PERSONNEL ONLY
RESPIRATORS AND PROTECTIVE CLOTHING ARE REQUIRED IN THIS
AREA

Warning labels shall be of sufficient size to be clearly legible and display the following:

CAUTION: CLOTHING CONTAMINATED WITH LEAD. DO NOT REMOVE DUST BY BLOWING OR SHAKING. DISPOSE OF LEAD CONTAMINATED WASH WATER IN ACCORDANCE WITH APPLICABLE FEDERAL, STATE, OR LOCAL REGULATIONS.

1.10.2 Hazard Communication and Right-to-Know Notices

Right-to-know notices shall be placed in clearly visible areas of the work site in compliance with federal, state, and local regulations. A Hazard Communication program shall be required that meets the requirements of 29 CFR Part 1910.1200.

1.10.3 Daily Air Monitoring Results air monitoring results shall be prepared so as to be easily understood by the workers and shall be placed in a clearly visible area of the work site.

10.4 Emergency Telephone Numbers

A list of telephone numbers shall be posted at the site. The list shall include numbers of the local hospital, emergency squad, police and fire department.

2.0 PRODUCTS

2.1 SAFETY AND HEALTH MATERIALS

Sufficient quantities of health and safety materials required by 29 CFR Part 1926, Section 62, and other materials and equipment needed to complete the project, shall be available and kept on the site.

2.1.1 Respirators

Air-purifying respirators shall be approved by NIOSH for use with dust, fumes, and mists having permissible exposure limits less than 0.05 milligrams per cubic meter [i.e., have high-efficiency particulate air (HEPA) filters] and for other hazardous airborne contaminants that may be encountered, as determined by the Competent Person. Respirators shall comply with the requirements of 29 CFR Part 1926, Section 62, and shall be used in accordance with 29 CFR Part 1926, Section 103, and Part 1910, Section 134.

2.1.2 Respirator Cartridges

A sufficient supply of respirator cartridges shall be maintained at the work site to provide new cartridges to employees, authorized visitors, and Navy personnel throughout the duration of the project. Cartridges shall be replaced according to the manufacturer's recommendations, when breathing becomes difficult, or if the cartridge becomes wet.

2.1.3 Protective Clothing,

The contractor shall furnish equipment/clothing for protection from airborne and waterborne lead-based paint debris. An adequate supply of these items shall be available for worker, authorized visitor, and Navy personnel use. Workers and visitors shall not take protective clothing and equipment off the work site at any time. Protective clothing, includes:

- Coveralls (Whole Body Protective Coverings): Full-body coveralls and head covers shall be
 worn by workers in the work area. Sleeves shall be secured at the wrist and pants legs at the
 ankle with tape. Permeable clothing shall be provided in heat-stress conditions. Where nondisposable coveralls are provided, these coveralls shall be cleaned after each wearing,
 Cleaning, of coveralls and other non-disposable clothing shall be in accordance with the
 provisions for cleaning in 29 CFR Part 1926, Section 62.
- Boots: Work boots with nonskid soles or impermeable work boot covers shall be worn by
 workers. Where required by OSHA, safety boots (steel toe or steel toe and shank) shall be
 worn. Paint the uppers of boots red with water-proof enamel. Do not allow boots to be
 removed from the work area for any reason after being contaminated with LBPA debris.
 Dispose of boots as LBPA contaminated waste at the end of the work.
- Gloves: Inner gloves, appropriate for items and hazards encountered, and disposable outer work gloves shall be provided to each worker and shall be worn while the worker is in the work area. Glove material shall be appropriate for the specific chemical exposure. Gloves

- shall not be removed from the work area, and shall be disposed of as LBPA contaminated waste at the end of the work.
- Hard hats: Head protection (hard hats) shall be provided as required by OSHA for workers and authorized visitors. Protective plastic strap suspension hats shall be used. Hard hats shall be worn at all times that work is in progress. Hats shall remain in the work area until the project is completed. Hats shall be thoroughly cleaned, decontaminated, and bagged before being removed from the work area at the end of the project.
- Eye protection: Fog-proof goggles for personnel engaged in LBPA operations shall be worn when the use of a full face piece respirator is not required.
- Work clothing: Cloth work clothes shall be provided for wearing, under the disposable protective coveralls and foot coverings.

2.2 EXPENDABLE SUPPLIES

2.2.1 Polyethylene Sheet and Bags - General

Polyethylene sheet and bags shall be a minimum of 0. 15 mm (6 mils) thick. Polyethylene sheets shall be in roll sizes to minimize seams.

Disposal bags shall be leak-tight polyethylene with preprinted labels (in accordance with local, State, and Federal requirements), and shall have 125 mm (5-inch) long plastic ties, pointed and looped to secure the filled bags.

Bags are to be labeled:

DANGER
LEAD CONTAINING MATERIALS
AVOID CREATING DUST

And / or

CAUTION
HAZARDOUS MATERIAL
LEAD CONTAINING MATERIALS
AVOID OPENING OR DISTURBING CONTAINER

2.2.2 Polyethylene Sheet - Reinforced

Reinforced polyethylene sheet shall be provided where high skin strength is required such as where it constitutes the only barrier between the LBPA control area and the outdoor environment. The sheet stock shall consist of translucent, nylon-reinforced or woven-polyethylene thread laminated between two layers of polyethylene film. Film shall meet flame resistant standards of NFPA 701.

2.2.3 Tape and Adhesive Spray

Tape and adhesive shall be capable of scaling joints between polyethylene sheets and for attachment of polyethylene sheets to adjacent surfaces. After dry application, tape or adhesive shall retain adhesion when exposed to wet conditions, including amended water. Tape shall be a minimum of 50 mm (2 inches) wide, industrial strength. Spray adhesive shall not contain methylene chloride, as listed on the product's label and/or Material Safety Date Sheet.

2.2.4 Containers

Impermeable containers shall be used to receive and retain lead-contaminated material until disposal. Containers shall be labeled in accordance with EPA, DOT, and OSHA standards.

2.2.5 Chemicals

Chemicals, including caustics and paint strippers, shall be properly labeled and stored in leak-tight containers.

Chemical paint strippers

Chemical paint strippers shall contain no methylene chloride and shall be formulated to prevent stain, discoloration, or raising, of the substrate materials.

Chemical paint stripper neutralizer

Neutralizers for paint strippers shall be used on exteriors only and shall be compatible with the substrate and suitable for use with the chemical stripper that has been applied to the surface.

2.3 VACUUM SYSTEMS

HEPA filtered vacuum systems shall be used during abatement operations which, generate dust The systems shall be suitably sized for the project, and filters shall be capable of removing particles as small as 0.3 micrometers at a minimum efficiency of 99.97 percent. Provisions shall be made to empty the debris (collection hopper) without causing visible emissions of particulate.

2.4 HEAT BLOWER GUNS

Heat blower guns shall be flameless, electrical, paint-softener type with controls to limit temperature to 590 degrees C (1,100 degrees F). Heat blower shall be DI (non-grounded) 120 VAC, and shall be equipped with cone, fan, glass protector, and spoon reflector nozzles.

2.5 ENCAPSULATES

Encapsulation paint must meet the requirements of ASTM Specification E 1795-96 and/or-1797-96. Encapsulating paint shall be guaranteed by the Manufacturer to remain as an encapsulant for a period of 20 years. This guarantee shall include impact surfaces (i.e. base boards, wall corners, etc.). The Contractors shall confirm the paint guarantee.

BITREX (or similar product) will be added to all paint for accessible surfaces.

** Note: BITREX is a paint additive that has a bitter taste and eliminates the danger of children being poisoned by chewing on "accessible surfaces" Per the manufacturer (BI Chemicals in NJ) the material is added at a rate of 50 ppm and costs approx. 3 to 4 cents per gallon of paint. Contractor to confirm that 20 year guarantee is not impacted

ENCAPSULATES SHALL BE SUBMITTED FOR APPROVAL BY THE SOUTH CAROLINA DEPARTMENT OF ARCHIVES AND HISTORY REVIEW AND COMPLIANCE STATE HISTORIC PRESERVATION OFFICE WHEN USED TO ENCAPSULATE HISTORICAL BUILDING SURFACES.

Product Requirements

The encapsulation system shall not allow the passage of substrate lead dust into the environment as measured using lead wipe method in HUD interim guidelines. The encapsulate shall be durable, vermin proof, mildew resistant, rust and rot proof, fire proof, and non-toxic in cured form. The encapsulate shall be able to penetrate (chemically) through existing layers of paint without flaking, cracking, peeling, or separating from the treated surface under normal conditions and the resulting encapsulate surface must be suitable for application of latex or enamel top coats.

Lead paint abatement encapsulates which may have applicability to work performed in accordance with this technical specification include:

- Acrylic elastomers.
- Acrylic latex emulsions.
- Synthetic organic resins with fiberglass admixtures.
- Synthetic organic resins for multi-step applications using imbedded fiberglass mats.
- Polymeric rubber compounds used for control of lead dust during demolition activities.
- Other innovative coatings with demonstrated effectiveness in lead paint encapsulation.

The following materials are not to be used as encapsulates:

- A new coat of paint or primer.
- Paper wall coverings.
- Contact paper

2.6 STORAGE OF MATERIALS

Materials shall be stored in a place and manner that protects them from damage and contamination. During periods of cold weather, plastic materials shall be protected from the cold. No flammable or hazardous materials shall be stored inside any building. Regularly inspect materials to identify damaged or deteriorating items. Damaged or deteriorated items shall not be used and shall be removed from the site as soon as they are discovered. Any materials which become contaminated with LBPA waste shall be disposed of consistent with the requirements of federal and state solid and hazardous waste laws and this specification. Stored materials shall not present a hazard or an inconvenience to workers, visitors, and/or other occupants and employees of the building.

3.0 EXECUTION

3.1 WORK PROCEDURES

LBPA shall be performed in accordance with the accepted contractor's LBPA Management Plan as approved. Procedures and equipment required to limit occupational and environmental exposures to lead during LBPA shall be in accordance with 29 CFR Part 1926, Section 62, and other applicable regulations and standards as specified herein. Paint chips and associated waste shall be disposed of in compliance with Federal, state, and local regulations.

3.1.1 Historical Preservation Procedures

The distinguishing original qualities or character of a building, structure, or site and its environment shall not be destroyed. The removal or alteration of any historic material or distinctive architectural features should be avoided when possible.

The preferred LBP abatement method on historical buildings and components is paint removal or encapsulation rather than removal and replacement.

The surface cleaning of structures shall be undertaken with the gentlest means possible. Sandblasting and other cleaning methods that will damage the historic building materials shall not be undertaken.

For more detailed guidance on historical preservation, specific preservation recommendations and not recommended procedures, refer to Standards for Rehabilitation (revised 1983), NAVFACMO-913, Facility Layaway Standards and Section 3.3, LBPA Methods in this specification.

3.1.2 Personnel Protection Procedures

Personnel shall wear and use protective clothing and equipment as specified. Eating,, smoking, drinking, chewing tobacco and chewing gum, and applying makeup shall not be permitted in the LBPA control area. Personnel of trades not engaged in the abatement and disposal of LBPA shall not be exposed at any time to airborne concentrations of lead equal to or in excess of 30 microgram per cubic meter of air.

3.1.3 Safety and Health Procedures

The Competent Person shall be present on the work site throughout the abatement project to supervise, monitor, and document the project's health and safety provisions. A daily log., shall be maintained showing the results of sampling tests throughout the project area.

3.1.4 Safety and Health Responsibilities

The Competent Person shall:

- Verify that training meets applicable requirements.
- Review and approve LBPA Management Plan for conformance to the applicable referenced standards.
- Inspect LBPA work for conformance with the accepted LBPA Management Plan.
- Ensure that worker exposure air monitoring activities are in accordance with 29 CFR Part 1926, Section 62.
- Ensure that work is performed in strict accordance with specifications.
- Ensure that hazardous exposure to personnel and to the environment are adequately controlled.

3.1.5 Medical Surveillance Procedures

Medical surveillance shall be implemented in accordance with the approved contractor's LBPA Management Plan, and shall comply with the requirements of 29 CFR Part 1926, Section 62, including the provisions for biological monitoring, medical removal protection, and a physician's written opinion, signed by the physician performing the employee examination.

3.1.6 Sampling Result

A daily log of the personal environmental air sampling test results shall be reviewed by the IH and submitted, in written form, no more than 48 hours after completion of the sampling cycle. The log

shall list each sample result, sampling time and date, sample type, identification of personnel monitored, flow rate and duration, air volume sampled, yield of lead, cassette size, analytical method used, analyst's name and company, and interpretation of results. Results shall be reported in micrograms of lead per cubic meter of air. In accordance with 40 CFR Part 50, the Ambient Air Standard for lead (for protection of the public) is 1.5 ppb. In addition, the daily log shall include the results of dust wipe samples, soil samples, and TCLP sampling for preabatement, during abatement, and for final clearance. Documentation of results that exceed specified limits (personal air samples that exceed an action level of 30 micrograms per cubic meter) or as required by federal, state, or local requirements shall be highlighted in the log in such a manner to make them easily distinguishable from monitoring results that do not exceed specified or regulatory limits.

3.2 ENGINEERING CONTROLS AND CONTAMINATED STRUCTURES

3.2.1 LBPA Control Area

The LBPA control area is where the lead-based paint removal occurs and as such shall be considered contaminated. The control area shall be decontaminated at the completion of the LBPA abatement and disposal work.

3.2.2 Boundary Requirements

Physical boundaries shall be provided around exterior LBPA control areas by roping off the area indicated in the LBPA Management Plan. Interior projects shall be isolated by curtains, portable partitions, or other enclosures to ensure that concentrations of lead dust outside the LBPA control area will not equal or exceed the preabatement level or 30 micrograms per square foot, whichever is greater.

3.2.3 Control Barriers

The LBPA control area shall be separated from other portions of the building and the outside with control barriers. The polyethylene sheeting will have all openings masked and sealed, and shall be erected according to the contractor's LBPA Management Plan. Polyethylene sheeting shall be mechanically supported, independent of duct tape or spray adhesive without damaging historical building components.

3.2.4 Preabatement Lead-Dust Wipe Samples

Preabatement lead-dust wipe samples shall be taken outside the LBPA controlled area, in accordance with HUD ACCN-5646. Samples shall be taken within 3 meters (10 feet) of the abatement structure at 20 percent of the area planned for abatement.

3.2.5 Masking and Sealing

Interior LBPA control area requirements

Openings shall be sealed where the release of airborne lead-based paint dust is expected. A control area shall be established with the use of curtains, portable partitions, or other systems in order to prevent the escape of dust from the contaminated control area. The control area shall be provided with protective covering of two layers of polyethylene sheeting over floors. Penetrations of the floor, walls, and ceiling shall be sealed with polyethylene sheeting and duct tape. Polyethylene sheeting shall be firmly attached to the structure. Joints shall be scaled with spray adhesive and duct tape. Openings shall be provided for the supply and exhaust of air for the negative air pressure system. Personal monitoring during the work shift shall be in accordance with 29 CFR Part 1926, Section 62.

Exterior LBPA control area requirements

Where the construction of a contained LBPA control area is impractical, a roped-off perimeter shall be installed 6 meters (20 feet) from, and around, the area where the LBPA handling procedures are performed and other requirements for LBPA control areas shall be maintained. Personal monitoring of airborne concentrations shall be conducted in adjacent areas, during the work shift, in accordance with 29 CFR Part 1926, Section 62 and 40 CFR Part 50 as appropriate (i.e., vicinity of public). Where wipe sampling is not practical, air monitoring outside of the roped-off perimeter shall be conducted as specified. Airborne concentrations shall not exceed specified levels.

3.2.6 Personnel Decontamination Unit Procedures

Decontamination units shall be constructed when required for the abatement procedures. Specifications and drawings of portable prefab units, such as a trailer unit, if utilized, shall be submitted for review and approval before start of construction. Submittal shall include, but not be limited to, a floor plan layout showing dimensions, materials, sizes, thickness, plumbing, and electrical outlets. A separate equipment decontamination unit shall be provided. Each work area shall have an emergency exit. The personnel decontamination unit's clean room shall be the only means of entrance and exit, except for emergencies, from the LBPA control area. Materials shall exit the LBPA control area through the equipment decontamination area.

3.2.7 Equipment Decontamination Unit Procedures

The Equipment Decontamination Unit shall be used for removal of equipment and materials from the LBPA control area, and shall include a wash room, holding room, and an enclosed walkway. The unit shall be constructed from wood framing material and polyethylene sheeting. Workers shall not enter or exit the LBPA control area through the Equipment Decontamination Unit. A wash down station, consisting of an enclosed shower unit, shall be located in the work area outside the Wash Room. The wash down station shall be used to clean equipment, bags and containers. Bagged or containerized LBPA wastes shall be passed from the work area and cleaned in the Wash Room. The Wash Room shall be separated from the work area by a polyethylene sheeting flap. Wastewater shall be filtered and filters shall be changed as required for the shower unit and the Wash Room. Filters shall be disposed of as LBPA contaminated wastes. The Holding Room shall be used as a drop location for bagged LBPA passed from the

Wash Room. This room shall be constructed so that bagged materials cannot be passed from the Wash Room through the Holding Room to the enclosed walk-way. The walkway shall be separated from adjacent rooms by double flaps of 1.6 mm (1/16-inch) thick single ply rubber roofing materials of EPDM or Neoprene. The enclosed walkway shall isolate the Holding Room from the building exterior and shall be constructed of wood framing, and polyethylene sheeting. walkway shall provide access to the Holding Room from the building exterior. The enclosed walkway shall be separated from the exterior by a single flap of polyethylene sheeting.

3.2.8 Maintenance of Decontamination Units

Barriers and polyethylene sheeting shall be effectively sealed and taped. Containment barriers shall be visually inspected at the beginning of each work period. Damaged barriers and defects shall be immediately repaired upon discovery. Smoke methods shall be used to test effectiveness of barriers when directed by government.

3.2.9 Clean Room Procedures

A temporary unit with a separate equipment decontamination locker room and a clean locker room shall be provided for personnel who are required wear whole body protective clothing. Lead-free personal clothing and shoes shall be kept in the clean room. Hand wash stations and showers shall be located between the equipment decontamination locker room and the clean locker room, and employees shall wash or shower before changing into personal clothes. An adequate supply of clean disposable towels shall be provided.

3.2.10 Hand Wash Station Shower Room Procedures

An operational shower and hand washing station shall be provided between the work area and the clean changing room. Workers shall wash and/or shower before entering the clean changing room. Shower room shall be separated from other rooms by air-tight walls fabricated from polyethylene sheeting. Both hot and cold water shall be provided. Shower heads and controls, soap dish, continuing supply of soap, and clean towels shall be provided. The shower shall be maintained in a sanitary condition. Wastewater shall be contained and treated prior to discharge in accordance with local sewer ordinances, Navy standards for discharge to base sewers, or other applicable state regulations. Wastewater disposal method requires approval by the local water treatment authority. Disposal, when approved, shall be through the sanitary sewer.

3.2-11 LBPA Control Area Exiting Procedures

Personnel exiting a LBPA control area shall not leave the work place wearing any clothing or equipment worn during the work day and shall perform the following procedure:

- Vacuum all protective clothing before removing.
- Remove protective clothing in the decontamination room, and place this clothing in an approved impermeable disposal bag.

- Wash or shower.
- Change to clean clothes prior to leaving, the physical boundary designated around the lead-contaminated work site.

3.2.12 Temporary Utilities

Electrical power (110V/22OV) and potable water service will be supplied at the facility. The subcontractor shall maintain the security and maintenance of the utility system in the LBPA control area. In the event of a failure of any utility system, The government will not be responsible for any loss of time or other expense incurred by the Contractor. Wiring and electrical service shall be in accordance with the National Electrical Code (NEC). In addition, the contractor shall provide:

- Back-flow protection on all water connections. Fittings installed by the contractor shall be removed after completion of work with no damage or alteration to existing water piping and equipment.
- Heavy-duty abrasion-resistant hoses to provide water to the work area and decontamination area.
- A hot water heater, if hot water is not supplied, to the decontamination showers.
- Electrical service to work areas. Electrical service shall comply with NEC and UL standards.
 Warning signs shall be posted at power outlets which are other than 110-120 volt power.
 Only grounded extension cords shall be used. Incandescent lamps and light fixtures shall be of adequate wattage to provide good illumination in LBPA control areas.
- Temporary heating units, when needed, that have been tested and labeled by UL, FM, or another recognized trade association related to the fuel being consumed, Forced air or fan type units shall not be utilized inside a work area. Units shall have tip-over protection.
- Sufficient quantity of single-occupant, self-contained chemical toilets, properly vented and fully enclosed, if permanent toilets are not available.

3.3 LBPA METHODS

The SPORTENVDETCHASN is responsible for choosing the removal method that will meet the requirements of the specification. When applicable, requirements stated in the Historic Structures Preservation Manual, Standards for Rehabilitation and Guidelines for Rehabilitating Historical Buildings and Facility Layaway Standards shall be followed. The method(s) selected should remove all lead paint from the surface without damage to the substrate surface.

abatement methods that produce uncontrolled dust or fumes will not be acceptable methods of removal.

3.3.1 Lead-based Paint Removal

The following lead-based paint removal methods may have applicability for the facility subject to the abatement activities. The contractor shall select the appropriate method(s) based upon the scope of work and additional information as may be provided by the government.

- HEPA vacuum system
- Heat gun (operating temperature must be controlled to prevent release of toxic fumes)
- Mechanical scraping includes hand and power tools (historic structures require use of natural bristle or nylon brushes).
- Chemical strippers containing methylene chloride are prohibited. The Subcontractor shall use non-hazardous, non-carcinogenic, and low- to no-odor chemicals.
- Needle Gun Lead-based paint may be removed by needle gun with the device fitted to HEPA
 vacuum system. Work shall be performed in a LBPA control area using negative pressure full
 containment with HEPA filtered exhaust. Adequate fire extinguishing and electrical resources
 shall be available.
- Water jetting without abrasives.
- Water jetting with abrasives is prohibited on all historical houses.
- Open abrasive blast cleaning with expendable abrasives is prohibited on all historical houses.
- Closed abrasive blast cleaning and recyclable abrasive is prohibited on all historical houses.
- Vacuum blasting is prohibited on all historical houses.
- Alternative techniques may be used only with prior written approval.

2 years on-the-job experience.

Paint removal methods that are not acceptable without the prior written approval:

- Dry scraping.
- Open flame burning or torching.
- Heat gun operating above 1,100°F.
- Machine sanding or grinding without a HEPA vacuum exhaust tool.
- Uncontained hydroblasting or high pressure wash. Abrasive blasting or sandblasting without a HEPA vacuum exhaust tool is Prohibited
- Methylene chloride chemical paint removers.

3.3.2 Lead-based Paint Encapsulation

Encapsulation of lead-based paint may be accomplished by on site encapsulation using a variety of products as listed in Section 2.5, "Product Requirements." The contractor shall provide a complete description of the recommended encapsulates in the LBPA Management Plan. This description shall include the chosen method(s) of application of each encapsulate recommended and a schedule of surfaces where the encapsulates is to be applied.

Encapsulating agents are also used in abrasive blasting compounds to chemically bond the lead in a non-leachable matrix. When the contract Scope of Work requires the use of abrasive blast in the blast media shall include an encapsulating agent. Lead paint waste generated by the use of these products shall be characterized using the TCLP test protocol from 40 CFR 261. Encapsulating agents will be used that result in the lead paint wastes being characterized as non-hazardous.

The recommended encapsulating agents, their proportions in the blast media, and their documented results in similar applications must be stated in the LBPA Management Plan.

3.4 METHODS OF COLLECTING DEBRIS

The contractor shall recommend the method of lead paint debris collection for each identified work zone in the LBPA Management Plan. Acceptable methods include the following. Alternative methods may be proposed by the contractor.

Localized collection at point of cleaning

Localized collection at point of cleaning, involves surrounding the coating, removal equipment with a localized containment enclosure equipped with a vacuum to permit the collection of the debris as it is being generated.

General area collection

General area collection involves the removal of paint debris from a containment structure that encloses the work area, workers, and tools rather than only enclosing, the removal tool itself.

3.5 MONITORING/SAMPLING

During the entire LBPA removal and disposal operations, and IH/Competent Person shall be on site directing the monitoring/sampling and inspecting the work to ensure that the health and safety requirements of this contract are satisfied.

3.5.1 Personal Air Monitoring

Airborne concentrations of lead shall be collected and analyzed in accordance with 29 CFR Part 1926, Section 62. Results shall be reported in micrograms per cubic meter of air. The Competent Person shall use personal air monitoring results to determine the effectiveness of engineering

controls, the adequacy of PPE and to determine if proper work practices are being employed. The government shall be notified if any personal air monitoring result equals or exceeds 30 micrograms per cubic meter of air. The SPORTENVDETCHASN shall take steps to reduce the concentration of lead in the air.

3.5.2 Wipe Sampling

- Wipe sampling for lead dust concentrations shall be conducted
- Preabatement to establish a baseline.
- During abatement to monitor activities and ensure containment integrity.
- Post abatement to determine if specified clearance criteria has been met.

Preabatement

Preabatement wipe samples shall be collected outside the LBPA control area in accordance with Section 3.2.4, "Preabatement Lead-Dust Wipe Samples." Samples outside the LBPA control work area shall be collected at critical barriers, in the clean room of the decontamination unit and in traffic control areas such as personal and equipment entrances.

Abatement

The SPORTENVDETCHASN shall collect wipe samples during all LBPA abatement activities on a daily basis. The samples shall be collected outside the LBPA control area in accordance with Section 3.2.4, "Preabatement Lead-Dust Wipe Samples." Samples shall be collected outside the LBPA control work area at critical barriers, in the clean room of the decontamination unit, and in traffic control areas such as personal and equipment entrances.

Results

The contractor shall have the results of the wipe sampling within 48 hours after the completion of the sampling. Results shall be reported in micrograms per square foot.

Excessive levels

LBPA abatement work being conducted within a LBPA control area shall be stopped if measured dust wipe concentration levels collected outside the containment area, during abatement, equal or exceed the preabatement levels or 30 micrograms per square foot. The Contractor shall immediately notify the government. At the direction of the government the contractor shall clean outside areas which equal or exceed the levels stated above. The cleaning shall be in accordance with Section 3.6, "Cleanup and Disposal," prior to clearance. The contractor shall collect and have analyzed additional wipe samples to ensure that the areas are clean. Cleaning and sampling shall continue until levels as stated above are achieved. The Contractor shall correct containment and/or work practices to mitigate the problem. Removal work shall resume when problem is corrected.

Post abatement

Post abatement samples shall be collected in accordance with Section 3.6.5, "Final Clearance" Testing.

3.5.3 Area Air Monitoring

Airborne concentrations of lead shall be collected (outside the work area where wipe sampling, is not practical) and analyzed in accordance with 29 CFR Part 1926, Section 62. Results shall be reported in micrograms per cubic meter of air.

Preabatement

Preabatement samples shall be collected in the following locations outside the work area; one upwind of the abatement and two downwind of the abatement activities.

Abatement

The IH/Competent Person shall collect area air samples on a daily basis. The samples shall be collected in the same location as the preabatement samples.

Results

The contractor shall have the results of the area air monitoring within 48 hours after completion of the sampling. Results shall be reported in micrograms per cubic meter of air.

3.5.4 Waste Sampling and Testing

Sampling and testing of all waste shall be in accordance with 40 CFR Part 261 and appropriate state equivalents.

3.5.5 Soil Sampling and Abatement

Preabatement

In order to establish baseline lead-in-soil conditions on the site prior to the initiation of lead abatement, composite soil samples shall be collected near the immediate area of abatement, and analyzed for total lead using EPA Method 7420 (or other procedures required by the state where work is being performed). A minimum of one sample shall be taken approximately 10 feet from the building line on each side of the building.

Soil Abatement

Excavate in 4 inch lifts, five feet wide in areas where Lead Survey indicated lead levels above 400 PPM. For those areas that still remain above 400 PPM, remove these "hot spots" to below 400 PPM and backfill with clean soil. Lead usually doesn't go deep into the soil from paint chips. It generally lives in the top inch. Do not remove trees or large bushes.

Post abatement

Post abatement soil samples shall be collected in the same locations as the preabatement samples utilizing the same procedures. If post abatement soil samples exceed the preabatement levels, The contractor will be required to perform soil excavation to a depth of 50 mm (two inches) in the area specified by the government. The soil shall be tested as specified in Section 3.6, "Cleanup and Disposal." Analysis that exceed TCLP limits shall be treated as LBPA contaminated waste and disposed accordingly.

3.6 CLEANUP AND DISPOSAL

3.6.1 Cleanup

The contractor shall begin final cleanup no less than 24 hours (unless notified otherwise) after final clearance and all materials, equipment, and debris have been removed. The entire work area including all surfaces shall be HEPA vacuumed free of paint debris and washed with a phosphate detergent.

3.6.2 Daily

Surfaces in the LBPA control area shall be maintained free of accumulations of paint chips and dust. Spread of dust and debris shall be restricted. Waste shall not be distributed over the work area. Dry sweep or compressed air shall not be used for cleanup. At the end of each shift, the area shall be cleaned of visible lead paint contamination by vacuuming with a HEPA filtered vacuum cleaner and wet mopping the area. LBPA work shall cease during the cleanup.

3.6.3 Prior to Clearance

Upon completion of the lead paint abatement and a satisfactory visual inspection by the Contractor and inspector in a given work area, a preliminary cleanup shall be performed by the Contractor. The cleanup includes removal of any contaminated material, equipment, or debris including polyethylene sheeting from the work area, except for critical barriers. The polyethylene sheeting shall be sprayed or misted with water for dust control, abatement debris removed, and then the sheeting removed by folding it in upon itself. Polyethylene sheeting used for critical barriers shall remain in place until final clearance criteria. The following methodology shall be utilized during the cleanup prior to clearance.

• Lead-contaminated debris shall be containerized in accordance with Section 3.6.8, "Contaminated Waste." Waste bags shall not be overloaded, shall be securely sealed and stored in the designated area until disposal. Hazardous waste shall be stored in compliance with the container requirements of 40 CFR 264.

- Uncontaminated debris shall be containerized, removed from the work area, and stored
 In the designated area until disposal in accordance with Section 3.6.8,
 "Uncontaminated Waste."
- Removal of surface polyethylene sheeting shall begin from upper levels such as cabinets
 and shelves. Removal of floor polyethylene sheeting shall begin at the corners and
 folded in the middle to contain the dust. Polyethylene shall be disposed of as specified
 for debris.
- Cleaning. Once the polyethylene sheeting, except critical barriers is removed from the
 work area, cleaning shall begin. It shall be done in the following sequence: HEPA
 Vacuum; Tri-Sodium Phosphate (TSP) wash (or equivalent cleaner); and HEPA
 Vacuum.
- HEPA vacuum. Vacuum all surfaces. Begin with ceilings and proceed down the walls
 including window, doors, door trim and ending with floors. Begin vacuuming at the
 furthest corner from the entrance to the work area.
- Wet wash. Wash or mop the surfaces vacuumed in the same sequence. Contractor shall utilize a trisodium phosphate (TSP) detergent solution or other equally effective cleaning accent and allow surface to dry.
- Cleaning equipment. The contractor shall prepare and use detergents containing five to ten percent TSP or other equally effective cleaning agent which shall be used in accordance with the manufacturer's instructions. The waste water from cleaning shall be contained and disposed of according to applicable Federal, state, county and local regulations and guidelines. The wastewater shall not be disposed of in storm sewers or sanitary sewers without authorization from the city of North Charleston.

3.6.4 Visual Inspection

Upon completion of the final cleaning, the contractor shall notify the government and request a final visual inspection by the SPORTENVDETCHASN's project superintendent and the ROICC. Specific clearance requirements will be provided in the Scope of Work for LBPA at the facility in question. If the area does not pass the visual inspection, (wipe samples) the SPORTENVDETCHASN shall clean the area as required by Section 3.6, "Cleanup and Disposal. Final clearance testing shall not proceed until final cleaning.

3.6.5 Final Clearance Testing

Final clearance surface dust sampling in accordance with HUD ACCN-5646 shall be conducted after a thorough cleanup has been completed in accordance with the following:

- On site paint removal in limited areas. Three samples shall be taken (one from a window sill, one from a window well, and one from the floor) in each area abated and one sample outside the containment area (within ten feet in 20 percent of the abated units). Preabatement wipe samples shall be compared to determine if dust from the abatement process has contaminated non-abated areas. The contractor cleanup these areas if contamination from the abatement process occurs.
- Replacement and/or encapsulation only in limited areas. One wipe sample shall be taken
 in each abated area divided equally between window wells, window sills, and floors, and one
 wipe sample outside the containment area (within ten feet in 20 percent of the abated units).
- Exterior abatement. At least one wipe sample shall be taken on a horizontal surface in part of the living area such as a front porch.
- Retests. Should laboratory results indicate that the wipe test clearance level is exceeded, the SPORTENVDETCHASN shall clean the affected area, at no additional cost to the government. The contractor shall utilize specified cleaning methods. Retesting will then be performed to determine if specified clearance criteria was met. The contractor shall pay for additional testing and shall provide, at no additional cost, a cleaning of an affected area until the clearance level is achieved.

3.6.6 Removal of Control Area

After approval of the final clearance certification the LBPA control area, containment barriers, and control structures roped-off boundary and warning signs shall be removed.

3.6.7 Disposal

Toxicity Characteristic Leaching Procedure (TCLP) results

The results of the TCLP analysis performed during abatement shall be used to determine disposal procedures.

Contaminated waste

Lead-contaminated waste, scrap, and debris shall be disposed of as follows:

• Lead-contaminated waste, scrap, debris, bags, containers, equipment, and lead-contaminated clothing,, which may produce airborne concentrations of lead particles shall be stored in U.S. Department of Transportation 49 CFR Part 178 approved 200 liter (55 gallon) drums. Each drum shall be labeled to identify the type of waste as defined in 49 CFR Part 172 and the date lead-contaminated wastes were first put into the drum. Uniform Hazardous Waste Manifest forms from federal and state agencies shall be obtained and completed. The manifest will be completed by the contractor; however, the base ROICC (or his designee) will sign as the generator. Land disposal restriction notifications shall be as required by 40 CFR Part 268. The government shall be notified at least 14 days prior to delivery to arrange for job site

inspection of the drums and manifests. Lot deliveries of hazardous wastes shall be made as needed to ensure that drums do not remain on the work site longer than 90 calendar days from the date affixed to each drum. The government will assign an area for interim storage of waste-containing drums.

 Lead-contaminated waste shall be handled, stored, transported, and disposed of in accordance with 40 CFR Parts 260, 261, 262, 263, 264, and 265. Land disposal restriction notification shall be as required by 40 CFR Part 268.

Disposal documentation

Written evidence shall be provided that the hazardous waste treatment, storage, or disposal facility is approved for lead disposal by the EPA and state or local regulatory agencies. One copy shall be submitted of the completed manifest, signed, and dated by the initial transporter in accordance with 40 CFR Part 262.

Uncontaminated waste

The SPORTENVDETCHASN shall be responsible for the segregation, storage (on site) and disposal of all uncontaminated solid waste. Disposal will be in accordance with all local, state, and federal regulatory requirements.

Project Submittal

For

Lead-Based Paint Abatement Project for Charleston Naval Shipyard Complex, Officer Single Family Housing

> Prepared for Environmental Detachment Charleston 1899 N. Hobson Avenue N. Charleston, S.C. 29405-2106

> Prepared By
> Cape Environmental Management, Inc.
> 2302 Parklake Drive
> Suite 200
> Atlanta, GA 30345



Project Submittal for Lead-Based Paint Abatement Project for Charleston Naval Shipyard Complex, Officer Single Family Housing Charleston, South Carolina

prepared for:

Environmental Detachment Charleston 1899 N. Hobson Avenue N. Charleston, S.C. 29405-2106

prepared by:


Cape Environmental Management Inc 2302 Parklake Drive, Suite 200 Atlanta, GA 30345-2907

TABLE OF CONTENTS


Section 1	Analytical Support
Section 2	Qualifications of Personnel – Documentations
2.1 2.2 2.3 2.4 2.5	Certified Industrial Hygienist (CIH) On-Site Industrial Hygienist (IH) Lead Abatement Supervisors and Workers Certificates Medical Records Respirator Fit Test
Section 3	Personal Protection Equipment and Engineering Control Equipment
3.1 3.2 3.3	Respiratory Protection Devices Cartridges, Filters and Vacuum Systems Protective Clothing
Section 4	Other Expendable Supplies and Chemicals
4.1 4.2	Supplies information/Catalog Chemicals including MSDS
	Appendix

Lead- Based Paint Abatement (LBPA) Management Plan

Section 1 Analytical Support

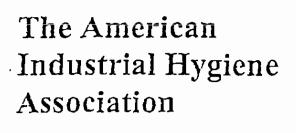


is proud to acknowledge that

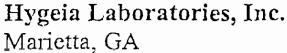

Laboratory ID# 9072

has fulfilled the requirements for Environmental Lead Laboratory Accreditation Program and has earned distinguished recognition as an

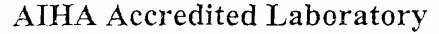

Current certificate effective October 1, 1997 to October 1, 2000, subject to continued compliance with AIHA accreditation criteria.

The above named laboratory participates in the following:

ELLAP - ELPAT matrices: Paint, Soil, Dust

The ELLAP program is recognized by the EPA as meeting the requirements of the National Lead Laboratory Accreditation Program established under Title X of the Residential Lead-Based Paint Hozard Reduction Act of 1992 and includes paint, soll and dust wipe analysis. Air analysis is not included as part of the NLLAP.

James C. Rock, Ph.D., PE, CIH

President, American Industrial Hygiene Association

Mark A. Puskar, Ph.D.

Chair, Analytical Accreditation Board

Certificate Number

ELPAT PROGRAM 076

ENVIRONMENTAL LEAD PROFICIENCY ANALYTICAL TESTING (ELPAT) PROGRAM INDIVIDUAL LABORATORY REPORT FOR ROUND 026 LAB ID=09072 MARCH 16, 1999 HYGEIA LABS INC., MARIETTA, GA 30066-6299

SAMPLE TYPE	SAMPLE NO.	REFORTED RESULTS	REFERENCE VALUES =	ACCEPTABLE LOVER	RANGE # UPPER	LAS 2 PERFORMANCE	Z & SCORE
Paint Chips (%)	1	0.0922	0.0942	0.0758	0.1125	Α	-0.32
	2	2.544	2.3956	1.9294	2.8618	A	0.96
	3	0.973	0.8519	0.6733	1.0305	A	2.03
	۷	5.7591	5.7041	4.3304	7.0779	A	0.12
Soil (mg/kg)	1	123.8	140,5	106,1	174.9	A	-1.46
	2	516.9	533.1	446,1	620.2	A	-0.56
	3	394.6	408.3	340.2	476.4	A	-0,60
	4	60.3	67.6	48.5	86.6	A	-1.15
Dust Wipes (ug)	1	101,6	93,4905	67.6	119.4	A	0.94
· -	2	282.5	272,5147	214.1	330.9	Α	0.51
	3	529.8	567.5491	459.9	675.2	A	-1.05
	4	105,1	119.0828	92.3	145.8	A	-1.57

- * Reference value is the mean of the reference laboratories
- # Upper limit: reference value + 3 standard deviations Lower limit: reference value - 3 standard deviations
- a A: Analysis acceptable; -: Results not reported
 K: Results > upper limit, t: Results < lover limit, not acceptable</pre>

& Z Score = (reported result-reference value)/standard deviation Note: the acceptablity of reported results is based on z-scores.

This is why a reported result may appear acceptable according to performance limits, but be identified as an outlier.

LABORATORY YEAR-TO-DATE PERFORMANCE REPORT LAS ID=09072

SAMPLE TYPE	ROUND NO.	ROUND * PERFORMANCE	ACCUMULATED 4 ROUNDS(%)		PERFORMANCE 2 ROUNDS(%)		PROFICIENCY RATING #	
Paint Chips (%)	023 024 025 026	L/4 2/4 4/4 4/4	14/16	87	8/ 8	100	P	
Soil (mg/kg)	023 024 025 026	4/4 4/4 1/4 4/6	13/16	81	5/8	62	Р	
Oust Wipes (Ug)	023 024 025 026	6/4 4/4 6/4	16/16	100	8/8	100	Р	

^{*} The denominators represent the number of total samples analyzed. The numerators represent the number of acceptable results.

[#] P : Proficient NP: Nonproficient -: Not Rated Performance ratings are based on accumulated results over four rounds (one year). A lab's performance in ground paint chips, soil, or dust wipes is rated proficient (P), if: 1) three-fourths (75%) or more of the occumulated results over four rounds are acceptable or 2) for the last two rounds, all samples are analyzed and the results are 100 % acceptable.

ELPAT PE RESULTS S

RY


type ANALYTE	ELPAT 14	ELPAT 15	ELPAT 16	ELPAT 17	ELPAT 18.	ELPAT 19	ELPAT 20	ELPAT 21	ELPAT 22	ELPAT 23	ELPAT 24	ELPAT 25	ELPAT 26
PC Po-1	AC	A.C	AC	AC	AC	AC	AČ	AC	AC	AC	LOW	AC	AC
PC P5-2	AC	ĀC	AC	AC	ĀC .	AC	ĀĊ	AC	AC	AC	AC	AC	AC
PC Po-3	AC	AC	AC	AC	ĀĈ	AČ	ĀĊ	AC	ĀČ	ÃC	AC	AC	AC .
PC Pb-4	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	LOW	AC	AC
SO P5-1	AC	AC	AC	ÄC	AC	AC	AC	AC	AC AC	AC	AC	LOW	AC
SO P5-2	AC	AC	AC	AC	AC .	AC	AC	AC	AC	AC	AC	AC	· AC
SO P5-3	AC	AC	AČ	AC	AC	AC	AC	AC	AC	AC	AC	LOW.	, AC
SO P5-4	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	LOW	AC
DW Pb-1	AC	AC	AC	AC	AC	AC	AC	AC -	AC	AC	AC	AC	AC
DW .Pb-2	AC	. AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	: AC
OW Pb-3	AC	, AC	AC	AC	AÇ	AC "	AC	! AC	AC	ÁČ	AC	AC	AC
DW Pb-4	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC	AC
TOTAL	. 12	12	12	12	12	12	12	12	· 12	12	12	12	12
Acceptable (AC	12	12	12	12	12	12	12	: 12	12	12	10	9	12
Not Acceptable (NA)	0	0	0	0	0	0	0	0	0	0	2	3	0
PC = Paint Chips	_P	L ; Р	P	<u>.</u> ! Р	, Ь	P		<u>:</u> P	! P	P	Р	<u> </u>	P P
SO = Soil	ρ	P	. Р	P	P	Р	Р	Р	P	Р	. P	Р	Р
DW = Dust Wipes	Р	<u> Р</u>	P	Р	Р	, <u>.P</u>	Ρ	Р	Ρ	P	Р	Ρ	Р
due date	3/4/96	! 6/3/96	9/4/96	12/2/96	3/3/97	6/2/97	9/3/97	: . 12/1/97	3/1/98	6/1/98	8/31/98	· 12/1/98	3/1/99
,		<u></u>	:	:		·	!	.	-	:			
: technique	ICP	ICP	ICP	FLAA	ICP	ICP	FL AA	FL AA	FL AA	FL AA	FLAA	FLAA	FLAA

Section 2 Qualifications of Personnel - Documentation

2.1 Certified Industrial Hygienist (CIH)

The

American Board of Industrial Hygiene® ABIH®

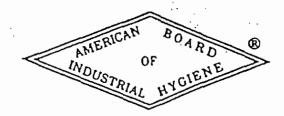

organized to improve the practice of Industrial Hygiene proclaims that

Michael Dennis Mount

having met all requirements through education, experience and examination, is hereby certified in the

COMPREHENSIVE PRACTICE of INDUSTRIAL HYGIENE

and has the right to use the designations

CERTIFIED INDUSTRIAL HYGIENIST

CIH

number

November 8, 1996	Terry & The Dell
date	Chair ABIH

CP 7228 Ray Y. Coment

rtificate Secretary ABI

ANALYTICAL ENVIRONMENTAL INTERNATIONAL TECHNOLOGIES, INC. LEAD BASED PAINT INSPECTOR TRAINING

CERTIFIES THAT

Michael D. Mount 424-90-6905

HAS SUCCESSFULLY COMPLETED REQUIREMENTS FOR THE

LBP INSPECTOR TRAINING 24 HOURS

HAVING SATISFIED THE REQUIREMENTS OF THE GEORGIA LEAD POISONING PREVENTION ACT, O.C.G.A., 31-41-1, ET SEQ. AND THE RULES FOR LEAD BASED PAINT, ABATEMENT AND CERTIFICATION CHAPTER 391-3-24.

CONDUCTED

7/27/98 - 7/29/98

BY ANALYTICAL ENVIRONMENTAL INTERNATIONAL TECHNOLOGIES, INC.

155 RIVER COURT PARKWAY, ATLANTA, GA 30328

Course Location: 585 Old Norcrons Rd. St.K Lawrencville, Ga

Serial Number: 2000 Passed Exam: 7/29/98 Expiration Date: 7/28/2001

> Ady Padan, PhD. Training Manager

ANALYTICAL ENVIRONMENTAL INTERNATIONAL TECHNOLOGIES, INC. LEAD BASED PAINT RISK ASSESSOR TRAINING

CERTIFIES THAT

Michael D. Mount 424-90-6905

HAS SUCCESSFULLY COMPLETED REQUIREMENTS FOR THE

LBP RISK ASSESSOR TRAINING 16 HOURS

HAVING SATISFIED THE REQUIREMENTS OF THE GEORGIA LEAD POISONING PREVENTION ACT, O.C.G.A., 31-41-1, ET SEQ. AND THE RULES FOR LEAD BASED PAINT, ABATEMENT AND CERTIFICATION CHAPTER 391-3-24.

CONDUCTED

7/30/98 - 7/31/98

BY ANALYTICAL ENVIRONMENTAL INTERNATIONAL TECHNOLOGIES, INC.

155 RIVER COURT PARKWAY, ATLANTA, GA 30328 Course Location: 585 Old Norcrons Rd. St.K Lawrencville, Ga

Serial Number: 1000 Passed Exam: 7/31/98 Expiration Date: 7/30/2001

> Ady Padan, PhD. Training Manager

MICHAEL D. MOUNT, CIH, OHST

Project Manager

Years Experience: 13

Education & Training:

BS Environmental Science, Troy State University, 1982
NIOSH 582 Sampling and Evaluation Airborne Asbestos Dust, 1984
OSHA 40 Hour HAZWOPER, 1994
EPA/AHERA Abatement Supervisor, 1994
Comprehensive Review For Industrial Hygiene Professionals, 1994
EPA/AHERA Inspector & Management Planner, 1996
Radiation Safety Training for XRF Instrumentation, 1994

Professional Registrations and Affiliations:

Certified Industrial Hygienist, #CP7228, ABIH, 1996
Occupational Health and Safety Technologist, #963, ABIH/BCSP, 1989
Member of Local and National American Industrial Hygiene Association
since 1990

Summary:

Mr. Mount brings 13 years of experience of industrial hygiene and environmental services to CAPE's Industrial Hygiene team. His experience includes performing industrial hygiene monitoring and safety surveys, environmental audits, indoor air quality surveys, and asbestos surveys; managing and supporting field staff during remediation projects; and analyzing air samples for particulate content using phase contrast and transmission electron microscopy. Management experience includes serving as program/project manager for large multi-disciplinary projects, as well as technical proposal preparation, fee negotiation, quality control, project start-up, staffing & planning, budgetary oversight, and cost estimating/cost control.

ENVIRONMENTAL MANAGEMENT I N C

Experience:

- Industrial Hygiene Surveys
- Asbestos Project Management/Design
- Lead Project Management/Design
- Air Monitoring Surveys
- IAQ Investigations
- Developing Health & Safety Programs

Representative Projects:

ţ.

- Site Safety Reviewer: February 1996 to present; BellSouth Telecommunications; Reviewed site safety plans for ongoing tank replacement program for over 100 sites located through out the Southeast.
- Site Safety and Health Manager: June to July 1997, Metropolitan Atlanta Transit Authority.
 Supervised site safety during removal of soil contaminated with petroleum hydrocarbons. Primary concerns were confined space entry, explosion hazards and benzene exposure.

- Noise Survey: July 1997; Beaulieu of America; Performed noise survey and frequency analysis at a
 nylon manufacturing operation to determine feasibility of abatement and selection of noise reductiontechniques and materials.
- Indoor Air Quality Survey: April 1997; General Service Administration. Performed indoor air
 quality survey at a GSA facility housing a social security and IRS offices. The survey included
 interviewing building occupants, collecting air samples, documenting environmental conditions, and
 inspecting HVAC systems. The data was analyzed and a report written with recommendations to
 correct the differences noted in the HVAC system.
- Project Manager: August 1997; BellSouth Telecommunications, Executive Park, Building No. 7.
 Developed and managed air sampling program during an asbestos abatement project that occurred over a communication system that was enclosed within the work area. The communication system was kept in operation throughout the 4-week project.
- Asbestos Program Development: March 1996-April 1997; Southern Division of the Navy; Managed
 asbestos survey performed at Naval Training Station in Jacksonville, Florida. Responsibilities
 included developing site safety plan, overseeing sample collection, cost estimating, data interpretation,
 developing written reports and O&M Program.
- Supervising Industrial Hygienist: February 1996; Institute of Paper Science and Technology, Atlanta, Georgia. Responsibilities included developing a sampling plan for formaldehyde in an industrial paper corrugation facility. He also supervised the sample collection and prepared the final report for the project.
- Industrial Hygienist: March 1994; Private Client, Responsibilities included sample collection and site safety at a USEPA superfund site contaminated with lead arsenate and using scanning electron microscopy techniques to identify the source of lead arsenate.
- Industrial Hygienist: May 1996; Service Painting Company, Monroe, Louisiana. Responsibilities included the development of a sampling plan and the collection of personal air samples to estimate employee exposure to airborne lead during sandblasting operations.
- Fly Ash Source Determination: July 1993; Bell and Pannel, PC Developed and executed sampling
 plan to determine extent of contamination of fly ash containing heavy metals throughout a residential
 area that surrounded the hazardous waste.
- OSHA Safety Audit: June 1990; Sheet Metal Manufacturer, Performed safety audit of a sheet metal
 manufacturing facility for site safety hazards. Project included review of OSHA 200 logs, facility
 walk through and process review.
- Laboratory Safety Manager: April 1992 to February 1996; MVA Inc., Responsibilities included
 developing, implementing, and managing the safety program of an analytical microscopy laboratory
 that utilized high voltage electron microscopes for determining molecular composition of known and
 unknown materials.
- Laboratory Analyst: April 1992-February 1996; MVA, Inc. Performed light microscopy and transmission electron microscopy analysis on various sample types to determine particle makeup or quantify the amount of toxic substances in material and dust samples.

- Industrial Hygienist: May 1992; Ness Motley Law Offices, Developed sampling strategy and collected samples to determine asbestos content of dust to be used as evidence in personal injury litigation cases.
- Industrial Hygienist: December 1989 to May 1997; US Sprint, Florida. Responsibilities included supervision of a multi-phased asbestos removal project. Specific tasks included conducting industrial hygiene surveillance and air monitoring, project documentation and on-site health and safety.
- Asbestos Surveyor: March 1987; Furman University, Greenville, South Carolina. Responsibilities
 included collection of suspect asbestos-containing bulk samples, documentation of the condition and
 location of the samples, recommended response actions and cost estimates.
- Asbestos Surveyor: March 1990 to December 1991; Emory University, Atlanta, Georgia.
 Performed asbestos surveys of chemistry, biology and geology buildings. The objective of these surveys was to identify existing asbestos containing materials so that proper consideration could be given them during yearly architectural planning meetings.
- Supervisor: April 1987 to August 1987; United Telephone of Florida, Naples, Florida. Responsibilities included developing a sampling plan and supervised air monitoring during asbestos abatement of a multi-story office building.

2.2 On-Site Industrial Hygienist (IH)

RESUME

ROBERT M. BEASLEY

POSITION:

Environmental Specialist

AEC

630 Duncan Ward Road

Seneca SC 29672

FIELD OF COMPETENCE:

Asbestos Project Management,

t Management, AHERA Asbestos Survey and Assessment

Asbestos Air Sampling

Supervision of Asbestos Abatement

Certified Phase Microscopist

Lead Risk Assessor

Lead Inspector

Project Management

CURRENT LICENSES:

SC Consultant(AHERA) / Building Inspector

SCDHEC License # 20896

SC Air Sampler

SCDHEC License # 20543

CURRENT E.P.A CERTIFICATIONS:

Lead Based paint Risk Assessment

Inspecting for Lead In Residences

KEY PROJECTS AND ASSIGNMENTS:

Asbestos Air Monitor:

Asbestos Air Monitor for Marine Logistics base in Albany, GA. Responsibilities included Asbestos Air area sampling and OSHA compliance sampling during asbestos abatement.

Job Duration: 2 Months

Client Contact: Harry Pepper and Associates

Phone: Jay 912-878-6920

Asbestos Air Monitor for Marine Recruit Depot, Parris Island, South Carolina.

Responsibilities included inspection for hazards and daily Asbestos area and Personal (OSHA) Air sampling.

Job Duration: 2 Months

Client Contact: The Adams Group, Inc.

Asbestos Air Monitor continued:

Asbestos Air/Lead Air Monitor for Michelin US1, located in Greenville, South Carolina Duties included asbestos air monitor for building owner. Acted as project manager for building owner to assure full compliance with all EPA and OSHA Laws.

Job Duration: 2 Months

Client Contact: Ed Long, Michelin USI

Phone: 864-458-6579

Asbestos Air Monitor for LaFrance Industries in LaFrance, South Carolina Provided asbestos air monitoring for building owner.

Job Duration: 1 Month

Client Contact: Jeff Galloway

Phone: 864-295-6400

Asbestos inspector:

Inspector of The City County Complex Located in Florence South Carolina. Inspection will facilitate upcoming renovations to the third floor jail facility.

Client Reference: Delaine R. Martin, Building Administrator (803)-679-0579

Inspector of the Landmark motel located in Myrtle Beach, South Carolina Duties included inspection and assessment for a building wide renovation.

Client Reference: Larry Timbes, Stevens and Wilkins Architects (803)-244-9898

Inspector Of more than 40 residential houses to be demolished for the City of Florence, South Carolina

Client Reference: Jeff Thomas, Rehabilitation Specialist (803)-665-3175

Asbestos Inspector continued:

Inspector of Wilson and McLeod Hospitals located in Florence, South Carolina. Air Monitoring was also performed during a building wide renovation for Wilson hospital. Duties included project management and project administration.

Client Reference: Dean Wallace, Director of Housekeeping (803)-667-2218

1990-1993 S&ME, Inc. Charlotte, North Carolina

Asbestos Specialist

Conducted air monitoring and analysis for the Veterans Hospital located in Asheville, North Carolina. Conducted Ashestos surveys for Clients such as The North Carolina. Department of Transportation, Owings Corning Fiberglas and many other clients.

1989-1990 Asbestos Environmental Consultants

Asbestos Specialist

Conducted air monitoring and analysis for Darlington County School Systems, Sonoco Products Company, James River Corporation, Baxter Travenol. Conducted Asbestos Surveys and Assessments for major building complexes and wrote asbestos removal specifications for projects as large as 100,000 S.F. and monitored abatement projects as large as \$250,000 in cost.

1987-1989 Mike Gaston, CIH, Inc.

Industrial Hygienist/Microscopist

In charge of the Washington D.C. Laboratory at the Berkshire apartments during a building wide renovation. Also served as project manager for asbestos abatement at the Berkshire apartments. Performed industrial hygiene services and air monitoring for Maryland Department of Transportation, Maryland Port Authority, Arlington Hospital Johns Hospital and many other place thoughout the tri-state area.

1984-1987 The Institute for Resource Management, Inc.

Industrial Hygienist/Microscopist

Conducted research in the asbestos abatement industry. Wrote procedures and specifications for the State of Maryland. Performed Defendant air monitoring for the State of Maryland.

ਾ-ucation:

. ∠y 15, 1987	Occupational Medical Center, NIOSH 582, Alrborne Asbestos Sampling and Evaluation Techniques.
June 16, 1988	Brujos Scientific, Inc. AHERA Supervisor Training
August 8, 1988	Georgia Institute of Technology, Inspecting Buildings for Asbestos
August 11, 1988	Georgia Institute of Technology, Managing Asbestos in Buildings
May 26, 1989	American Environmental Safety Institute, Inc., Supervision of Asbestos Abatement Projects Refresher
April 1990	American Environmental Safety Institute, Inc., Supervision of Asbestos Abatement Projects Refresher
October 26, 1990	Asbestos Abatement Associates, Inc., Management Planner Refresher
October 26, 1990	Asbeslos Abatement Associates, Inc., Inspector Refresher
February 7, 1991	Medical University of South Carolina, Supervision of Asbestos Abatement Projects Refresher
August 16, 1991	Medical University of South Carolina, Asbestos In Buildings, Management Planner Refresher.
August 16, 1991	Medical University of South Carolina, Asbestos In Buildings, Asbestos in Buildings, Inspector Refresher
·30, 1992	Medical University of South Carolina, Management planning for ACM in Buildings Refresher
July 30, 1992	Medical University of South Carolina, Inspecting ACM in Buildings Refresher
January 28, 1993	Medical University of South Carolina, Supervision of Asbestos Abatement Projects Refresher
August 16, 1993	Asbestos Abatement Associates, Inc. AHERA Building Inspectors Course
August 23, 1993	OSHA 1910.146 Permit Required confined space entry compliance training
February 19,1992	Asbestos Abatement Associates, Inc. AHERA Supervisor Training Refresher
March 19, 1993	Asbestos Abatement Associates, Inc., Field Sampling strategy Supplement to NIOSH 582
March 19, 1993	Asbestos Abatement Associates, Inc. Sampling and Evaluating Airborne Asbestos Dust. NIOSH 582, Revision # 3.
February 16, 1994	
October 12, 1995	Asbestos Abatement Associates, Inc. Inspecting Buildings for ACM Refresher

acation Continued:

March 7, 1990	Al IERA Supervisor Refresher Training Course, AAA Env.
June 17-19, 1996	Inspecting For Lead I lazards in Residences, Georgia Tech.
June 20-21, 1996	Lead based Paint Risk Assessment, Georgia Tech.
April 29, 1997	Inspecting for ACM in Buildings Refresher, Medical University of SC
Maiuli 12, 1997	Al IERA Supervisor Refreser Training Course, AAA Environmental
June 6, 1997	OSHA 40 Hour Health and Safety Training, Koch Environmental





The Georgia Institute of Technology

This is to certify that

Robert Beasley

has attended and satisfactorily passed an examination covering the contents of a Continuing Education Course entitled:

Inspecting for Lead Hazards in Residences

June 17-19, 1996

Dates of Artendance

June 19, 1996

Examination Date

Georgia Tech Research Institute Electro-Optics, Environment and Materials Laboratory Training Programs Office Atlanta, GA 30332

Phone: (404) 894-7430; FAK: (404) 894-8281

Vicki H. Amslie. Course Director

Exam Administrator

946

Certificate Number





The Georgia Institute of Technology

This is to certify that

Robert Beasley

has attended and satisfactorily passed an examination covering the contents of a Continuing Education Course entitled:

Lead-Based Paint Risk Assessment

June 20-21, 1996

Dates of Attendance

Georgia Tech Research Institute
Electro-Optics, Environment and Materials Laboratory
Training Programs Office
Atlanta, GA 30332
Phone: (404) 694-7430; FAX: (404) 894-8281

June 21, 1996

Examination Date

Course Director

Margie Brown, Exam Administrator

Vicki H. Ainslie.

491

Certificate Number

2.3 Lead Supervisors and Worker – Training Certificates

34851.4508CERT/

900 N.W. 5TH Avenue, Fort Lauderdale, Florida 33311

(954) 524-7208

This is to Certify that

Mayro Hidalgo



2302 Park Lake Drive, Allanta, GA

Processed By: Seaguille

Since 1971

has successfully completed an English

40 Hr. Lead Abatement Supervisor Course

17-May-99

TO

21-May-99

OHIO LEAD TRAINING PROVIDER NO. 0203 / VA APPROVED

Complies With All EPA, OSHA & HUD Guidelings

Trainer(s): Dc Starnes

TEST SCORE: 82 %

Training Address: 2759 Chamblee-Tucker Road, Atlanta, Ga

Student had passed the course test & hands-on assessment

This Certificate Expires

20-May-00



James F. Stump, Course Sponsor

Certificate Number......



Course Number

AT9920





34839.7852CERT/

900 N.W. 5TH Avenue, Fort Lauderdale, Florida 33311

(954) 524-7208

This is to Certify that

Luis Manuel Hidalgo



2930 Market Ct , Snellville, GA

has successfully completed an English

16 Hr. Lead Abatement Worker Course

15-May-99

TO

16-May-99

OHIO LEAD TRAINING PROVIDER NO. 0203 / VA APPROVED

Complies with OSHA & HUD Guidelines

Trainer(s): Charles Patterson

Training Address: 2759 Chamblee-Tucker Road, Atlanta, Ga

Student had passed the course test & hands-on assessment

This Certificate Expires

15-May-00



Processed By:



Since 1971

DER EMELAND CRIMINAL TERRITOR OF THE FOR MANYING OR SUBMESSON OF FALSE OFFERD DUTY TERRITOR OR TO PROVIDE THE FULL OF CRISIC (S. 613), I TILLY THIS TRAINING THE SECOND THE PULCABLE THE SECOND THE SE

IREMEDITADE TITLE IV CHARACTURE

", 422 P. PART 745 OR TO AI
EDUTATE TATE, OR LOC TO QUIRT

James F. Stump, Course Sponsor

Certificate Number...... 9 5 8

Course Number AT9919

34839.7846CERT/

900 N.W. 5TH Avenue, Fort Lauderdale, Florida 33311

(954) 524-7208

This is to Certify that

Vincente Hormiga



2224 Plaster Road, Atlanta, GA

has successfully completed an English

16 Hr. Lead Abatement Worker Course

15-May-99

TO

16-May-99

OHIO LEAD TRAINING PROVIDER NO. 0203 / VA APPROVED

Complies with OSHA & HUD Guidelines

Trainer(s): Charles Patterson

Training Address: 2759 Chamblee-Tucker Road, Atlanta, Ga

Student had passed the course test & hands-on assessment

This Certificate Expires

15-May-00





Since 1971

James F. Stump, Course Sponsor

Certificate Number...... 9 5 8 2 9



Course Number

AT9919



34839.7856CERT/

900 N.W. 5TH Avenue, Fort Lauderdale, Florida 33311

(954) 524-7208

This is to Certify that

Jose Gonzalez S.



2224 Plaster Road, Atlanta, GA

Processed By:

Seaguill

Since 1971

has successfully completed an English

16 Hr. Lead Abatement Worker Course

15-May-99

TO

16-May-99

OHIO LEAD TRAINING PROVIDER NO. 0203 / VA APPROVED

Complies with OSHA & HUD Guidelines

Trainer(s): Charles Patterson

Training Address: 2759 Chamblee-Tucker Road, Atlanta, Ga

Student had passed the course test & hands-on assessment

This Certificate Expires

15-May-00



James F. Stump, Course Sponsor

Certificate Number....... 9 5 8 4 Ø

Course Number AT9919

DIRECTOR: WILLIAM B CRYMES MD IF YOU HAVE ANY QUESTIONS CONTACT - BRANCH: 800-476-0747 LAB: 843-763-0588 LAST PAGE OF REPORT



FORIZON REPORT FORM #1

ीं ..

730 Precitives, NESULIS 100 ATLANTA, GA 30308
Phone: (404) 881-1155 Fax: (404) 881-6873
DEPARTMENT OF TRANSPORTATION EXAM

Address of Driver

Patien	t: Hidalgo, Mayro	Address:	2930 Market C	;t	Employer:	Marcor E	nvironmental	Services	Contact	: Denise Patters	son	
SSN:	590-70-0276				Address:	1600 Ros	well St. Ste 9	€	Role:			
	02/25/59	• . •	SNELLVILLE.	GA 30078		SMYRNA	, GA 30080		Phone:	(770) 319-655	6 Ext.	
ر. اب ن	r: M	Phone:	(770) 972-375	7	Auth. by:				Fax:			
Charles	PATIONAL HISTORY			PAIRMENT H	STORY			REVI	EW OF S			
PATIONAL HISTORY Y IN Have you ever been off work for more than one day due to job-related illness or injury? Y N Have you ever been hospitalized? PERSONAL HABITS Y N Do you smoke cigarettes now? Packs per day Years Y N Do you use chewing tobacco or snuff? Times per day Years Y N Do you drink alcohol? Orinks per week MEDICATIONS Y N Do you take prescription medication? List: FAMILY HISTORY Y N Serious heart disease before the age of 607 Y N Diabetes in the immediate family?				Decreased grip and si Decreased N Decreased ankles or I Permanen Any other	sion in either of a saving that rect function in a trength and the function in a function in the feet? It defect from nervous disourtiering from a would interfer and or operate	juires a hea either hand ne use of al neck or lowe ips, knees, Illness, dis rders; If ye another dis re with you	ering aid? including I fingers? er back? legs, ease, or injuries, explain: ease; If yes, or ability to: s machinery	Have	REVIEW OF SYSTEMS Have you ever had or been told you h Y N decreased vision in either eye Y N carpal tunnel syndrome Y N depression or other mental con Y N diabetes Y N epilepsy, seizure, fits, convulsion Y N fainting spells -Y N gastrointestinal ulcer/ nervous Y N gonorrhea Y N head or spinal injuries Y N head or spinal injuries Y N hernia Y N hernia Y N high blood pressure Y N kidney disease Y N iung problems/asthma Y N musculo-skeletal problems			
The aborder terminate to my en	we answers are true and ination. This also authoriting the physic on the physic of the	correct to the t ses release of a	est of my knowls any rijedical inform	dge and belief. I c nation, concerning examination.	inderstand that g my past or pre	falsification (may be ground	YN		ric problems/nem rordėjs	vous disorde	
Comm	ents: CAL EXAM											
General Height E Canal TM Vis Nose Teeth Throat Skin Neck Thyrold Chest Comm	Al Appearance: Good. S. Weight: 1. B/P/20: / of ex) B/P/25: / AB Clear AB Clear AB Clear AB	Pulse Lungs Heart Rhythm Auscultat If organ of present, I compens Abdomen Is a truss Tenderne Abd. surg.	ion AB isease fully ated? N Y worn? dp Y ss	Umbi Ingula Femo Varicox Urethra Upper Handsa Legs Knees	Rt (I	DOGGOGGGG YYYYAB YYYYAB YYYYAB	Knee surg. si Foot/ankles Varicosities Up. ext. strer Up. ext. ROM Low. ext. stre Low. ext. RO Back/spine R Back surg. so	car (digith (digith (digith (digith (digith (digith (digith (digith (digit))))))))	A B B B B B B B A C C C C C C C C C C C	th Perception (Indig to forced with feet) Reflexes Rinomberg PC Pupillary Rt Lt Accom. Rt Lt Bloeps Rt Lt Knee Rt Lt Ankle Rt Lt	SS	
	LARY STUDIES Júnalysis / ハム	ا	EKG Comments:	NL AB Se	e Results			udio (if A		rused) 004050	6000	
Spec.	Gravity // U	<u>5</u> 1	Lumbar X-Ray		e Results		B	lood anal	ysis r	NL AB See Re		
Albumi Sugar Kelone	112	4	Comments: _ Chest X-Ray Comments: _	NL AB Se	e Results		— ₊	Commen IPE	:s:	NL AB Sea Re		
Blood	<u>`</u>	1/2										
42:	MEDICAL EX	that'l have ex. Yeyro Hidelico. Micro Corrier Sa thi knowledge of hing corrective lens as accompanied and a heaning sid. 39 CFR 391.94 as driving withing	ERTIFICATE aminod fely Regulations (43 somer duries, 1 find in tes. by a	CFR Immer weiver GG.	PHYSICAL C N Able List Y Med List	rolled subs CLASSIFIC to perform failed essen ical restrict medical res	essential fun ntial function ions are India striction(s):	edormed notions as is): sated				
Marin.	11/3/2000	for	moforma	<u>~</u>	Signature: _	10	mp	nee	2 <u>e</u> m	Date:	1/3/	
1,(\$	078EN (?)	5.71-rect	Secretary of Medical En								/ /	

AMERICAN MEDICAL LABORATORIES, INC.®

P.O. Box 10841 • 14225 Newbrook Drive Chantilly, VA 20153-0841 Telephone: (703) 802-6900 • (800) 336-3718

JOSE, BOLTEADA

51127321/@

21 YEARS MALE

Page 1 From Chantilly

ATL:1:X

COLLECTED: 05/20/1999

FOR WAINSTEIN, J 31073 CONCENTRA — NORCROSS

RECEIVED:

05/21/1999

REPORTED: 05/21/1999

6475 JIMMY CARTER BLVD #200

1999/ 0/ 31073/ 0/29309080

NORCROSS GA 30071

-----RESULTS-FLAG--REF. RANGE-----UN1TS

2301/Chantilly

Zinc Protoporphyrin

18

ug/dL

Reference range (IRON DEFICIENCY):

A result > 35 ug/dL may indicate iron deficiency.

Reference range (LEAD EXPOSURE):

Adults: < 50 ug/dL indicates no excess lead exposure.

Children: This is not the screen recommended by CDC

for lead exposure in children.

*** FINAL REPORT ***

~ 34672]-[S 428]

Concentra Medical Centers
6475 Jimmy Certer BoulevardSuits 200 NORCROSS, GA 30071
Phone: (770) 242-7744 Fax: (770) 368-0164

PLHCP WRITTEN STATEMENT for RESPIRATORS (EMPLOYEE)

L	<u></u>			* (=:::: = + : = =)	<u>'</u>
Survice Date: 5	21/99				
Employee Name:	,		Employee SSN:	524-19-576	9
Bolteada, Jose A.			•		_
Address:		•			
2224 Plaster Rd		···			
ATLANTA	G₽	30345			
Employer: Cap	e Environment	tal Management			
You were evaluat	 ed in this offi	ce of your medical s	status related to your phy	/slcal capabilit	
to wear a respirate		-		,	•
	indings listed t	pelow were not relate	er your ability to perform y d to wearing a respirator b		
Based upon the	results of this	evaluation it is my	opinion that you: (Chec	⊸ sk ✓ ALL that	/vlaak
RE NOT qual sequire further concentra Me Must wear Spe Must use an Ey	ring restrictions ified to wear a testing by you dical Centers cial prescriptio /e glass conve	s concerning respirate respirator. If private physician won eye-wear needed to the sion kit.	or usage: tho must submit a written region so that a final decision to accommodate respirator on certain face masks.	eport of his/her to on your ability to	
use only. Employees This evaluation Include The above Individual Questionnaire in App to report any difficulti outlined in 29 CFR 11 In accordance with s exposures that may a	HAS been examined should be instructed the Respiratory (HAS NOT been examined C Part A Section of the Section o	I to report any difficulties in usi Questionneire outlined in 29 Co amined by me for respirator for ion 2. In accordance with 29 Co is or change of any physical standard in ab- aments, I have informed the ab- nation or treatment. Where applying and asbestos, lead and/o	ness. The employee's medical evaluation is FR 1910.134, this limited evaluation is table to their supervisor or physician. Second armed individual of the results of picable, the above named individual h	cal status to their super ion consisted of a revie a specific to respirator of this evaluation include this evaluation and of as been informed of the	rvisor or physicism. ew of OSHA's Medical Evaluation use only. Employees should be instructor id the Respiratory Questionnaire any medical conditions resulting from is increased risk of Jung cancer
and warnings for prop and result in sickness use and/or limitations.	er use contained on the or death. Wearer mus	he respirator packaging and/or f.	anuauon teveta to waten use worker with allure to wear the haspicator during all th I any respirator.Refer to product literatui	nes of exposure can red	tuce the respirator's effectiveness social information regarding fit.
YCP Signature 2e75 D P Name (p	ton me	<u>) </u>			Employee's Signatur 5/21/2000 Expiration Da

¹Physician or other Licensed Healthcare Professional To be maintained in the employee's file with a copy to the employee

AMERICAN MEDICAL LABORATORIES, INC.®

P.O. Box 10841 • 14225 Newbrook Drive Chantilly, VA 20153-0841 Telephone: (703) 802-6900 • (800) 336-3718

HERNANDEZ, LUIS

51127346/0

-----RESULTS-FLAG--REF. RANGE-----UNITS

20 YEARS

MALE

Page 1 From Chantilly

FOR

ATL:1:X

REPORTED:

COLLECTED: 05/20/1999

1999/ 0/31073/ 0/29309075

31073 CONCENTRA - NORCROSS

RECEIVED:

05/21/1999

05/21/1999

6475 JIMMY CARTER BLVD #200

NORCROSS GA 30071

2301/Chantilly

Zine Protoporphyrin

Ξ1

ug/dL

Reference range (IRON DEFICIENCY):

Alresult) 35 ug/dL may indicate iron deficiency.


Reference range (LEAD EXPOSURE):

Adults: < 50 ug/dL indicates no excess lead exposure.

Children: This is not the screen recommended by CDC

for lead exposure in children.

*** FINAL REPORT ***

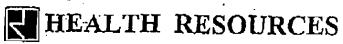


600 West Cummings Park, Suite 3400 Woburn, Massachusetts 01801-6350 Phone: (781) 935 - 8581; (800) 350 - 4511

Fax: (781) 938 - 4678

Surveillance Examination Medical Release For Job Placement

Employee's Name:	Hernandes, Luis		
Social Security No:	314-91-7388		1977
Company:	Marcor		
Company Branch:	2742 - Georgia		
Date Of Exam:	28 December 1998	• • • • • • • • • • • • • • • • • • • •	
Exam Location:	Concentra Medical	Center Atlanta, GA	
Medical Surveillance	Exam:		
KI Asbestos [7]	Hazmat Deleading	C Other	
🗷 Initial 🗀 F	Periodic 🗔 Exit	Other	
from work in the property of the property of the property of the property of this evaluation of this evaluat	medical condition which proposed job assignment, employee's assigned wo employee, it was determine noted which require fol	rk. Recommended limitations ned that the employee is pro- low-up before fitness can be Zinc Protoporphyrin testing w	pably fit for work, but laboratory
further examination o	r treatment. ations: The above employ	the examination and any med yee has been informed of the	nealth risks associated with
	d Physician	Signature	Date

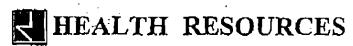

600 West Cummings Park, Suite 3400 Woburn, Massachusetts 01801-6350 Phone: (781) 935 - 8581; (800) 350 - 4511

Fax: (781) 938 - 4678

Certificate For Respirator Use 29 CFR 1910.134

Employee's Name:	Hernander, Lui	.5				
Social Security No: 314-91-7388						
Company:	Marcor					
Company Branch:	2742 - Georgia					
Date Of Exam:	28 December 19	98	···· • • ··· • ·· • ·· • ·· • ·· •			
Exam Location:	Concentra Medi	cal Cento	r Atlanta, GA			
I have examined the	above named Indivi	dual and I co	ertity that this employea:			
🔀 is physically capab	ie 🗀 Isn	ot physically i	capable			
of using a negative problems of using a negative problems.		d respirator	and/or powered air purifying	respirator subject to the		
•	Respirator use should be limited to air supplied or powered air purifying respirators. (positive pressure)					
No respirator use	if wheezing and sho	ortness of br	eath are evident.			
Comments:						
interference with a fa	ice-to-face pieces s	eal is not ac	rds cannot be worn with all ty ceptable. Contact lenses can	not be worn with any		
			ons indicate that contact lens	es should not be worn in		
areas where there m	ay be a likelihood of	chemical sp	Minten	(MM)		
Tom Winters H.D.	•	ж	1/00/11/	01/04/99		
Authorize	ed Examiner	•	Signature	Date		

AMERICAN MEDICAL LABORATORIES, INC.®

P.O. Box 10841 • 14225 Newbrook Drive . . Chantilly, VA 20153-0841 Telephone: (703) 802-6900 • (800) 336-3718

HIDALDO, LUIS

51127333/0

38 YEARS MALE

Page 1 From Chantilly

FOR

ATL:1:X

COLLECTED: 05/20/1999

05/21/1999

31073 CONCENTRA - NORCROSS

RECEIVED:

REPORTED: 05/21/1999

6475 JIMMY CARTER BLVD #200

1999/ 0/31073/ 0/29309078

NORCROSS GA 30071

-----RESTS-----UNITS

2301/Chantilly

Zinc Protoporphyrin

ug/dL

Reference range (IRON DEFICIENCY):

A result > 35 ug/dL may indicate iron deficiency.

Reference range (LEAD EXPOSURE):

Adults: (50 ug/dL indicates no excess lead exposure.

This is not the screen recommended by CDC Children:

for lead exposure in children.

*** FINAL REPORT ***

546721-[S 426]

Concentra Medical Centers 1051 Talbotton Road COLUMBUS, GA 21994 Phono: (706) 322-2511 Fax: (706) 322-0913 Physical Exam

Name: Hidalgo, Luis 🖃

SSN: 588-43-8921

Date: 04/22/99

Examination Results				
Able to perform essential functions as listed.				
Unable to perform all essential functions as listed. Please list failed essential function(s):				
No medical restrictions are indicated.				
The following medical restrictions are indicated:				
Recommend further evaluation.				
Remarks:				

JACK D. SHERRER, JR., M.D.

Physician Print Name Here

Physician's Signature

AMERICAN MEDICAL LABORATORIES, INC.®

P.O. Box 10841 • 14225 Newbrook Drive Chantilly, VA 20153-0841 Telephone: (703) 802-6900 • (800) 336-3718

HORNAGA, VINCENTE

51127464/0

32 YEARS

MALE

Page 1 From Chantilly

ATL:1:X

COLLECTED: 05/20/1999

31073 CONCENTRA - NORCROSS

RECEIVED:

05/21/1999

05/21/1999

6475 JIMMY CARTER BLVD #200

REPORTED:

1999/ 0/ 31073/ 0/29309079

NORCROSS GA 30071

-----RESULTS-FLAG--REF. RANGE-----UNITS

FOR WAINSTEIN, J

2301/Chantilly

Zine Protoporphyrin

18

uq/dL

Reference range (IRON DEFICIENCY):

A result > 35 ug/dL may indicate iron deficiency.

Reference range (LEAD EXPOSURE):

Adults: (50 ug/dL indicates no excess lead exposure.

This is not the screen recommended by CDC Children:

for lead exposure in children.

*** FINAL REPORT ***

546721-[S 427]

Concentra Medical Centers

6475 Jimmy Carler BoulevardSuite 200 NORCROSS, GA 30071 Phone: (770) 242-7744 Fax: (770) 368-0164

... PLHCP WRITTEN STATEMENT for RESPIRATORS (EMPLOYEE)

/ice Da	te: <u>5/21/99</u>			
loyee انہ ّ اَ	Name:		Employee SSN:	472-87-2365
<u>Hormiga, Vi</u>	incente			
Address:			:	
2224 Plaste	er Rd			
				
ATLANTA	GA	30345		
Employer:	Cape Environmental I	fanagement		
You were	evaluated in this office	f your medical status	related to your phys	ical capability
to wear a r	espirator. (Check 🗸 <u>on</u>	that applies)		
☐ The abr	vere no abnormal findings normal findings listed belo al physician for further eva	w were not related to w	ur ability to perform you vearing a respirator but	ur job duties while wearing a respirator. I should be reported to your
•	on the results of this ev	•	ion that you: (Check	✓ ALL that apply)
	alified to wear a respirato			
	e following restrictions co		age:	
LI ARE NO	OT qualified to wear a res	pirator.		
	further testing by your p			•
	ntra Medical Centers			n your ability to wear a respirator can be mad
	ear Special prescription e		ommodate respirator.	
	se an Eye glass conversion ed to shave Facial hair to		artain face masks	
	stop smoking.	assure tight sear on co	itali lace masks.	
(Check ✓	ALL that apply)			
				ed evaluation is specific to respirator
-	Employees should be instructed to re ation included the Respiratory Ques			status to their supervisor or physician.
☐ The above	individual HAS NOT been examine	d by me for respirator litness. Th	e employee's medical evaluation	consisted of a review of OSHA's Medical Evaluation
				pecific to respirator use only. Employees should be instructed s evaluation included the Respiratory Questionnaire
•	29 CFR 1910.134.	rionge of any physical status to t	their sopervisor or physician. The	s evaluation included the Respiratory Odesitorinalite
_				is evaluation and of any medical conditions resulting from
	e to the combined effect of smoking	•••		been informed of the increased risk of lung cancer
and warnin	ngs for proper use contained on the re	pirator packaging and/or failure to	wear the respirator during all time:	exposed. Failure to follow the use and fitting instruction to of exposure can reduce the respirator's effectiveness and packaging for specific information regarding fit,
-				10-1 11 11 1
011100.0) religio m			Employee's Signature 5/81/2000 Expiration Date
PLHCP S				Employee's Signature
-25	ame (printed)			<u> </u>
ICP N	ame (printed)			Expiration Date

ician or other Licensed Healthcare Professional

To be maintained in the employee's file with a copy to the employee

Print Date: 05/21/99 13:57 Revision Date: 08/31/98

Concentra Medical Centers 6475 Jimmy Carter BoulevardSuite 200 NORCROSS, GA 30071 Phone: (770) 242-7744 Fax: (770) 368-0164

Medical Surveillance - Asbestos

Patient:	Hormiga, Vincente	Job Title:				
SSN:	472-87-2365	Employer:	Cape Environmental Manageme			
DOB:	07/19/66		2302 Parklane Dr Suite 200	- · -		
Gender:	M					
Marital Status:	M		ATLANTA, GA 30345			
Address:	2224 Plaster Rd	Job Contact:	Juan Hernandez			
	ATLANTA, GA 30345	Phone:	(770) 908-7200 Ext.:			
Home Phone:	(404) 325-8939	—— Fax:	(770) 908-7219			
Work Phone:						
WOLK FROME.	Ext.:	Race:	ASIAN BLACK HISPANIC INDI	AN WHITE OTHER		
The above individ	dual was seen on 05/21/99	in accordance with:	29 CFR 1926.1101. 40 CFR 763.121.			
The following w	as performed:					
	on and review of the standardize y, cardiovascular, and gastroint		and work history with special emphas ndix D in 1926.1101.	is directed to the		
			they relate to the employee's exposu on equipment to be utilized by the em			
Review of	Review of information from previous medical examinations if available.					
A physica	A physical examination with emphasis upon the pulmonary, cardiovascular, and gastrointestinal systems.					
A pulmona						
A chest roentgenogram, posterior-anterior, 14x17 inches (or current film on file) with interpretation in accordance with 29 CFR 1926.1101. (M)(2)(ii)(C).						
NOTE: A		(M)(2)(ii)(C), it is up to the	e discretion of the physician whether o	or not a chest X-ray		
from asbe			exam and of any medical conditions the combined effect of attributable to the combined effect of			
employee at an inc		mpairment from exposure	etected medical conditions that would to asbestos, and there are no recom- pment or respirator.			
Comments or limit	ations (if any):					
		11				
		Saltono	5/4	199		
	Pro	vider Signature		Date		

Revision Date: 03/31/98

Service Date: 05/21/9

AMERICAN MEDICAL LABORATORIES, INC.®

P.O. Box 10841 • 14225 Newbrook Drive Chantilly, VA 20153-0841 Telephone: (703) 802-6900 • (800) 336-3718

GONZALES, ABRAHAM

51127456/0

24 YEARS MALE

Page 1 From Chantilly

FOR WAINSTEIN, J ATL:1:X

COLLECTED: 05/20/1999

31073 CONCENTRA - NORCROSS

05/21/1999 RECEIVED:

6475 JIMMY CARTER BLVD #200

REPORTED: 05/21/1999 1999/ 0/31073/ 0/29309073

NORCROSS GA 30071

-----RESULTS-FLAG--REF. RANGE-----UNITS

2301/Chantilly

Zinc Protoporphyrin

ug/dL

Reference range (IRON DEFICIENCY):

A result > 35 ug/dL may indicate iron deficiency.

Reference range (LEAD EXPOSURE):

Adults: < 50 ug/dL indicates no excess lead exposure.

Children: This is not the screen recommended by CDC

for lead exposure in children.

*** FINAL REPORT ***

[Navi4678]-[S 421]



600 West Cummings Park, Suite 3400 Woburn, Massachusetts 01801-6350 Phone: (781) 935 - 8581; (800) 350 - 4511


Fax:

(781) 938 - 4678

Certificate For Respirator Use 29 CFR 1910.134

Employee's Name;	Gonzales, Abrahan					
Social Security No:	514-83-9030 Marcor					
Company:						
Company Branch: 2742 - Georgia						
Date Of Exam	28 December 1998					
Exam Location:	Concentra Hedical Center Atlanta, GA					
I have examined the	above named individual and I certify that this employee: le					
of using a negative following restrictions	pressure, air supplied respirator and/or powered air purifying respirator subject to the					
Respirator use should be limited to air supplied or powered air purifying respirators. (positive pressure)						
: No respirator use	e if wheezing and shortness of breath are evident.					
Comments:						
interference with a f supplied air respirate areas where there m Tom Wincers M.D.	yeglasses, contact lenses or beards cannot be worn with all types of respirators. Any face-to-face pieces seal is not acceptable. Contact lenses cannot be worn with any or. General safety recommendations indicate that contact lenses should not be worn in may be a likelihood of chemical splashes. O1/04/99 ed Examiner Signature Date					

4.69/61

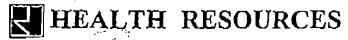

600 West Cummings Park, Suite 3400 Woburn, Massachusetts 01801-6350 Phone: (781) 935 - 8581; (800) 350 - 4511

Fax: (78

(781) 938 - 4678

Surveillance Examination Medical Release For Job Placement

Employee's Name:	Gonzal	es, Abraham				
Social Security No:	514-83	-9030				
Сотрапу:	Karcor					
Company Branch:	2742 -	Georgia				
Date Of Exam:	28 Dec	ember 1998				
Exam Location:	Concen	tra Medical (enter Atl	anta, GA		110
Medical Surveillance	Exam.					
Asbestos □ F	lazmat	Deleading	C Other			
ি ি নি	Periodic	□ Exit	[.] Other			
I have not detect impairment from I have detected a from work in the f	ed any m work. a medical proposed a employe	edical condition of condition which is job assignment. e's assigned wor	which would place a	olace the er in employer inded limitat	nployee at e at increa ions are:	tions and in my opinion: increased risk of health sed risk of health impairment
abnomalities we	re noted r aluation,	which require foll Blood Lead and I	aw-up before Zinc Protopci	fitness car phyrin testi	i be detern	it for work, but laboratory nined. arformed at an OSHA-CDC
Other:	, , , , ,					
I have informed the efforther examination of			the examinat	ion and any	r mediçəl d	onditions which require
For asbestos examir smoking and asbesto		•	yea has been	informed a	f the healt	h rīsks associated with
Ton Winters M.D			· Mr	Signatur	(MY)	01/04/99

AMERICAN MEDICAL LABORATORIES, INC.®

P.O. Box 10841 • 14225 Newbrook Drive Chantilly, VA 20153-0841 Telephone: (703) 802-6900 • (800) 336-3718

GONZALEZ, JOSE

51127341/0

21 YEARS MALE

Page 1 From Chantilly

FOR

ATL:1:X

COLLECTED: 05/20/1999

31073 CONCENTRA - NORCROSS

RECEIVED:

05/21/1999

6475 JIMMY CARTER BLVD #200

REPORTED: 05/21/1999

NORCROSS GA 30071

1999/ 0/31073/ 0/29309074

-----TESTS-----RESULTS-FLAG--REF. RANGE-----UNITS

2301/Chantilly

Zinc Protoporphyrin

ug/dL

Reference range (IRON DEFICIENCY):

A result > 35 ug/dL may indicate iron deficiency.

Reference range (LEAD EXPOSURE):

Adults: (50 ug/dL indicates no excess lead exposure.

Children: This is not the screen recommended by CDC

for lead exposure in children.

*** FINAL REPORT ***

Ew 4672]-[S 422]

EQ.9 JATOT

Tom Winters M.D.

Authorized Examiner

==



600 West Cummings Park, Suite 3400 Woburn, Massachusetts 01801-6350 Phone: (781) 935 - 8581; (800) 350 - 4511

Fax: (781) 938 - 4678

Certificate For Respirator Use 29 CFR 1910.134

Employee's Name:	jose gonzalez				
Social Security No:	53166- 3554				
Company:					
Company Branch:	2742 - Georgia				
Date Of Exam:	28 December 1998				
Exam Location:	Concentra Medical Center Atlanta, CA				
Is physically capable of using a negative p following restrictions: Respirator use she (positive pressure)	ould be limited to air supplied or powered air purifying respirator subject to the				
Comments:					
nterference, with a fact upplied air respirator.	glasses, comact lenses or beards cannot be worn with all types of respirators. Any e-to-face pieces seal is not acceptable. Contact lenses cannot be worn with any General safety recommendations indicate that contact lenses should not be worn in the a tikelihood of chemical splashes.				

Signature

01/04/99

Date

Concentra Medical Centers
6475 Jimmy Carter BoulevardSuite 200 NORCROSS, GA 30071
Phone: (770) 242-7744 Fax: (770) 368-0164

.. PLHCP1 WRITTEN STATEMENT for RESPIRATORS (EMPLOYEE)

	_	
ice Date: <u>5/21/99</u>		
Employee Name:	Employee SSN:	531-66-3545
Gonzalez, Jose S.		
Address:	:	
2224 Plaster Rd		
LAWRENCEVILLE GA 30045		
Employer: Cape Environmental Management		
You were evaluated in this office of your medical st to wear a respirator. (Check 🗸 one that applies)	atus related to your phys	sical capability
There were no abnormal findings that would hampe The abnormal findings listed below were not related personal physician for further evaluation.	r your ability to perform you to wearing a respirator bu	ur job duties while wearing a respirator. t should be reported to your
Based upon the results of this evaluation it is my o	ppinion that you: (Check	✓ <u>ALL</u> that apply)
ARE qualified to wear a respirator.		•
Have the following restrictions concerning respirato	r usage:	
\square ARE NOT qualified to wear a respirator.		
equire further testing by your private physician wh		
oncentra Medical Centers		n your ability to wear a respirator can be ma
ust wear Special prescription eye-wear needed to Must use an Eye glass conversion kit.	accommodate respirator.	
☐ May need to shave Facial hair to assure tight seal of	on certain face masks	
Need to stop smoking.	ar contain 1800 mesns.	
(Check ALL that apply)		
The above individual <u>HAS</u> been examined for respirator fitness in accordance use only. Employees should be instructed to report any difficulties in using		
This evaluation included the Respiratory Questionnaire outlined in 29 CFI	R 1910.134.	
The above individual HAS NOT been examined by me for respirator fitne		
Questionnaire in Appendix C Part A Section 2. In accordance with 29 CFI to report any difficulties in using respirators or change of any physical sta	_	
outlined in 29 CFR 1910.134.	aad individual of the secules of the	sis evaluation and of any medical conditions seculting from
In accordance with specific OSHA requirements, I have informed the abo exposures that may require further explanation or treatment. Where applications in the contract of the		
attributable to the combined effect of smoking and asbestos, lead and/or	other chemical exposure(s).	
Respirators must be properly selected based on the containment and concen- and warnings for proper use contained on the respirator packaging and/or fail and result in sickness or death. Wearer must be trained in the proper care of a use and/or limitations.	lure to wear the respirator during all time	s of exposure can reduce the respirator's effectiveness
m		Employee's Signature
PLHCP Signature		(Employee's Signature
JAF Duttonmo		
CP Name (printed)		Expiration Dat
gian or other Licensed Healthcare Professional		

To be maintained in the employee's file with a copy to the employee

05/21/99 10:48

Page 1 of 1

08/31/98 Revision Date:

Print Date:

Employee Name: Mayro C. A	Hidali.
Social Security #: 590 75	.0776
Test Date: 5/28/59 Last Date Tested:	
Test Data	·
Respirator Manufacturer:	
Type: Model:	Size: <u>Medium</u>
Initial Fit OK YE	s_ Wo
Successful Negative Pressure Test YE	s NO
Successful Positive Pressure Test YE	s_/, NO
Successful Irritant Smoke Test YE	s NO
NOTE: If any answer is "NO", retesting and/or r model, or size) is in order.	espirator change (manufacturer,
Explain any other tests employed:	
 .	<u> </u>
Middle	Michael D. Mont
Employee Signature	ester's Signature

Employee Name:	¿ A. Bolfeada
	sted: NA Next Expected Test Date: 5/28/00
Respirator Manufacturer: Noth	Test Data Nodel: 7700-30 size: M
Initial Fit OK	YESNO
Successful Negative Pressure Test	YESNO
Successful Positive Pressure Test	YESNO
Successful Irritant Smoke Test	YES NO
NOTE: If any answer is "NO", model, or size) is in order.	retesting and/or respirator change (manufacturer,
Explain any other tests employed:	
Lose' A. Bolfea Employee Signature	Tester's Signature

Employee Name: <u>โซโฮ</u>	Hernandez T
Social Security #: 314. Test Date: 05-28-99 Last Date:	Tested: Next Expected Test Date: 05/8/00
Respirator Manufacturer: NOT	Test Data 6V/P/00 The Filter 7581 P/00 Model: 7700 Size: M
Initial Fit OK Successful Negative Pressure Test Successful Positive Pressure Test Successful Irritant Smoke Test	YES NO NO YES NO NO
model, or size) is in order. Explain any other tests employed:	", retesting and/or respirator change (manufacturer,
Employee Signature	E. Twall S. Mour

Employee Name: <u>Luis</u> <u>X</u>	nanuel Hidalgo
Social Security #: 589 -	93 - 8921 d: <u>WA</u> Next Expected Test Date: <u>5/28/00</u>
Test Date	next Expected Test Date: 5/28/CO
	Test Data
Respirator Manufacturer: North	7581 P100 OV/P100 del: 7700-30 size:
Type: 12 1/P Mod	del: 7700-30 Size:
Initial Fit OK	YES VO
Successful Negative Pressure Test	YES NO
Successful Positive Pressure Test	YESNO
Successful Irritant Smoke Test	YES NO
NOTE: If any answer is "NO", rete model, or size) is in order.	sting and/or respirator change (manufacturer,
Explain any other tests employed:	· · · · · · · · · · · · · · · · · · ·
	<u> </u>
	·
Luis Manuel Hidal 9	Mikald Moul
Employee Signature	Tester's Signature

M0130002

	•
Employee Name: Alince	ente Hormiga
Social Security #: _ 472	187/2365
Test Date: 05/29/99 Last Date	Tested: N/A Next Expected Test Date: 5/28/00
	Test Data
Respirator Manufacturer: Nor/5	7700-30M . MOSH 7581 Ploo
Type: 1/2 face NP	Model: 7700-30m Size: Medium
Initial Fit OK	YES NO
Successful Negative Pressure Test	YES NO
Successful Positive Pressure Test	YES NO
Successful Irritant Smoke Test	YES NO
NOTE: If any answer is "NO model, or size) is in order.	, retesting and/or respirator change (manufacturer,
Explain any other tests employed:	
Vincente Hornigo	- KRM
Employee Signature	Tester's Signature

Employee Name: <i>Abraho</i>	am Zonralez Santos
	- 38-9030
Test Date: 05/28/Pf Last Date 7	Tested: Next Expected Test Date: 5/28/00
· .	
	Test Data
Respirator Manufacturer: WOY/L	7700-30M NIOSH 7581 P100
Type: Y2face NP	Model: 7700-30 Size: Madium
Initial Fit OK	YESNO
Successful Negative Pressure Test	YES NO
Successful Positive Pressure Test	YES NO
Successful Irritant Smoke Test	YES NO
NOTE: If any answer is "NO" model, or size) is in order.	, retesting and/or respirator change (manufacturer,
Explain any other tests employed: _	
Abraham Zoncalez	5. KIRM
7 Employee Signature	Tester's Signature

·	
Employee Name: <u>Tosť E</u>	Ochzáliz S.
Social Security #: <u>₹₹/ 6 6</u>	-7554
Test Date: <u>05/28/99</u> Last Date Teste	d: Next Expected Test Date: 5/28/00
•	•
	Test Data
Respirator Manufacturer:Novik	7700-30M. NIOSH 7581P100
Type: 1/2 fa Ce Np Mod	del: 7700-30m Size: Medium
Initial Fit OK	YESNO
Successful Negative Pressure Test	YES NO
Successful Positive Pressure Test	YES NO
Successful Irritant Smoke Test	YES NO
NOTE: If any answer is "NO", retemodel, or size) is in order.	esting and/or respirator change (manufacturer,
Explain any other tests employed:	
·	
Jose Bonzalez S	- 11 1 P 11
,	
Employee Signature	Tester's Signature

Section 3

Personal Protection and Engineering Control Equipment

3.1 Respiratory Protection Devices



NORTH MODEL 7780 RESPIRATOR

Suitable for use in asbestos concentrations not in excess of 2 fibers/cc TWA and/or 10 fibers/cc EL (10 X PEL).

The Model 7780 Respirator is a half mask air-purifying respirator equipped with N7500-8 high efficiency filtercartridges.

The North 7700 Series half mask silicone facepiece has become the standard by which all respirators are judged. Put that together with the North high efficiency filtercartridges, and you have half mask protection that can't be beat.

Its silicone construction readily conforms to facial features and doesn't harden with age. Silicone is easy to clean, and provides a non-stick, no slip surface. It stands up to punishment better than any other facepiece material.

To further promote worker acceptance. the 7780's contoured sealing flange eliminates the discomfort caused by pressure points. And the cradle suspension system won't slip, yet gives an even seal without irritating pressure.

The low profile of the North 7780 gives workers a wide field of vision and room for protective eyewear. Its low inhalation and exhalation resistance make breathing easier, leaving more energy for getting the

job done.

All of this, and low maintenance, too. Just unscrew the filter/cartridges and drop the facepiece into the wash. The direct cartridge-to-facepiece seal means no cartridge receptacles to clean and no sealing gaskets to lose or replace. The silicone rubber facepiece can take a lot more cleanings and still come out soft and flexible.

Available in three overlapping sizes, the 7780 delivers secure, comfortable fit to a large number of respirator wearers. A slide/tape presentation on use and fitting instructions is available from North.

The 7700 Series is also NIOSH/MSHA approved for use with combination chemical cartridge and HEPA filters. See filter cartridge section below for details.



NORTH HEPA FILTER/CARTRIDGES

FOR NIOSH/MSHA Certified Respirators

A high efficiency (HEPA) filter/cartridge is a NIOSH/MSHA certified filter that is at least 99.97 percent efficient against monodispersed particles 0.3 micrometers or larger (#52473)

Model N7500-8 filter/cartridge (TC-21C-152): Approved for respiratory protection against dusts. Jumes, and mists having a time-weighted average less than 0.05 milligram per cubic meter asbestos and radionuclides.

**Model 9800-8 filter/cartridge (TC-21C-481): For respiratory protection against dusts, fumes, and mists having a time-weighted average less than 0.05 milligram per cubic meter, asbestos containing dusts and mists, radionuclides and radon daughters.

Model N7500-81 filter/cartridge (TC-23C-204): Approved for respiratory protection against: (1) mists or paints. lacquers and enamels, (2) not more than 1.000 parts per million organic vapors by

volume, or (3) any combination thereof. dusts, fumes, and mists having a timeweighted average less than 0.05 milligram per cubic meter asbestos, radionuclides, and radon daughters.

*Model N7500-82 filter/cartridge (TC-23C-207): Approved for respiratory protection against not more than 10 parts per million chlorine, 50 parts per million hydrogen chloride, or 50 parts per million sulfur dioxide and dusts, fumes, and mists having a time-weighted average less than 0.05 milligram per cubic meter asbestos. radionuclides, and radon daughters. *Model N7500-83 filter/cartridge

(TC-23C-210): Approved for respiratory protection against not more than 1000 parts per million organic vapors, 10 parts per million chlorine, 50 parts per million hydrogen chloride, or 50 parts per million sulfur dioxide and dusts, fumes, and mists having a time-weighted average less than 0.05 milligram per cubic meter asbestos. radionuclides, and radon daughters.

*Model N7500-84 filter/cartridge (TC-23C-213): Approved for respiratory protection against not more than 300 parts per million ammonía or 100 parts per million methyl amine and dusts, fumes, and mists having a time-weighted average less than 0.05 milligram per cubic meter asbestos, radionuclides, and radion daughters.

* For use with 7600 and 7700 Series respirators only.

For use with Model 9890 Powered Air Purifying Respirators only.

NORTH

5500 & 7700 Series

Half Mask Air

Purifying

Respirator

Operating and Maintenance Instruction Manual

©1996 Siebe North Inc. Printed in U.S.A.

Part No. 46000375

CONTEN	TS	PAGE
CONTEN 1	INTRODUCTION IMPORTANT INFORMATION TERMINOLOGY GENERAL WARNINGS USER REQUIREMENTS TRAINING PROGRAM FIT TESTING PERIODIC FIT CHECKS RESPIRATOR DESCRIPTION PRE-USE INSTRUCTIONS FACEPIECE PRE-FILTERS ASSEMBLING THE RESPIRATOR TO PUT ON THE RESPIRATOR USE SERVICE LIFE CARTRIDGES PARTICULATE FILTERS TO TAKE OFF THE RESPIRATOR TURNAROUND MAINTENANCE AIR-PURIFYING ELEMENT REPLACEMENT PRE-FILTERS CARTRIDGES INSPECTION	
8	STORAGE PERIODIC MAINTENANCE	18
8.1 8.2 9 10 11 11.1	CLEANING AND SANITIZING PREPARE FOR USE REPLACEMENT PARTS ACCESSORIES KEY TO CAUTIONS AND LIMITATIONS CONTAINED IN NIOSH APPROVAL LABELS SPECIAL USER'S INSTRUCTIONS	20

NORTH

North Safety Products Safety Equipment Division 2000 Plainfield Pike Cranston, RI 02921-2019 401-943-4400

Cust. Service: 800-581-0444 FAX: 800-572-6346

In Canada North Safety Products Siebe North Canada Ltd. 26 Dansk Court Etobicoke Ontario Canada M9W 5V8 416-675-2810 FAX: 416-675-6898

1 INTRODUCTION

North Air-Purifying respirators are intended to be used for respiratory protection against hazardous vapors, gases and/or particulate matter, depending on the air-purifying elements used and the contaminant concentration and/or toxicity; but only if there is sufficient oxygen present in the contaminated atmosphere to support life. These respirators are approved by the National Institute of Occupational Safety and Health (NIOSH) and are suitable for use in workplaces regulated by the Occupational Safety and Health Administration (OSHA).

1.1 IMPORTANT INFORMATION

This Operating and Maintenance Instruction Manual contains important information and must be completely read and understood by all persons who may use or maintain this respirator.

This Respirator should be used or maintained only by persons who understand the instructions contained within this manual.

1.1.1 TERMINOLOGY

Warnings, cautions and notes used in this manual have the following significance:

NOTE

Procedures and techniques that are considered important enough to emphasize.

CAUTION

Procedures and techniques which, if not carefully followed, will result in damage to the equipment.

A WARNING

Procedures and techniques which, if not carefully followed, will expose the user to the risk of serious injury, illness or death.

1.1.2 GENERAL WARNINGS

A WARNINGS

- Failure to properly select the appropriate respirator for all the contaminants and their concentrations against which protection is required, or a failure to follow North's instructions and warnings, may result in exposure to the hazardous materials, exposing the user to the risk of serious injury, illness or death.
- Do not use this respirator for protection against air contaminants other than those listed on the air-purifying elements and on the NIOSH Approval Label which is supplied with each respirator and/or replacement air-purifying element.
- :3. Do not use this respirator under any of the following conditions:
 - · While performing or observing abrasive blasting (sandblasting) operations.
 - · For fire fighting.
 - In oxygen-deficient atmospheres (any atmosphere having less than 19.5 % oxygen by volume at sea level).
 - In atmospheres where the concentrations of toxic contaminants are unknown, or are Immediately Dangerous to Life or Health (IDLH). An IDLH atmosphere is any atmosphere which has a concentration of any toxic, corrosive or asphyxiant substance that poses an immediate threat to life, which would cause irreversible debilitating effects on health, or which would interfere with the ability to escape from a dangerous atmosphere.
 - In atmospheres where the concentration of the contaminant exceeds the respirator's Maximum Use Concentration, That is, where the concentration of the contaminant exceeds:
 - 10 times the contaminant's permissible exposure limit (the maximum permissible 8-hour time weighted average (TWA) concentration) established by applicable OSHA or other government regulations, or by NIOSH or ACGIH publications; or
 - ii. any lower Maximum Use Concentration for that contaminant (when using a half mask air purifying respirator) established by such OSHA or other government regulations (as In the case of asbestos) or NIOSH or ACGIH publications, or shown in the contaminant's Material Safety Data Sheet (MSDS), in a pesticide label, or in the current edition of the North Respirator Selection Guide.
 - In poorly ventilated areas, or confined spaces such as tanks, small rooms, tunnels or vessels, unless the confined space is well ventilated and the concentration of toxic contaminants is known to be, and will continue to be, below the Maximum Use Concentration recommended for the respirator.

A WARNINGS (CONTINUED)

- For protection against gas or vapor contaminants with poor warning properties (irritation, odor or taste) at or below their permissible exposure limit or those which are sensory desensitizers, unless the air-purifying elements are equipped with End-of-Service-Life indicators; or a cartridge change schedule is implemented based on service data which includes:
- i. desorption studies (unless the cartridges are changed daily),
- ii. expected concentration,
- iii. pattern of use, and
- lv. duration of exposure;

and the contaminant does not have a ceiling limit.

- For protection against gases or vapors which generate high heats of reaction with the sorbent material in the cartridge.
- For protection against gases or vapors which are not adsorbed by the sorbent material in the cartridge (e.g. Methanol).
- Do not use any air purifying respirator when conditions prevent a good facepiece-to-face seal. Examples of such conditions are:
 - the growth of beards, mustaches or sideburns which will pass between the facepiece sealing area and the face;
 - ii. the use of spectacles, goggles or other devices which interfere with the respirator;
 - iii. the use of head or face coverings which contain materials which will pass between the facepiece sealing area and the face; and
 - iv. missing teeth or dentures, facial deformities or deep scars.
- 5. Immediately leave the contaminated area if:
 - breathing becomes difficult;
 - ii. dizziness or other distress occurs;
 - iii. you smell, taste or sense irritation from the contaminants;
 - iv. the air purifying element is equipped with an End-of-Service-Life Indicator which has changed color to Indicate expiration, or
 - v.. the respirator becomes damaged.

▲ WARNINGS (CONTINUED)

- 6. Any air purifying respirator, when properly selected and fitted, will significantly reduce, but will not completely eliminate, the breathing of contaminant(s) by the respirator wearer. When working in atmospheres containing substances which are reported to cause cancer in amounts below their permissible exposure limit, you will obtain better protection from a continuous flow or positive pressure air supplied respirator or self-contained breathing apparatus (an SCBA).
- 7. This respirator does not provide protection to exposed areas of the body. If the contaminated almosphere contains vapors, gases or airborne particulate matter which may either irritate or burn the eyes or the skin, or can be absorbed by the body through penetration of the skin, the use of specialized eye, hand and/or body coverings may be required for protection.

1.1.3 USER REQUIREMENTS

To use this respirator you must know;

- The contaminants and their concentrations. (Ask your Safety Director or Industrial Hygienist, or follow the hazard determination steps as outlined in paragraph 7.2.2.1 of American National Standards Institute (ANSI) Standard Z88.2-1992, American National Standard for Respiratory Protection.)
- 2) That this is the respirator approved for use against those contaminants and at those concentrations. (Carefully read the NIOSH Approval Label Summary booklet included with this facepiece. Make sure the part numbers on the respirator components match the component numbers on the NIOSH Approval Label or on the configuration chart. If you have any doubts, prior to using the respirator consult an Industrial Hygienist, or North Safety Products Customer Service in the United States at 1-800-581-0444 or 1-401-946-0444.)
- 3) That the contaminated atmosphere is not Immediately Dangerous to Life or Health (IDLH). For the definition of IDLH see Warning #3 of the preceding list of General Warnings.
- 4) That this respirator fits you properly. (See Warning #4 of the preceding list of General Warnings.)

5) That you do not have any physical limitations or illness which would preclude you from using this respirator or be aggravated by an increase in breathing resistance. (Ask your Safety Director or physician.)

You should not enter any potentially contaminated atmosphere unless you have confirmed all of these factors.

1.1.4 TRAINING PROGRAM

These brief written instructions cannot substitute for a formal Respirator Training Program. Such training should include an opportunity for you to handle the respirator, learn how to inspect it, have it properly fitted, test its facepiece-to-face seal, wear it in normal air for a long familiarity period, and finally, to wear it in a test atmosphere. The Training Program should be based on ANSI Z88.2-1992, and should familiarize you with OSHA Regulation 29CFR Section 1910.134 and other regulations promulgated by various Regulatory Authorities.

1.1.5 FIT TESTING

A respirator should not be assigned to a person unless the person is given a qualitative or quantitative respirator fit test and the results of the test indicate that the facepiece of the respirator fits properly.

This respirator is available in three sizes; large, medium and small. Most faces can be fit with the medium, however person with small faces may get a better fit with the small size, and person with large faces may get a better fit with the large size.

Fit tests should be conducted at least annually and more frequently if there are factors such as weight change or dental surgery which may affect the fit of the respirator.

A fit test adapter is available for conducting quantitative fit tests. (See Accessories.)

Instructions for carrying out qualitative and quantitative respirator fit tests are given in publications such as ANSI Z88.2-1992, and respirator manuals published by government agencies such as NIOSH, ERDA, and NRC.



1.1.6 PERIODIC FIT CHECKS

Each time that the respirator is put on, before entering an area containing hazardous atmospheres, and periodically white wearing the respirator in the contaminated area, the respirator wearer should check the effectiveness of the seal of the facepiece to the wearer's face by carrying out a negative or positive pressure fit check. Instructions for carrying out fit checks on this respirator are given in Section 3 of this manual.

1.2 RESPIRATOR DESCRIPTION

This device is an air-purifying respirator consisting of a half mask facepiece assembly and a pair of replaceable air-purifying elements which provide respiratory protection against hazardous vapors, gases and/or particulate matter, depending upon the type of air-purifying element used.

When the respirator wearer inhales, the contaminated air is drawn through the air-purifying elements, which, depending upon their type, remove the hazardous vapors, gases and/or particulate matter from the air before it enters the lungs. During inhalation, the inhalation valves in the facepiece open and the exhalation valve closes to prevent contaminated air from entering the facepiece. During exhalation, the exhalation valve opens, and the inhalation valves close to prevent exhaled air from passing back through the air-purifying elements.

This respirator is approved by NIOSH to protect against, and reduce exposure to the type of air contaminants specified on the air-purifying elements and in the approval label supplied with the respirator or the air-purifying elements. When assembled with a pre-filter, this respirator is also approved to protect against, and reduce exposure to, additional air contaminants specified in the approval label on the pre-filter package.

2 PRE-USE INSTRUCTIONS

A WARNING

The respirator facepiece and air-purifying elements may be sold separately. Do not use this respirator unless the proper air-purifying elements are attached. See the NIOSH Approval label on the back cover of this manual for a list of the approved components, or check with your Safety Director or Industrial Hygienist or North Safety Products Customer Service in the United States at 1-800-581-0444 or 1-401-946-0444.

2.1 FACEPIECE

Remove the facepiece assembly from its container and visually check the facepiece to make sure that the sealing flange is not distorted, and that all components including the exhalation valve flap are in place, in good condition and secure.

2.2 PRE-FILTERS

If replaceable pre-filters are required, they should be assembled to the cartridges or filter holders before the cartridges or filter holders are attached to the facepiece. Follow the directions on the pre-filter for proper orientation. Place the pre-filters in the appropriate filter covers so that the entire outer edges of the pre-filters are seated evenly and securely against the inner wall of the filter covers. (See Figure 1.)



Snap the filter covers, with the pre-filters seated evenly and securely, to the cartridge or filter holders. (See Figure 2.)



FIGURE 1
Assembling the Pre-Filter



FIGURE 2 Attaching the Cover

2.3 ASSEMBLING THE RESPIRATOR

Assemble the respirator by screwing the two appropriate air-purifying elements onto the inhalation connectors mounted on the facepiece. Check to be sure that each air-purifying element is effectively sealed against the facepiece. (See Figure 3.)



FIGURE 3
 Attaching Air-Purifying Elements

After assembling the respirator facepiece and air-purifying elements, inspect the respirator to make certain that the respirator has not been damaged.

CAUTION

A respirator must be inspected by the wearer before and after each use to insure that it is in good working condition.

3 TO PUT ON THE RESPIRATOR

The following should be performed in an area with uncontaminated air.

 Remove your eyewear (if worn), then grasp the front of the respirator with one hand and the upper headband with your other hand. Then place the portion of the facepiece containing the exhalation valve under your chin. (See Figure 4.)



FIGURE 4 Putting on the Respirator

2) Position the narrow portion of the respirator on your nose bridge and place the cradle suspension system on your head so that the top headband rests across the top of your head and the bottom headband rests above your ears, on the back of your head. Then hook the bottom headband behind your neck, below your ears, and adjust the position of the face-piece on your face for best fit and comfort. (See Figure 5.)



FIGURE 5 Hooking the Bottom Headband



3) The length of the headbands are adjustable; tighten or loosen by holding the respirator body or headband yoke with one hand and pulling on the elastic material in the appropriate direction with your other hand. (See Figure 6.)

NOTE

For a comfortable fit, the headbands must be adjusted equally on both sides of the respirator.



FIGURE 6 Adjusting the Faceplece

4) Position the facepiece so that the nose section rests as low on the bridge of your nose as is comfortable, and tighten the upper headband on both sides just tight enough so that the respirator doesn't slide down on your nose. Do not over tighten. If the respirator pinches your nose, loosen the upper headband slightly. (See Figure 7.)



FIGURE 7
Adjusting the Upper Headband

5) Then, tighten the lower headband on both sides just tight enough to secure the respirator under your chin. (See Figure 8.)



FIGURE 8
Adjusting the Lower Headband

NOTE

For proper positioning and comfort, the upper headband must be adjusted first, then the lower headband must be adjusted.

- 6) If you previously removed your eyewear, put it back on at this time.
- 7) Conduct a positive or negative fit check as follows:

To conduct a negative pressure fit check, place the palms of your hands over the openings in the cartridges or fit check/filter covers (if so equipped) or, unscrew the air-purifying elements from the respirator and place the palms of your hands over the inhalation connectors, inhale and hold your breath for about 5 seconds. If the facepiece collapses slightly and no air leaks between the facepiece and your face are detected, an effective fit has been obtained. If air leaks are detected, reposition the facepiece on your face and/or readjust the tension of the headbands and repeat the negative pressure check until an effective seal is obtained. If the air-purifying elements were removed, once an effective facepiece-to-face seal is obtained, a co-worker or a representative of the Safety or Industrial Hygiene Department must assist you by screwing the air-purifying elements onto the Inhalation con-

nectors mounted on the facepiece. (This must be done without removing the facepiece from your face.) Check to be sure that each air-purifying element is effectively sealed against the facepiece. (See Figure 9.)



FIGURE 9 Negative Pressure Fit Check

To conduct a positive pressure fit check, block the openings in the exhalation valve guard using the palm of your hand and simultaneously exhale. If the facepiece bulges slightly and no air leaks between the facepiece and your face are detected, an effective fit has been obtained. If air is detected to be leaking out between the facepiece and your face, reposition the facepiece on your face and/or readjust the tension of the headbands to eliminate the leakage. This check must be repeated until an effective seal of the facepiece to your face is obtained. (See Figure 10.)



FIGURE 10
Positive Pressure Fit Check

4 USE

A WARNING

If the air-purifying elements have End-Of-Service-Life Indicators, you must be able to see the End-of-Service-Life Indicators while wearing the respirator.

If you cannot see the indicators, do not use the respirator because you will not know when the cartridge has expired. Should this occur, and you remain in the contaminated work area, you risk exposure to hazardous quantities of the air contaminant which can result in serious injury, illness or death.

You are now ready to enter the use environment for which the respirator is intended.

A WARNING

Immediately leave the work area and replace the respirator if;

- i. breathing becomes difficult;
- li. dizziness or other distress occurs,
- iii. you smell, taste or sense irritation from the contaminants in the work area,
- iv. the air purifying element is equipped with an End-of-Service-Life Indicator which has changed color to Indicate expiration, or
- v. the respirator becomes damaged.

Should any of these occur, and you remain in the contaminated work area, you risk exposure to hazardous quantities of the air contaminant which can result in serious injury, illness or death.

4.1 SERVICE LIFE

The service life of this respirator will vary depending on the work environment.



4.1.1 CARTRIDGES

When you are using a gas or vapor cartridge respirator which does not have End-Of-Service-Life Indicators, you will know the service life is ending when you smell, taste, or sense irritation from the contaminants while wearing the respirator.

If the respirator has End-Of-Service-Life Indicators, the cartridges must be changed when the color of either one of the indicators match the color standard indicated on the cartridge.

4.1.2 PARTICULATE FILTERS

When you are using a particulate filter respirator, or a gas or vapor respirator with pre-filters, the filters or pre-filters should be replaced when breathing becomes difficult.

5 TO TAKE OFF THE RESPIRATOR

- 1) Go to an area with uncontaminated breathable air.
- 2) Loosen headbands and remove the facepiece.

6 TURNAROUND MAINTENANCE

After each use, the respirator should be examined by trained personnel:

NOTE

It is good hygiene practice to replace the air-purifying elements after a single day of use even if the service life of the air-purifying elements have not expired.

A WARNING

Always replace air-purifying elements after water spray decontamination. Excessive moisture can damage the air-purifying elements and expose the user to the risk of serious injury, illness or death.

6.1 AIR-PURIFYING ELEMENT REPLACEMENT

NOTE

The replacement of air-purifying elements must be done in a safe area containing uncontaminated breathable air.

6.1.1 PRE-FILTERS

To replace pre-filters, detach the filter cover from the cartridge or filter holder, discard old pre-filters and replace them with new ones. Follow the directions printed on the pre-filter for proper orientation. Check to ensure that the entire outer edge of the pre-filters are seated evenly and securely against the inner wall of the filter covers. Snap the filter covers with the pre-filters to the cartridges or filter holders. (See Figures 1 and 2.)



6.1.2 CARTRIDGES

To replace gas, particulate or combination cartridges, unscrew them from the inhalation connectors, which are mounted on the facepiece, and discard them. Screw on new cartridges tightly to insure an effective seal between each cartridge and the facepiece. (See Figure 3.)

6.2 INSPECTION

Visually inspect all components for damage or wear, especially rubber parts. Replace parts where needed

If needed, clean and sanitize the facepiece assembly (see Section 8: Periodic Maintenance).

7 STORAGE

Store in a clean dry area in the respirator storage bag provided with the facepiece.

CAUTION

Rubber and elastomeric parts must be stored in a manner which will prevent them from taking an abnormal set. Do not expose this device, during storage, to excessive heat (above 140°F/60°C), moisture, contaminating gaseous substances or airborne particulates. Excessive heat may distort the facepiece resulting in the inability to achieve a proper fit. Moisture and contaminated air can damage the air purifying elements. Either of these conditions will expose the wearer to the risk of serious Injury, Illness or death.

8 PERIODIC MAINTENANCE

As needed, remove, inspect and clean the facepiece assembly.

A WARNING

The NIOSH Approval and all North warranties for this respirator are nullified if other than North replacement parts are used.

8.1 CLEANING AND SANITIZING

A WARNING

Never allow air-purifying elements to come in contact with water or cleaning and sanitizing solutions. Excessive moisture can damage the air-purifying elements and expose the user to the risk of serious injury, illness or death.

- 1) Remove filters and/or cartridges from connectors and discard them.
- Inspect headbands for wear. Check all elastomer and rubber parts for pliability and signs
 of deterioration.
- Remove the facepiece Inhalation connectors, headband assembly, exhalation valve guard, valve and seat from the facepiece.
- Remove the inhalation valves from inhalation connectors.
- 5) Prepare a solution of cleaner/sanitizer (North Catalog Number 80992) according to the cleaner/sanitizer instructions.
- 6) Wash the facepiece and components in the cleaning solution.
- 7) Rinse components completely in clean warm water, then air dry in a clean area.
- 8) Visually inspect the exhalation valve for damage. If damage or wear is evident, replace.
- 9) Reassemble the facepiece: Follow steps 2 through 4 above, in reverse order.



8.2 PREPARE FOR USE

- 1) Install a new pair of air-purifying elements.
- Perform a fit check to make sure that components are functioning properly.

9. REPLACEMENT PARTS

	COMPLETE ASSEMBLIES												
CATALOG NUMBER DESCRIPTION													
5500 SERIES	7700 SERIES												
5500-30S 5500-30M 5500-30L	7700-30S 7700-30M 7700-30L	Facepiece Assembly Complete, Small Facepiece Assembly Complete, Medium Facepiece Assembly Complete, Large											

,	:	COMPONENTS	(See Figure 11.)
ITEM	CATAL	OG NUMBER	DESCRIPTION
	5500 SERIES	7700 SERIES	
1	7700-16	7700-16	Inhalation Connector
2	7700-17	7700-17	Inhalation Valve
3	7700-18	7700-18	Exhalation Valve
4	7700-19	7700-19 ·	Exhalation Valve Seat
5	7700-20	7700-20	Exhalation Valve Guard
6	5500-92	7700-92	Cradle Suspension System
7	5500-11S	7700-11S	Basic Faceplece, Small
7	5500-11M	7700-11M	Basic Facepiece, Medium
7	5500-11L	7700-11L	Basic Facepiece, Large

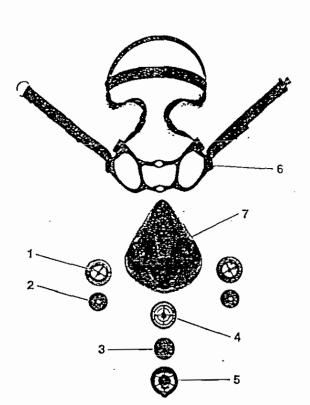


FIGURE 11



10 ACCESSORIES

CATALOG NUMBER	DESCRIPTION	
7002	Fit Check Ampule	
7700-21	Fit Test Adapter	
N7500-27	Fit Check / Filter Cover	
80992	Cleaner/Sanitizer Powder	;

11 KEY TO CAUTIONS AND LIMITATIONS CONTAINED IN NIOSH APPROVAL LABELS

- A Not for use in atmospheres containing less than 19.5 percent Oxygen.
- B Not for use in atmospheres immediately dangerous to life or health.
- C Do not exceed maximum use concentrations established by regulatory standards.
- H Do not wear for protection against organic vapors with poor warning properties or those which generate high heats of reaction with sorbent.
- J Failure to properly use and maintain this product could result in injury or death.
- K The Occupational Safety and Health Administration regulations require gas-proof goggles to be worn with this respirator when used against formaldehyde.
- M All approved respirators shall be selected, fitted, used and maintained in accordance with MSHA, OSHA, and other applicable regulations.
- N Never substitute, modify, add, or omit parts. Use only exact replacement parts in the configuration as specified by the manufacturer.
- O Refer to user instructions, and/or maintenance manuals for information on use and maintenance of these respirators.
- S Special or critical user's Instructions and/or specific use limitations apply. Refer to instruction manual before donning.

11.1 SPECIAL USER'S INSTRUCTIONS

A WARNING

If the air purifying elements have End-of-Service-Life Indicators, you must be able to see the End-of-Service-Life Indicators while wearing the respirator.

If you cannot see the indicators, do not use the respirator because you will not know when the cartridge has expired. Should this occur, and you reemain in the contaminated work area, you risk exposure to hazardous quantities of the air contaminant which can result in serious injury, illness or death.



North Safety Products

2000 Plainfield Pike Cranston, RI 02921-2019

1-800-581-0444 CARTRIDGE IS APPROVED ONLY IN THE FOLLOWING CONFIGURATIONS:



02.	1
₹ }	
UDSH	

****						_											R	85	pi	rat	or	Ç	om	ıρc	one	ne	l\$																
NIOSH Approval TC	Protection (Sea 1 below)	Cartridg 6 (Pair)									eco les									30	00	on 25') ma	18 1	12.					Co	lqu		ect	- 1.	Shower cap (Pair)	_	pec	tacle (II	Ā	WI	-log pe nates)	- }	Cautions and Limitations (See 2 Below)	
		. 7	5	5	5	7	7	7	7	7	7	7	7	7	7	7	7	8		8			8							1 -	1	8	- 1	7	7		8	8	٦	8			
		√,5	5	5	5	7	7	7	7	7	7	6	6	8	8	8	8	8	8	8	8	8	8	3 6	8 4	8	8	8	8	8	8	8	1	5	6		0	0	ļ	0			
		8	0	0	0	0	0	0	В	В	В	0	0	0	٥	٥	٥	6	6	В	6	8	8	3 8	8 8	В	8	8	ß	8	6	8	1	0	٥)	1	9		9			
Į į		. 1	0	0	0	0	0	0	P	P	þ																							0	0	١	0	4		4			- 1
		P.	-	-	-	-	-	-	-	-	-	~	-	5	5	6	8	1	2	5	0	1	2	2 :	5	٥	0	0	0	ð	0	0	rľ	-	-		0	4		5			
		31	3	3	3	3	3	3	3	3	3	8	8	-	s	- {	s	2	5	0	0	2	5	5 0	٥	이	н	S	s	ļн	ı s	s	;	2	2	!		l					
		o.	0	0	0	0	0	0	이	0	0	٨	A	-	-	-			l		ı	1	1	1	1	-				l	ı		-	8	2	!		l					
		0 .	Ĺ	м	s	Ļ	М	s	빕	м	s		s		\perp				L_			\perp		┸	_	┙									L								_
84A-0593	OV/P100	Χ.	X	X	X		П	ì	П						_[L	L	L	Ι								Τ	_ _	_x							_ _	A.B,C,H,J,L,M,N,O	_
84A-0595	OV/P100	x	1-	-	Г	X	x	X		_	٦		7		Т		_		Γ	1	Ī.,		Ľ	Τ.	_[_[_		L	Ι	T			_ X				I	_[_ _	A,B,C,H,J,L,M,N,O	
84A-0612	OV/P100	x			-				X	X	X					_		•				1.				_	_	_		L	Ľ			X	_						_ _	A, B,C,H,J,L,M,N,O	
84A-0594	OV/P100]-	1-	_	_					_	x	X					_		_	L		Ι		1					L		L	<u>-</u> .	x	>	(X	×		X	_ _	A, B,C,H,J,L,M,N,O	
	SA/OV/P100	X	-	Γ	_	_			7			T		X	X	X	X	X	X	X	X	١.	I				X	X	X				_[.	X	_>	<u></u>	_x	X	\Box	Х	_	A,B,C,D,E,G,H,J,L,M,N,C),S
84A-0666	SA/OV/P100	X.	-	1	-	_	-				П	T	T	X	X	×	X		Γ	Γ	T	X	त्र	X Z	xΓ	X	_		[Įχ	(X	₹[;	7	X	>	(X	×	٦	X	A	A,B,C,D,E,G,H,J,L,M,N,C	2,0

1 PROTECTION

P100-Particulate Filter (99,97% filter efficiency level) affective against all particulate aerosols

OV - Organic Vapors SA - Supplied air

- 2 CAUTIONS AND LIMITATIONS
- "A Not for use in atmospheres containing less than 19,5 percent oxygen.
- B Not for tree in atmospheres immediately dangerous to life or health.
- C Do not exceed maximum use concentrations established by regulatory standards.
- D Air-line respirators can be used only when the respirator are supplied with respirable air meeting the requirements of CGA G-7.1 Grade D or better.
- E Use only the pressure ranges and hose lengths specified in the User's Instructions.
- .G If sirflow is cut off, switch to filter and/or cartridge and immediately exit to clean air.
- H Do not wear for protection against organic vapors with poor warning properties or those which generate high heats of reaction with sorbent.
- J Fallure to properly use and maintain this respirator could result in injury or deeth.
- L Follow the manufacturer's User's Instructions for changing cartridges and/or filters
- .M All approved respirators shall be selected, fitted, used, and maintained in accordance with MSHA, OSHA, and other applicable regulations.
- N Never substitute, modify, add, or omit parts. Use only exact replacement parts in the configuration as specified by the manufacturer.
- O Refer to User's instructions, and/or maintenance manuals for information on use and maintenance of these respirators.
- S Special or critical user's instructions and/or specific use fimitations apply. Refer to User's instructions before donning.

Part No. 7581P100

NIOSH OV/P100

▲WARNING

Do not use for protection against paints containing isocyanatos.

ADVERTENCIA

No lo use para la protección contra los pintura contengan isocianatos.

AAVERTISSEMENT

À ne pas utiliser dans pour se protéger des peinture contenant isocyanate.

O1997 North Safety Products. Printed in U.S.A. Part No. 46000491 Rev. B



North Safety Products 2000 Plainfield Pike Cranston, RI 02921-2019 1-800-581-0444



ESTE CARTUCHO HA SIDO APROBADO SOLAMENTE EN LAS CONFIGURACIONES SIGUIENTES: CETTE CARTOUCHE N'EST HOMOLOGUÉE QUE DANS LES CONFIGURATIONS SUIVANTES:

~~ (~	0 4 1	1 L. O A		<u> </u>	<u> </u>	<u> </u>		14		3 1		10	_	_		_				, ,		_	_		_					14 1	<u>riaun,</u>	41101	13 3	0:0		N 1.5	NICISH
														Con	npon																						141212171
Aprobación	Protección	Cartucho	Ţ	_		-		,	Mas	cara						Ţ	Man	gue	ras.	da s	bas	tech	nle	nto"	Ačc			de c		ķ•"	A	ccesorios	/ Access	orires			Procauciones y
TC- de	(vez al 1 a	(par)						(S	usti	tulos	()					- [de a	ilre(l	Max	90n	n on	e 3.	75n	10				ipide			Tapa de		ga de			or enti-	. limitaciones
MOSH .	continuación)							•			•					- 1		7,	5m)	(Su	rstitu	ilos)		- 1				tutos			la ducha (par)	antoolos			brun		(voa el 2 a continuación)
	Onto otto ot	Carlouche					t'a		-51	e Ma		_				[7	uyaı	ux d	redd	neth	on d	nir		Acc	oup	lom	ent	rapi	do						utos)	Conseils de
Homologation	Protection'		١.									•				ľ		Va:							((Sut	bstiti	utlor	ns)		Cultura au book		lunellas	Chitio	~-	ntibuée	prodonce at fimitations
NIOSH	(volr 1 ci-dossous)	(Paire)	l					(50	DStil	lution	1S)									Sub				1							douche (Pair)	(5001	liutions)	1		utlans)	(voir 2 cl-dessous)
TC-			١_,	-			2 .		-		Ψ.	7 2	- E	_		_	_		1			2	,	_		- 1-	- 1-		_	_		 -		(300	31/10	/ICA15)	.
		7	5	5	5	7	7 7	7 7	7 7	' 7	7	7	7	7	7	7	8	8	В	8	8	8 I	8	B	8 8	B	8	8	8	8	7	7	8	6		8	1
		5	5	5	5	7	7 7	7 7	7 7	7 7	6	6	8	8	8	8	8	8	8	8	8	8 1	3	8 I	3 8	9	6	8	8	8	5	6	0	0		0	1
		8	0	0	0	0	0 0) 1	3 8	3 B	0	0	0	0	0	0	6	8	6	6	8	8 1	B	8	3 6	5	6	8	8	8	0	0	1	9		9	1 1
		1	0	0	0	0	0 0) 6	9 F	, b	10	0	0	0	0	0	0	0	0	1	0	0 0	0	1	0 0	ן כ	0	0	0	0	0	0	0	4		4	1
		P	l I	-	-	-]	- -	- -	- -	. -	-	 -	5	5	6	6	1	2	5	0	1 :	2 :	5	0 (0 0	o •	0	0	0	0		-	0	4		5	i I
		Ť	3	3	3	3	3 3	3 3	3 3	: ∤3	8	18	H	s		\$	2	5	0	٥	2	5 0	١٥	0	H (s	sl	н	s l	s	2	2		1	J	,	i l
· '		0	0	0	ا ہ	0	0 0	١l	o lo	0	l a	A	H				- (- 1								- 1		8	2	1	1		ı	· •
		0	ا د ا	м	s	L	MIS	sΙι	۸ا	A S		s	1	1			- 1				- 1							- [- 1					1	- 1	ı	· I
84A - 0593	OV / P100	x	X	X	x	~	7	\top	\top	7	┰	+-	1			_†	7	<u> </u>		7	7		- r	7	7	7		_7	•		X	<u> </u>		1	\neg		A,B,C,H,J,L,M,N,O
84A - 0595	OV / P100	x	1		7	Χľ	X I	ΧT	_	7	1	1					_	Tt			7	(-	-r	— I.		~ -	_	_1	-1	_	x		·	·}	-1		A,B,C,H,J,L,M,N,O
84A - 0612	OV / P100	X	-	_	-	7	-		হার	₹İx	1	+	1-		-	·	\neg	7	\neg	_			7		_				-1	$\overline{}$	x		 -	·	-		A,B,C,H,J,L,M,N,O
84A - 0594	OV / F100		-	\vdash			_	7	7	7		X	 			-¦	—ļ	_	-	-		_	- -	I		٦-				_	x	x	- -	' '''x''	-1	_ž	A,B,C,H,J,L,M,N,O
84A - 0665			1					-	_	-1-	-r-``	1-1	X	x	\mathbf{x}	Σľ	고	$\overline{\mathbf{x}}$	$\overline{\mathbf{x}}$	\mathbf{x}	-	- -		[χij	χT	\mathbf{x}^{\dagger}	-				x		-{−°;-	-1	· 😭—	A.B.C.D.E.G.H.J.L.M.N.O.S
84A - 0668			-	-	-	-+		-			+		Tx'	ΓŸ	Tx†				77		\mathbf{x}^{\dagger}	x 1	χŤ	$\overline{\mathbf{x}}$				ᇵ	χĦ	x	(<u>x</u>	x^		-ŷ-	^	· 🖁 🕶	A.B.C.D.E.G.H.J.L.M.N.O.S
0-74 - 0000	3A/07/P100		<u> </u>	<u> </u>	لححا	_						┸~				ىك			_			-	<u> </u>	•••		щ,			ىن		<u> </u>	<u> </u>	 ^_	_^			V'0'0'0'E'G'U'9'E'W'M'N'O'2

1 PROTECCION 2 PRECAUCIONES Y LIMITACIONES

de perticulas (nivel de aficiencie del

B -No se dabe usar en atmósferas que sean directamente peligrosas para la vida o la satud. C -No axcade las concentraciones de uso máximo establecidas por los estándares reguladores. D -Los respiradores de línes de sire se pueden usar solamente cuando se proporcionan con sire respirable que cumplan con los requisitos de CGA G-7.1, Grado D o de calidad más alta. E -Use solamente las games de presión y las tongitudes de manguera expedificades en el manusi de instrucciones.

fiftre de 99.97%) ** stactive conire todos los serosoles da particulas

OV - Vacor

produkto

SA - Alta , abertecido

J -Si este producto no se usa y se mantiene correctemente, se pueden producir lesiones o la muerte. L - Siga los manuales de instrucciones para cambiar los certuchos y/o los fitiros. M -Todos los respiredores aprobados sa deban seleccionar, ajustar, usar y mantener de acuerdo con las requisciones da MSHA OSHA y otras regulaciones aplicables.

N -Nunce aubatituya, modifique, añada u omita partes. Use solemente las partes da repuesto exactes en la conflouración, como lo especifica al fabricante.

G-St se corte el fluto de atre, camble el tittro y/o cartucho y seige inmediatamente at aire limplo.

H -No lo use para la protección contra los vepores orgánicos con poces sañeles de advertencia

A -No se debe user en atmósferes que contengan menos de 19,5 por ciento de oxígeno.

o contra aquática que reaccionan con calores elevadas con el absorbente

- O -Consulte los manuales de instrucciones y/o de mentenimiento para obiener la información sobre el uso y mantenimiento de estas tespiradores.
- 8 -Se aplican les instrucciones especiales o críticas del usuario y/o las limitaciones del uso específico. Consulte el menual de instrución untas de ponérselo.

1 PROTECTION 2 CONSEILS DE PRUDENCE ET LIMITATIONS A -À ne pas utiliser dans les almosphères contenant moins de 19,5 pour cent d'axygène.

de particules (99.97% d'el licacità de III rrage) efficace conire lous fee

aérosols de particules

- OV Vapeur organique
- D -Les respirateurs à adduction d'eir ne peuvent âtre utilisés que lorsqu'its sont abmentes en air respirable conforme au moins aux spécifications de la norme CGA G-7.1 Classe D. E -Respecter les timites de pression et longueurs de tuyaux précisées dens la manuel d'instruction. Q -En cas de coupure da l'alimentation en etr, activer le tittre et/ou la cartouche et sortir immédiatement à l'air tibre.

C -- No pas dépasser les concentrations maxima d'utilisation établics par les normes réglementaires.

B -- À ne pas utiliser dans les atmosphères mèttant directament la vie ou le samé en danger,


- H -Ne pas porter comme protection contre des vapeurs organiques ayant de meuvatses propriété d'alerte ou contre celles qui rèsglesent su sorbent en dègageant unegrande chaisur.
- -itutifisation et l'entrellen incorrects de ce produit peuvent entreiner des blessures graves, voire mortailes, L -Sulvre les Instructions du fabricant pour remplacer les cartouches eVou filtres,
- M -Tous les respirateurs homologués doivent être sélectionnés, ajustés, utilisés et entretenus conformément à MSHA, OSHA al l'autre règlements applicables. N -Ne jamala ramplacer, modifer, ajouter ni ometire de plèces. N'utiliser que des plèces de rechange correctes dens
- in configuration spécifiée par le fabricent. D -Se reporter aux instructions d'utilisation evou aux manuels d'entratien pour les informations aux l'utilisation
- et l'antralien de ces respireteurs.
- 3 -Des instructions d'utilisation spéciales ou d'une importence critique eVou des limitations d'utilisation précises s'appliquent. Se reporter au guide d'instruction avent de porter l'appareil.

3.2 Cartridges, Filters and Vacuum System



ADVANCED CONTAINMENT SYSTEMS

Force Air Portable Clean Negative Air Mächine

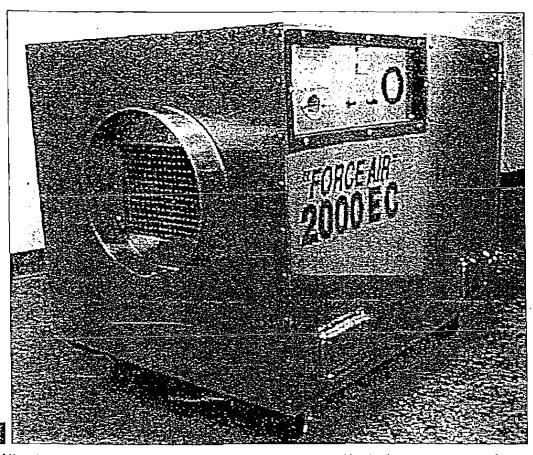

FA 2000 EC

Designed specifically for the cost-conscious contractor that does not require on-line vis and audible alarms. This unit meets specs and exceeds the standards of the EPA, OSHA, N and ANSI.

SPECIFICATIONS

Dimensions: 37 1/2 x 26 1/2 x 32 1/2

Prefilter #1: 24 x 24 - 2 ply pad

Prefilter #2: 24 x 24 - 3 ply ring panel

HEPA Filter: 24 x 24 x 11 1/2 (99.97%)

Weight:

160 lbs.

Motor:

High efficient 1 3/4 HP.

two speed

Power Supply: 115V, 60Hz, 13 Amps

FEATURES


- · Heavy duty aluminum cabinet
- · Modular control panel and service
- · Sealed control box
- HEPA filter is locked in
- Four heavy duty swivel casters 2 with locks
- Rugged carrying handles

BENEFITS

- Lightweight, durable, rust resista
- Control panel unplugs for each removal
- Eliminates leakage around gauç
- Assures positive seal around HEPA filter
- Provides easy portability


(ITEM 55011)

Call for pricing and availability!

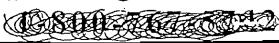



FA 2000 EPE EXPLOSION PROOF ELECTRIC UNIT

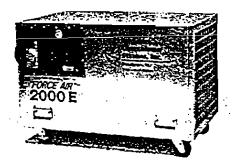

SPECIFICATIONS

Dimensions:

44 1/2 x 26 1/2 x 31

Prefilter #1:

24 x 24 - 2 ply pad

Prefilter #2:

24 x 24 x 3 ply ring panel

HEPA filter:

24 x 24 x 11 1/2 [99.97%]

Weight:

200 lbs.

Motor:

Explosion proof 1 HP

Power Supply:

115 Volt, 60 HZ, 15 Amps

FEATURES

#55011

- Thick .090 aluminum cabinet
- 4" heavy duty swivel casters (2 w/locks)
- · Rugged carrying handles
- Grounding clamp
- · Bracket for grounding wire
- · Backwardly incline aluminum Centrifugal:fan
- · Venturi style inlet cone
- Explosion proof 1 HP motor
- · Explosion proof switch
- · Explosion proof electrical fittings
- Explosion proof plug

All explosion proof components are UL listed for use in Class I, Group (and Class II, Groups E, F and G hazardous locations.

FEATURES

- Heavy duty aluminum cabinet
- 1 1/2 HP air driven motor
- Variable speeds
 - 1/2" quick disconnect, air inlet


Recessed Filter, Regulator, Lubicator

- Inline, inlet air filter
- · Inline, inlet lubricator
- · HEPA filter is locked in
- · Rugged carrying handles
- · Four heavy duty 4" swivel casters
- Backwardly incline aluminum centrifugal fan
- Venturi style inlet cone
- · Welded air tight construction
- Grounding clamps

BENEFITS

- · Lightweight, durable, rust resistant
- Used where electric motors are prohibited
- · Variable air control
- Standard fitting
- · Protects it from damage
- Provides motor protection
- Provides motor lubrication
- Prevents particle by-pass
- Provides easy portability
- Provides easy portability
- · Can withstand high static pressure
- Provides increased CFM
- · Extends filter life
- Reduces air turbulence for increased CFM output

FA 2000 EF EXPLOSION PROOF PNEUMAT

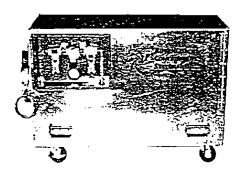

SPECIFICATIONS

Dimensions:

44.5" x 28.5" x 31"

Prefilter #1:

24 x 24 - 2 ply pad

Prefilter #2:

24 x 24 -3 ply ring panel

HEPA Filter:

24 x 24 x 111/2 (99.97%)

Weight:


185 lbs.

Motor: 11/2 HP air driven

Power Supply: 90 PSI - 65 CFM - compressed :

Filter Gauge

HYDRO FORCE HF-4 PNEUMATIC WATER FILTRATION SYSTEM

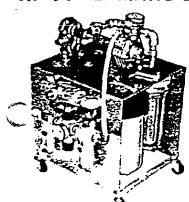

SPECIFICATIONS

Dimensions:

21 x 20 x 26

Weight:

70 Lbs with casters

Filters:

(2) 50 micron pleat (9 3/4 x 4 1/2)

(2) 5 micron pleat (9 3/4 x 2 3/4)

Pump:

20 GPM - variable
Air driven - 1 1/2 HP

Motor: Flow rate:

20 GPM

FEATURES

- . Heavy duty (.090) aluminum housing
- · Variable speed air driven motor
- Inlet air filter
- · Inlet air lubricator
- Galvanized plumbing
- (4) 2" swivel caster
- Pleated filters
- · Bronze rotary gear pump
- . Zerk fittings on pump

Features

Equipped with a HEPA filter system. Consisting of a primary certified absolute filter, double layer intermediary micro filter and totally enclosed two ply disposable paper filter bag. The HEPA filter has a steel outer casing and micro-fibered glass paper filter media separated by corrugated aluminum sheeting that is encased in a protective steel screening.

The HEPA filter is rated with a minimum efficiency of 99.97% at 0.3 microns. Tested using the HOT DOP method @ 100 CFM for

16" and 75 CFM for 14".

Poly and steel tank models have the same quality features as our standard vacuums.

Units are shipped with intermediary micro pre-filter (2/pk) disposable paper filter bags (5/Pk) and 6 mil poly bags (5/pk) with OSHA markings. DAF models include 1½" dry tool kit and WA models a wet/dry tool kit.

An optional wet conversion kit converts the dry vacuum over for liquid pickup. See page 27.

UL, CUL, CSA, NRTL/C listed.

HazardMaster Specifications:

Model No	Туре	Rec Cap	Tank Type	Part No
120V. 1 ¹ /4 HP I	By-Pass	Motor - 84"	Waterlif	t, 94 CFM
.010DAF	Dry	7 Gal	Steel	394572
2010DAF	Dry	16 Gal	Steel	380423
P4810DAF	Dry	8 Gal	Poly	310069
P4810WAF	W/D	8 Gal	Poly	310298
P41510DAF	Dry	16 Gal	Poly	310190
P41510WAF	W/D	16 Gal	Poly	309087

Note: Steel tanks are also avaiable in stainless steel.

Model Type Rec Tank Part Νo Cap Type 120V, 21/4 HP By-Pass Motor - 110" Waterlift, 115 CFM 1015DAF Drv 7 Gal Steel 382701 2015DAF 16 Gal Steel 380431 Dry 8 Gal P4815DAF Dry Poly 310093 8 Gal P4815WAF W/D Polv 310301 P41515DAF Dry 16 Gal Poly 310212 P41515WAF W/D 16 Gal 309907 Poly 120V, 11/2 HP By-Pass Motor - 88" Waterlift, 128 CFM P41520DAF Dry 16 Gal Poly 310220 P41520WAF W/D 16 Gal 310387 Polv

Back Pack HEPA Dry Vacuum

This lightweight stainless steel vacuum is perfect for use in hard reach areas. The HEPA filter has a minimum efficiency rating of 99.97% at 0.3 microns HOT DOP method certified @ 100 CFM. Strap it on your back, clean in hard to reach and limited areas. Easily detachable back frame can be removed to create a lightweight canister vac.



1015 DAF

410SSDAF

UL, CUL listed

Specifications:

-10SSDAF (302775) w/1½" dry kit lotor: 120V. 1¼ HP By-Pass - 84" Waterlift, 94 CFM Tank Capacity: 40 Bu Recovery

EnviroMaster™ HEPA Dry Vacuum

Easy to carry and transport, this compact vac is perfect for cleanup in small and confined areas. The filter has a minimum efficiency rating of 99.97% at 0.3 microns HOT DOP method certified @ 100 CFM. The heavy-duty poly tank is rotationally molded, equipped with four- 2½" swivel casters and three hold-down clamps.

Specifications:

P4710DAF (369861) w/1½" dry kit P4710HVAF (369888) w/1¼" dry kit

Motor: 120V, 1¹/₄ HP By-Pass - 84" Waterlift, 94 CFM Tank Capacity: .70 Bu Recovery

P4710DAF

Note: Available in 100V, 230V - 50/60 Hz, 400 Cycle



On characterists

Wester all with

HEPA illustrations of

removal of

asbestos lead saluminum ceramic

dust, fiberglass
and many other
hazardous
materials.

Designed for use in clean rooms, hospitals, or industrial plants and wherever air or dust pollutants exist.

See pages 24 and 25 for motor head and tank specifications.

See pages 26 and 27 for adaptors and accessories.



(800) 8855-78112 (914) 1565-8850

(000)/F7460 (010)/H7460



CORPORATE OFFICE • P.O. BOX 29 = 1655 IMPERIAL WAY = THOROFARE, NEW JERSEY 08086-0029
(609) 848-5330 • (800) 767-6933 • FAX: (609) 848-0802

www.aramsco.com

January 12, 1999

To Whom It May Concern:

Hepa filtered vacuums and negative air machines are required to meet two standards in the asbestos industry.

UL Standard (Underwriters Laboratories)

- A. Electrical for the motors, plugs and GFCI if included with the unit.
- B. Fire retardancy of the Hepa media.

ANSI Z9.2

This is a standard that applies to the efficiency of the final filter requiring a minimum of 99.97% at .3 micron. DOP testing assures compliance with Mil-STD 282.

Aramsco Hepa Filtered Vacuums, Aramsco Negative Air Machines, Aramsco Blastrac Dust Collector Systems, and Ram Air Jr. Negative Air Units featured in our catalog are tested to meet ANSI Z9.2 standards. All our Hepa filters are D.O.P tested in accordance with Mil-STD 282, and are registered and labeled on each individual unit by the manufacturer. They meet or exceed a minimum of 99.97% efficiency for .3 micrometer particles.

Sincerely,

ARAMSCO, INC.

David H. Naylor Sales Manager

DHN/mf



Phone (770) 33 FAX (770) 33 Sales/Orders (800) 63

Abatement Technologies, Inc.

1705 Belle Meade Court

Suite 150

Lawrenceville, GA

To whom it may concern:

This is to certify that Abatement Technologies' HEPA-AIRE air filtration machines are manufactured in accordance with ANSIZ9.2-1974 requirements for negative pressure generating air filtration equipment. Units include the H1000V, H1990C, H2000A, H2000C, H2000P, H2000EA, H2000EC and H5000C. These machines are also designed to meet or exceed the requirements of ANSI N509-1980 for overall filtration efficiency.

Each of the Type A HEPA filters we supply as original equipment in these machines has been individually tested in accordance with IES-RP-CC-001-86 and certified to meet or exceed a minimum filtration efficiency of 99.97% against 0.3 micron particles. Individual filter efficiency results are labeled on each filter.

Use of substitute HEPA filters in HEPA-AIRE machines voids all performance claims and warranties.

Sincerely,

David M. Shagott

President

Abatement Technologies, Inc.

DS:db





PSTARTER N



January 7, 1997

Subject:

Certification

To Whom It May Concem:

This is to certify that the exhaust air stream emitted from a properly assembled and maintained Pullman/Holt vacuum cleaner or air moving device equipped with a H.E.P.A. filter meets or exceeds OSHA Standard 1910-1001, as amended and all applicable sections of A.N.S.I. z 9.2 for asbestos fiber concentration.

This certification applies also to other solid particulate materials such as lead, silica, radioactive dust and many other hazardous materials. This filter is not sultable for materials that vaporize, such as Mercury.

Each H.E.P.A. filter is individually tested per MIL.STD 282 and certified by the filter manufacturer for a minimum efficiency of 99.97% on 0.3 micron particles.

Sincerely,

Hobart Eukovich


Vice President

Sales and Marketing

RE:kb

FILTRATION MASTER, INC.

FMI-MASTERPLEAT

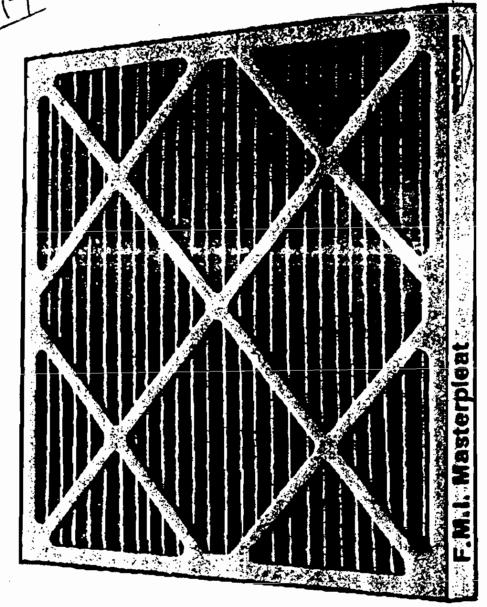

iliter media & backino:

he MASTERPLEAT 40 utilizes a lofted, non-woven filter redia composed of cotton and synthetic fibers. The fiber lend maximizes dust retention capabilities while giving the MI-MPs 30-35% sverage efficiency and a 90-93% average restance when tested in accordance with ASHRAE Test lethod 52-76. The media is treated with a fire retardant iditive for safety purposes.

last configuration & support:

refilter media derives its support from being continuously led to a corrosion resistant, 28 gauge expanded metal ...ort grid with a 95% open face area. The media/backing ion is formed into serodynamically optimized aped pleats and is bonded to the entire periphery that losure frame thereby eliminating any possibility of my a sypassing the media pack. To maintain accurate eat alignment and prevent sagging or collapse of the fitter

when subjected to high concentrations of dust, the diagonal discut filter support members are bonded to the air entering and exiting edges of the media pack.

Filter closure frama

The FMI-MP filter elements are enclosed in a two piece discut frame made of heavy duty, high wet strength beverage board. When assembled, the two mating frame components form a double wall on all four aidea. The double wall frame combined with the integral corner flaps and the fully bonded construction form a rugged and durable filter that will not rack, warp or leak under normal conditions.

Fire retardant construction:

The MASTERPLEAT 40 standard capacity medium efficiency pleated air filters are U.L. Class 2 approved and listed. Testing on this product was performed in accordance with U.L. Standard 900.

(550M)

esign and construction

Filter media

The filter media used in all filters is a high performance, non-woven, reinforced cotton or rayon fabric, specially manufactured with additive E-7 to meet rigid performance specifications.

Media is available in Type 40, with an ASHRAE 52-76 (atmospheric) efficiency of 30-35% †, and in Type 60, with an efficiency of 50-55% †.

Media support


The media support is an "expanded diamond" grid with 98% open area. The filter media is chemically bonded to the media support to ensure pleat stability throughout the life of the filter.

Pleat design

The filter employs an exclusive "radial V" pleat design. This guarantees total usage of filter media, and maximum dust holding capacity. This affords the user a greatly extended service life.

Enclosing frame


The enclosing frame is constructed of rigid, heavy-duty, moisture resistant kraftboard. The support members, which are an integral part of the frame, are bonded to each pleat on the air entering and air exit side to ensure pleat spacing and stability. The filter pack is bonded to the inside periphery of the frame to eliminate the possibility of air bypass.

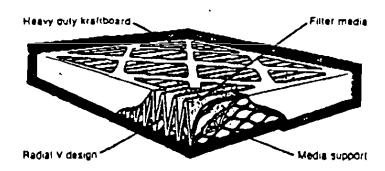

crinciples of filtration

Each filter operates on a strainer type principle, utilizing pleats that are shaped and speced on predetermined centers. This controlled spacing causes diffusion of air pressures over the pleated surface. Initially the least resistance is in the bottom of the pleat where pollutants are filtered out. A build-up of these contaminants increases the resistance at the bottom of the pleat, and air flow gradually moves up the side walls of the pleat as the filter becomes loaded.


The targer pollutants in the air stream, because of their velocity and inertia forces, are unable to change direction as the airflow moves up the side walls of the

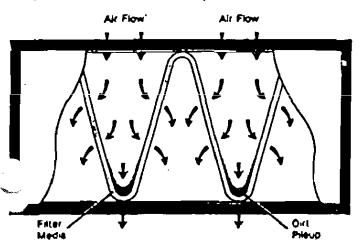

pleat, and these pollutants lodge themselves in the back of the pleat while the finer microscopic particles become trapped on the side walls.

As dirty air angles through the pleat sides, increased media loft (created by the particulate layer build up) is achieved, with the result of better micron efficiency. This is the strainer principle of filtration. The pollutant bed functions as a supplemental filtration medium throughout the filter's life.

Efficiency vs. particle size

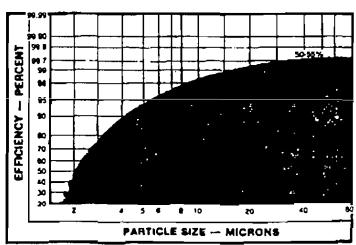

3.3 Protective Clothing

Polycoated Polypropylene Disposable Clothing


.ese coveralls are made of a lightweight material providing an effective barrier and are designed for industrial applitions where basic chemical protection is needed. Results from independent laboratory tests show that Poly-Safe performs as good as, and in many cases better than Tyvek® and Tyvek® QC (see chart below.) These coveralls have passed the ASTM ES-21 test determining its resistance to liquid penetration. This test is the standard used by OSHA regarding bloodborne pathogens and other potentially harmful fluids.

- Polycoated Coverall
- **Zipper Front**
- Elastic Wrists & Ankles
- Attached Hood
- Serge Seam 25/case

Yellow

XL
2XL
3XL
4XL
5XL



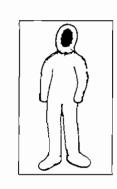

- Polycoatéd Bunnysuit
- Zipper Front
- Elastic Wrists & Ankles
- Attached Hood & Boots
- Serge Seam
 25/case

<u>White</u>	
50473XL 504742XL	50477XL
504742XL	50478 /2XL
504753XL	5047x3XL
504753XL 504764XL	50460\4XL
	/ \

ND= None Detected

Call for current pricing

CHALLENGE CHEMICAL	TYV	EK® QC	POLYCOATED PO	LYPROPYLENE
	Normalized Breakthrough Time (minutes)		Average Normalized Breakthrough Time (minutes)	Average Permeation Rate (µg/cm2/minute)
Acetone	Immediate	10	8	0.62
Acetonitrile	Immediate	16	<4	8.7
Ammonia	Immediate	3.1	4	4.5
1, 3 Butadiene	8	12	8	11.9
Carbon Disulfide	Immediate	HIGH	<4	>50
Chlorine Gas	Immediate	>50	6	23
Dichlormethane	Immediate	>50	4	0.59
Diethylamine	Immediate	64	4	9.5
N,N-Dimethylformamide	Immediate	0.72	8	2.1
Ethylacetate	7	12.7	4	3.3
Ethyleneoxide	Immediate	168	<4	359
n-Hexane	Immediate	HIGH	4	6.3
Hydrogen Chloride	Immediate	9.3	30	>50
Methanol	Immediate	2.2	<4	2.23
Methylchforide	Immediate	0.3	4	0.38
Nitrobenzene	Immediate	18	4	16
Sodium Hydroxide	>480	ND	ND	ND
Sulfuric Acid	>480	ND	ND	ND
Tetrachloroethylene	Immediate	410	8	10
Tetrahydrofuran	Immediate	183	<4	>50
oluene	Immediate	HIGH	8	25

TECHNI	4-1	
TECHAN	SOL	RATE
IP4 PINL		
16611141		121111

•		([5013	7)				\subseteq	hee	tifor Sou	nd Polyo
(O. Yd.)	Thickness		ieile	Elong			Trapezo	old Tear	:0	Air Permeability (Cu. Ft./Sq. Ft./Min.)	Mullen Burst (PSI)
(O; `` . Yd.)	(Mils)	MD (Lbs.)	(Lbs.)	MO (%)	CD (%)	Peak (Lbs.)	Avg.	Peak (Lbs.)	Avg. (Lb#.)	(Cu. Fixed, Fixmin)	(F30)-
0.50	4.1	10.8	6.8	80.0	105.0	5.8	4.1	4.1	2.7	880.0	46.0
0.75	5.3	17.1	11.9	95.0	115.0	8.3	5.8	6.2	3.9	660.0	50.0
0.90	7.2	20.8	14.9	100.0	120.0	9.8	6.8	7.5	4.7	590.0	52.0
1.00	7.6	23.3	16.9	105.0	125.0	10.9	7.5	8.4	5.2	555.0	54.0
1.25	10.1	/ 29.6	22 0	115.0	130.0	13.4	9.1	10.5	6.4	500.0	57.0
1.50	11.5	3 5. 9	27.1	120.0	135.0	16.0	10.8	12.5	7.6	420.0	61.0
w,	13.3	42.2	32.2	120.0	140.0	18.5	12.5	14.8	10.1	380.0	65.0
2.00	15.1	48.4	37.3	115.0	135.0	21.1	14.2	16.9	10.1	335.0	68.0
2.25	15.5	54.7	42.3	110.0	130.0	23.6	15.9	19.1	11.4	300.0	7 2.0
	ASTM D1910	-		STM 1682			AS D2:	TM 263		ASTM D737-75	ASTM D3786-80A

no matter what the doior the specs Poly are the parre





MID-ATLANTIC PARK
POST OFFICE BOX 29
1655 IMPERIAL WAY
THOROFARE, NJ 08086-0029
TELEPHONE: {800} 767-6933
(609) 848-5330 FAX: (609) 848-0802

The uest of Poly Bond Ind's knowledge, information in this publication is generally complete and accurate Poly-Bond, Ind. will use its best efforts to keep Indicate current and well asserted men as properties information from time to time as conditions werrant. However, single this information is intended to be a general guide only the specific rectangues are made as to the suitability of any Poly-Bond. Ind. products for daincolor

end uses. Good business practice requires that sufficient leating by performed prior to production of end tiern for release to the market. Poly-Bond, Incis responsibilities for its products are limited to those statud in its standard Terms and Conditions of Sale in 65. Sales Approviding thorm and representations or warrantes, express or implied our mixed separate and apart from such terms and conditions of sales."

Section 4

Other Expendable Supplies and Chemicals

4.1 Other Expendable Supply Information

Features:

- Conforms well to irregular surfaces
- Excellent adhesion to a wide variety of surfaces
- Tears straight, hangs straight, does not curl
- Easy unwind

Typical Values:

Adhesive:	Grey Calendered Rubber/Resi			
Adhesion to Steel (oz./in.):	• ::		45	
Adhesion to Backing (oz./in.):	٠.;		40	
Quickstick (oz./in.):	· · · · · ·	• ;	. 15	
Elongation (%):		·	6.8	
Gauge (Mils):			, 10	100
Tensile (lbs./in.):	.:	· ·	21	
Unwind (lbs./in):		: . :	4.3	
Maximum Performance Temp. (C	F): (200	:
Flame Spread:			15	
Smoke Developed: Values when tested in	-	. :	5	
accordance with UL 723 & ASTM E84-91A		. '* : 		
			** *	

Applications:

- An indispensable Item in the home for all general repair
- Used for bundling, patching and mending
- Useful as an emergency tape for automotive breakdowns





All-Purpose Grade
DUCT TAPE

(52454)

MATERIAL SAFETY DATA SHEET

US Department of Labor
Occupational Safety and Health Administration
OMB No. 1218-0072
OSHA's Hazard Communication Standard
29 CFR 1910 1200
HAZARD RATING (NFPA)
Health
1
Flammability
3
Reactivity
0
Specific
None

IDENTITY Personal Safety Equipment Cleaning Pads P.N 1001 (NESP, WIPE)

SECTION I

Allegro Industries 6403 E. Alondra Blvd Paramount, CA 90723 (310) 633-4861 Chemtrae (800) 424-9300

SECTION II Hazardous Ingredients/Identity Information

Lagradients 24 ACGIHTLV Cas Number

Ispropyl Alcohol 70 400 ppm 67-63-0

SECTION III Physical/Chemical Characteristics

Boiling Point - N/A Specific Gravity - 0.868 - 0.878

Vapor Pressure - 25.7 Melting Point - N/A

Vapor Density - I Evaporation Rate - 1

Appearance & Color - Water white liquid with alcohol order.

N/A = Not Applicable

Revised 3/13:96: Correct MEDS

MATERIAL SAFETY DATA SHEET

Dow Chemical U.S.A.* Midland, MI 48674 Emergency Phone: 517-636-4400

Product code: 72805 Page: 1

Product Name: SD 360 POLYETHYLENE

Effective Date: 06/12/90 Date Printed: 02/27/91 MSDS:000443

INGREDIENTS: (% w/w, unless otherwise noted)

Polyethylene homopolymer

CAS# 009002-88-4 100%

300

This document is prepared pursuant to the OSHA Hazard Communication Standard (29 CFR 1910.1200). In addition, other substances not 'Hazardous' per this OSHA Standard may be listed. Where proprietary ingredient shows, the identity may be made available as provided in this standard.

2. PHYSICAL DATA:

BOILING POINT: Not applicable VAP PRESS: Not applie. VAP DENSITY: Not applie. SOL. IN WATER: Nil SP. GRAVITY: 0.91 - 0.97 APPEARANCE: Translucent white, solid pellets or granules. ODOR: No odor.

3. FIRE AND EXPLOSION HAZARD DATA:

FLASH POINT: Not applic. METHOD USED: Not applic.

FLAMMABLE LIMITS LFL: Not applie. UFL: Not applie.

EXTINGUISHING MEDIA: Water fog. foam, alcohol foam, CO2, domestical.

FIRE & EXPLOSION HAZARDS: Dense smoke emitted when burned without sufficient oxygen. Accumulation of fine dust particles could pose an explosion hazard.

(Continued on page 2)
(R) Indicates a Trademark of The Dow Chemical Company

* An Operating Unit of The Dow Chemical Company

シフログノ

Dow Chemical U.S.A.* Midland, MI 48674 Emergency Phone: 517-636-4400

Product code: 72805 Page: R-1

Product Name: SD 360 POLYETHYLENE

Effective Date: G6/12/90 Date Printed: 02/27/91 MSD5:000443

REGULATORY INFORMATION: (Not meant to be all-inclusive--selected regulations represented.)

NOTICE: The information herein is presented in good faith and believed to be accurate as of the effective date shown above. However, no warranty, express or implied, is given. Regulatory requirements are subject to change and may differ from one location to another; it is the buyer's responsibility to ensure that its activities comply with federal, state or provincial, and local-laws. The following specific

information is made for the purpose of complying with numerous federal, state or provincial, and local laws and regulations. See MSD Sheet for health and safety information.

SARA HAZARD CATEGORY: This product has been reviewed according to the EPA "Hazard Categories" promulgated under Sections 311 and 312 of the Superfund Amendment and Reauthorization Act of 1986 (SARA Title III) and is considered, under applicable definitions, to meet the following categories:

Not to have met any hazard category

(R) Indicates a Trademark of The Dow Chémical Company
The Information Herein Is Given In Good Faith, But No Warranty,
Express Or Implied, Is Made. Consult The Dow Chemical Company
For Further Information.

* An Operating Unit of The Bow Chemical Company

COIKI

Dow Chemical U.S.A.* Midland, MI 48674 Emergency Phone: 517-636-4400

Product code: 72805 Page: 2

Product Name: SD 360 POLYETHYLENE

Effective Date: 06/12/90 Date Printed: 02/27/91 MSDS:000443

FIRE AND EXPLOSION HAZARD DATA: (CONTINUED)

FIRE-FIGHTING EQUIPMENT: Wear positive pressure, self-contained breathing apparatus in any closed space.

4. REACTIVITY DATA:

STABILITY: (CONDITIONS TO AVOID) Temperatures over 572F. 3000 -- will release combustible gases.

INCOMPATIBILITY: (SPECIFIC MATERIALS TO AVOID) None.

HAZARDOUS DECOMPOSITION PRODUCTS: Combustible gases when exposed to temperatures over 572F, 300C.

HAZARDOUS POLYMERIZATION: Will not occur.

5. ENVIRONMENTAL AND DISPOSAL INFORMATION:

ACTION TO TAKE FOR SPILLS/LEAKS: Sweep up and discard. :

DISPOSAL METHOD: Bury in landfill or burn in an adequate incinerator in accordance with applicable local, state, and federal regulations.

6. HEALTH HAZARD DATA:

EYE: Solid or dust may cause irritation or corneal injury due to mechanical action.

SKIN CONTACT: Essentially nonirritating to skin. Mechanical injury only.

SKIN ABSORPTION: A single prolonged skin exposure is not likely to result in the material being absorbed through skin in harmful amounts.

(Continued on page 3)
(R) Indicates a Trademark of The Dow Chemical Company

An Operating Unit of The Dow Chemical Company

ころつ

Dow Chemical U.S.A.* Midland, MI 48674 Emergency Phone: 517-636-4400

Product code: 72805 Page: 3

Product Name: SD 360 POLYETHYLENE

Effective Data: 06/12/90 Date Printed: 02/27/91 ASDS:000443

6. HEALTH HAZARD DATA: (CONTINUED)

INGESTION: May cause choking if swallowed. Single dose oral toxicity is believed to be very low. Considered physiologically Inert.

INHALATION: Vapors are unlikely due to physical properties.

Single exposure to dust is not likely to be hazardous.

SYSTEMIC & OTHER Effects: No relevant information found.

7. FIRST AID:

EYES: !rrigate immediately with water for at least 5 minutes. Mechanical irritation only.

SKIN: Wash off in flowing water or shower.

INGESTION: No adverse effects anticipated by this route of exposure incidental to proper industrial handling.

INHALATION: No adverse effects anticipated by this route of exposure incidental to proper industrial handling.

8. HANDLING PRECAUTIONS:

EXPOSURE GUIDELINE(S): None established.

VENTILATION: Good general ventilation should be sufficient.

RESPIRATORY PROTECTION: No respiratory protection should be needed.

SKIN PROTECTION: No precautions other than clean body-covering clothing should be needed.

EYE PROTECTION: Use safety glasses.

9. ADDITIONAL INFORMATION:

(Continued on page 4)

(R) Indicates a Trademark of The Dow Chemical Company

An Operating Unit of The Dow Chemical Company

BAGS

Dow Chemical U.S.A.* Midland, MI 48674 Emergency Phone: 517-636-4400

Product code: 72805 Page: 4

Product Name: SD 360 POLYETHYLENE

Effective Date: 06/12/90 Date Printed: 02/27/91 MSDS:000443

9. ADDITIONAL INFORMATION:

SPECIAL PRECAUTIONS TO BE TAKEN IN HANDLING AND STORAGE: Practice reasonable care and caution in handling.

MSDS STATUS: Revised section 9 and regsheet.

For information regarding state/provincial and federal regulations see The Regulatory Information Section. (R) Indicates a trademark of The Dow Chemical Company

* An Operating Unit of The Bow Chemical Company

Material Safety Data Sheet (Pムーローン)

4 mil (d) lemil Poly Film

looming (As Used on Label and List) Polyole:	fin (CH2 -	CIP)n				
Section 1	<u> </u>	·				
Manufacture's Name		Emonsonary Telephone Humber (612)469-5461				
Roxam Flexible Packaging Address 8235 220th Street West		(800) 328-4080				
		(800) 328-4080 Date Proposed				
Lakeville, MN 55044						
		Signature of Preparer (optional)				
Section II - Hazardous Ingradiants/Ider	itity Informatio	on ,				
			Other Units			
Hazardous Compinions (Specific Chemical Marality: Polyethylene is not considere			Recommended % (Optional)			
		2000 MA 00 1 X 000 1				
· · · · · · · · · · · · · · · · · · ·	,					
Chemical Name: Polyethylene	Film					
Trade Name & Synonyms: StarFl	lex Film					
<u> </u>						
						
- Marine						
Section III - Physical/Chemical Characte	oristics					
Colleng Point		Specific Cravity (HQO = 1)				
apor Pressure (mm Hg)	N/A	Manuel Point	0.91 - 0.97			
	N/A	<u> </u>	0.1%			
apor Density (AIR = 1)	N/A	Evaporation Rate (Butyr Acetate = 1)	nil			
olubility in Water	- 					
Posturance and Odox						
Film solid with ne		ydrocarbon odor				
ection IV - Fire and Explosion Hazard I						
ush Point (Method Used) 353 deg. + 12 deg.C - ASTM D-	1929 Flam	nutle Limite ILEL N/A	:UEL			
Mater, fog, CO2 foam - dry ch						
- Fighting Procedures						
Nothing_special						
News			<u> </u>			
Nothing apecial						
			···································			

(4 MIL & KMIL POLY FILM)

	Section	٧-	Reactivity	Data
--	---------	----	------------	------

•	Urelabic		Conditions to Avoid	, , , , , , , , , , , , , , , , , , ,	
I	Stabia				
		x	360 deg. C		
incompatibility (C	Admas to Avoid) Lein, Hydro	carbons, an	d oxidation products	are produced	at high temperatures.
Hazardous Deco	mposition or Cypro-	lucis	<u></u>		
Hazandixas	May Occur	Ţ .	Conditions to Avnid		
Polymortzation					
	Will Not Occur	x			
Section VI - I	Health Hazard	Data			
Route(s) of Entry		Inhalation?	Skin'/		Ingesti vi?
House Harnede H	Acuto and Chronic)				
FACILITY FACER CY (A	action and cancerna,				
Ceronogenicaty:		NIP?	IARC Mixiographs?		Osha Raquator?
	-				
Signs and Sympk	one of Exposure		,		
-		···			
	<u> </u>				***
Moderal Condition	s Conorally Aggrav	stop by Extrocure			
·					
cy and Fi	irst Aid Procedures				
		_			
Section VII - F	Precautions for	Save Handling	g and Use		
•		Released or Spile			
_Film_is_a	a_sli ppi ng_	hazard in c	omplia nce_with feder	ral,-state,-an	d-local-reg ulations.
			-	_	<u>-</u>
Waste Disposal Me	Shod				
		··· ·			
	Takon in Handling a	ad Stane			
THESIONORES TO BU	(aver at Leasing a	ina Storing			
Xhar Procautions					*
Section VIII - (Control Measu	res			
Rospiratory Protoc	tion (Specify Type)				•••
(entilation	Local Exhaust			Spacial	
		for high t	emperature processir	•	
	Mechanical (Cener	nt)	• • • • • • • • • • • • • • • • • • • •	- Omer	
rox			Eye Protoction		
Xner Protective C	lothing or Equipmen	;;	,		
5					

4.2 Chemicals including Materials Safety Data Sheet (MSDS)

PRODUCT DATA

L-B-C **LEAD BARRIER COMPOUND**

(Type I - Interior)

DESCRIPTION

Product No.: 5400 - Antique Linen

> 5401 - White (custom colors available)

L-B-C[®] Type I is an elastomeric-thermoplastic water based copolymer that meets or exceeds all projected federal, state and local standards for lead-based paint encapsulants. Blended specifically to form a barrier to lead-based paint on interior surfaces, L-B-C Type I has been independently tested to the ASTM E-1795 requirements for a Category I encapsulant. L-B-C Type I has been approved by Massachusetts (No. DL-9977), authorized by the State of Connecticut, and accepted by the states of Ohio, New York and Maryland. L-B-C Type I has also been classified by Underwriters Laboratories (UL* Ref. # 8N32). L-B-C Type I is environmentally friendly and complies with all federal and state VOC requirements. L-B-C Type I has a limited twentyyear warranty, as required by HUD Guidelines and FPA regulations. L-B-C Type I contains Bitrex*, a ter-tasting, nontoxic anti-ingestant to discourage .. al contact.

The required minimum 7 mil dry film thickness of L-B-C Type I offers unparalleled coverage and economics. In addition, the lower film thickness reduces stress on the existing paint system and maintains architectural detail. Approved for use in all 50 states.

PROPERTIES

 Percent Solids: 53 ±2% by weight 42 ±2% by volume

Volatile: Principally water

Average particle size: 0.2 microns

Viscosity at 78°F: 120 - 130 Krebs Units Weight per gallon @ 78°F: 10.1 ±0.2 lbs/gal.

Flash Point: Noncombustible (water-based)

Odor: Virtually odorless

Shelf Life: @ 78°F, 36 months minimum, (in original factory sealed containers)

Finish: Eggshell. 60° specular gloss 17 ±5

Minimum dry film thickness: 7 mils

Coverage:

Airless Spray: 100 ft2/gal. (7 dry mils) Brush: 200 ft2/gal. (4 dry mils)

Dry Time @ 78°F:

To touch: 1 - 2 hours Additional coats: 8 - 16 hours Full cure: 7 - 15 days (7 days ambient)

 Fire rating ASTM E84-81a: Class "A" (Southwest Research Institute)

Flame Spread: 0 Smoke Developed: 5

Packaged: 1, 5, and 55 gallon containers







SURFACE PREPARATION

Consult all related local, state and federal regulations prior to surface preparation regarding work practices and personal protection to be used. Dry sanding, scraping and other surface preparation procedures can create toxic dust and hazardous waste. A HEPA (High Efficiency Particulate Air) vacuum should be used on all surfaces to remove hazardous dust and particles. Use MSHA/NIOSH approved or equivalent respiratory protection suitable for concentrations and types of air contaminants encountered. For detailed and specific information regarding surface preparation, refer to L-B-C Type I Specification.

L-B-C Type I must be applied when the atmosphere and surface temperatures are above 50°F. Inspect all surfaces to be treated to insure they are clean, dry and free of all foreign matter including: dust, rust, grease, oil, mildew, glue size, calcimine, wax, soap, loose paint, etc. Patch and repair irregularities in surfaces with prepared vinyl paste or appropriate patching compound. Allow to dry and wet sand until smooth. Where necessary due to discoloration, water-damage, rust, etc., use appropriate Fiberlock primer. For high gloss or newly painted surfaces, wet scour with a coarse scouring pad and apply Lead Prep® (I or II) or any other approved liquid surface cleaner.



FIBERLOCK TECHNOLOGIES, INC.

630 Putnam Avenue, P.O. Box 390432 Cambridge, MA 02139-0802 U.S.A. Toll Free: 1-800-FIBERLK Tel. (617) 876-8020 FAX (617) 547-6934

MATERIAL SAFETY DATA SHEET

(Essentially similar to OSHA form 174, Sept. 1985 - For Compliance with OSHA's Hazard Communication Standard, 29CFR 1910.1200)

ction I - Product Identity:

L-B-C[®], Lead Barrier Compound, Type I - Interior Date of Preparation: December 4, 1997

unufacturer's Name: perlock Technologies, Inc.

Information Telephone Number:

630 Putnam Avenue Cambridge, MA 02139-0802

(617) 876-8020

Mail Address:

Emergency Telephone Numbers: Weekdays: (617) 876-8020 (After hours, weekends & holidays)

P.O. Box 390432

(508) 887-5926, or "CHEM-TEL" Emergency

Cambridge, MA 02139-0802

Contact Number: (800) 255-3924

Section II - Hazardous Ingredients/Identity Information

%

COMPONENT

COMMON NAME(S)

NO.

OSHA PEL

OR

ACGIH TLV

None per the limits for reporting set forth in 29CFR 1910.1200 (1)

Section III - Physical/Chemical Characteristics (See reference note(s) No. 1, 2 on Reverse)

Boiling Points of Major Constituent: (Water)	212°F	Specific Gra	vity (H,O=1) Wgt/gal.	10.4
Vapor Pressure (mm Hg) @ 68°C	17	Melting	Point Water (Ice)	32°F
Vapor Density (AIR=1) Heavier Lighter	х		poration Rate yl Acetate=1)	Slower
Solubility in Water	Total	Appearance and Odor	Viscous liquid; slīght odor	Maximum VOC's 250 g/l

Section IV - Fire and Explosion Hazard Data Non-Flammable

ash Point:	Flammable Limits:	DOT Hazard Class:	Marking:
วท-Combustible	LEL: N/A UEL:N/A	Non Regulated	*Keep From Freezing*

ction V - Reactivity Data

Hazardous Polymerization: Will not occur.

Stability: Stable

Incompatibility: Avoid Contact with: Strong oxidizing agents (e.g., nitric acid, permanganates), etc.

Hazardous Decomposition Products: Some carbon monoxide

Section VI - Health Hazard Data, Toxicity Data

Route(s) of Entry: N/A Carcinogenicity?: No

Health Hazards (Acute and Chronic):

EFFECTS OF OVEREXPOSURE: Inhalation, vapors or spray mists may be slightly irritating to eye, nose, throat, and mucous membranes of respiratory tract producing symptoms of headache, nausea in poorty ventilated areas. Skin Contact: Prolonged or repeated contact with coating may cause slight skin irritation. Eye Contact: Direct contact; inconsequential eye irritation. Ingestion: May cause nausea and intended expectoration.(2)

EMERGENCY AND FIRST AID PROCEDURES: Inhalation: Remove to fresh air. Eye and Skin Contact: Immediately flush eyes with plenty of water for at least 15 minutes and consult physician; wash skin thoroughly with soap and water. If drenched, remove and wash clothing before reuse. Ingestion: If victim is conscious, give 2 glasses of water. Call a physician.

SUPPLEMENTAL INFORMATION

To comply with New Jersey DOH Right-To-Know labeling law (N.J.A.C. 8:59 - 5.1 & 5.2)

CAS. No.: 7732-18-5 CHEMICAL INGREDIENTS:

Water

13463-67-7 Titanium dioxide

Proprietary inert extender* Not. Available Not Available Proprietary surfactant* Proprietary resin solids* Not Available

*contents partially unknown

HMIS HAZARD RATING				
Health 1	Flammability 0	Reactivity 0	Personal Protection E	
	H	IAZARD INDEX		
	0=Minimal, 1≂SligI	hl, 2=Moderate, 3=Se	erious, 4=Severe	
	PERSONA	AL PROTECTIO	N CODE	
E=\$af	ety Glasses, Gloves, Du	ust Respirator - for air	rless-spray applications only	

S: 9This product contains titanium dioxide pigment classified by ACGIH as a "nuisance dust". Exposure to spray mists or sanding dusts should be controlled to below 10 mg/ n. unrough usage of NIOSH-approved dust filter respirators.
Contains 0.04% (Denatonium Benzoate NF - XVII) as an anti-ingestion agent - yields a very bitter taste.

PRODUCT DATA



L-B-C® LEAD BARRIER COMPOUND (Type II - Exterior)



DESCRIPTION

Product No.: 5500 - Antique Linen

5501 - White (custom colors available)

L-B-C Type II is an elastomeric-thermoplastic water-based copolymer blended specifically to form a durable, flexible, and permanent barrier between lead-based paint and the environment on exterior surfaces. It has been independently tested and found to meet or surpass ASTM E-1795, Standard Specification for Non-Reinforced Liquid Coating Encapsulation Products for Leaded Paint in Buildings. Formulated specifically for exterior, low-temperature projects, the minimum 38°F air and surface application temperatures make L-B-C Type II a superior encapsulant for exterior lead-paint abatement projects.

L-B-C Type II has a limited twenty-year warranty, as required by HUD Guidelines and EPA regulations.

'-B-C Type II is environmentally friendly and comies with all federal and state VOC requirements. L-C Type II contains Bitrex*, a bitter-tasting, nontoxic anti-ingestant to discourage oral contact. The required minimum 7 mil dry film thickness of L-B-C Type II offers unparalleled coverage and economics. In addition, the lower film thickness reduces stress on the existing paint system and maintains architectural detail. Approved for use in all 50 states.

PROPERTIES

Percent Solids by weight: 53 ±2%;

by volume: 42 ±2%

· Volatile: Principally water

Average particle size: 0.2 microns

• Viscosity at 78°F: 120 - 130 Krebs Units

Weight per gallon @ 78°F: 10.3 ±0.2 lbs/gal.
 Flash Point: Noncombustible (water-based)

Odor: Virtually odorless

Shelf Life: @ 78°F, 36 months minimum, (in original factory sealed containers)

• Finish: Eggshell. 60° specular gloss 17 ±5

· Minimum dry film thickness: 7 mils

Coverage:

Airless Spray: 100 ft²/gal. (7 dry mils) Brush: 200 ft²/gal. (4 dry mils)

Dry Time @ 78°F:

To touch: 2 - 4 hours

Additional coats: 8 - 16 hours

Full cure: 7 - 15 days (7 days ambient)

• Fire rating ASTM E84-81a: Class "A"

(D/L Laboratories, NY) Flame Spread: 5

Smoke Developed: 0

• Scrub Resistance: 2550+ cycles (ASTM D2486)

· Packaged: 1, 5, and 55 gallon containers

SURFACE PREPARATION

Consult all related local, state and federal regulations prior to surface preparation regarding work practices and personal protection to be used. Dry sanding, scraping and other surface preparation procedures can create toxic dust and hazardous waste. A HEPA (High Efficiency Particulate Air) vacuum should be used on all surfaces to remove hazardous dust and particles. Use MSHA/NIOSH approved or equivalent respiratory protection suitable for concentrations and types of air contaminants encountered. For detailed and specific information regarding surface preparation, refer to L-B-C Type II Specification.

L-B-C Type II must be applied when the atmosphere and surface temperatures are above 38°F. Inspect all surfaces to be treated to insure they are clean, dry and free of all foreign matter including: dust, rust, grease, oil, mildew, glue size, calcimine, wax, soap, loose paint, etc. Patch and repair irregularities in surfaces with prepared vinyl paste or appropriate patching compound. Allow to dry and wet sand until smooth. Where necessary due to discoloration, water-damage, rust, etc., use appropriate Fiberlock primer. For high gloss or newly painted surfaces, wet scour with a coarse scouring pad and apply Lead Prep* (i or II) or any other approved liquid surface cleaner.



FIBERLOCK TECHNOLOGIES, INC.

630 Putnam Avenue, P.O. Box 390432 Cambridge, MA 02139-0802 U.S.A. Toll Free: 1-800-FIBERLK Tel. (617) 876-8020 FAX (617) 547-6934

MATERIAL SAFETY DATA SHEET

(Essentially similar to OSHA form 174, Sept. 1985 - For Compliance with OSHA's Hazard Communication Standard, 29CFR 1910.1200)

ction I - Product Identity:

L-B-Co, Lead Barrier Compoundo, Type II -Exterior

anufacturer's Name:

oerlock Technologies, inc.

630 Putnam Avenue Cambridge, MA

02139-0802

Cambridge, MA 02139-0802

Mail Address: P.O. Box 390432 Date of Preparation: December 4, 1997

Information Telephone Number:

(617) 876-8020

Emergency Telephone Numbers: Weekdays: (617) 876-8020 (After hours, weekends & holidays)

(508) 887-5926, or "CHEM-TEL" Emergency

Contact Number: (800) 255-3924

Section II - Hazardous Ingredients/Identity Information

COMPONENT

COMMON NAME(S)

%

NO

OSHA PEL

OR

ACGIH TLV

None per the limits for reporting set forth in 29CFR 1910.1200 (1)

Section III - Physical/Chemical Characteristics (See reference note(s) No. 1, 2 on Reverse)

Boiling Points of Major Constituent: (Water)	212*F	Specific Gra	vity (H,O=1) Wgt./gal.	10.4
Vapor Pressure (mm Hg) @ 68°C	17	Melting	Point Water (Ice)	32°F
Vapor Density (AIR=1) Heavier Lighter	X		poration Rate yl Acetate=1)	Slower
Solubility in Water	Total	Appearance and Odor	Viscous liquid; slight odor	Maximum VOC's 250 g/l

Section IV - Fire and Explosion Hazard Data Non-Flammable

ash Point:	Flammable Limits:	DOT Hazard Class:	Marking:	\neg
on-Combustible	LEL: N/A UEL:N/A	Non Regulated	"Keep From Freezing"	

ction V - Reactivity Data د

Hazardous Polymerization: Will not occur.

Stability: Stable

Incompatibility: Avoid Contact with: Strong oxidizing agents (e.g., nitric acid, permanganates), etc.

Hazardous Decomposition Products: Some carbon monoxide

Section VI - Health Hazard Data, Toxicity Data

Route(s) of Entry: N/A Carcinogenicity?: No

Health Hazards (Acute and Chronic):

EFFECTS OF OVEREXPOSURE: Inhalation, vapors or spray mists may be slightly imitating to eye, nose, throat, and mucous membranes of respiratory tract producing symptoms of headache, nausea in poorly ventilated areas. Skin Contact: Prolonged or repeated contact with coating may cause slight skin irritation. Eye Contact: Direct contact; inconsequential eye irritation. Ingestion: May cause nausea and intended expectoration.(2)

EMERGENCY AND FIRST AID PROCEDURES: Inhalation; Remove to fresh air. Eye and Skin Contact: Immediately flush eyes with plenty of water for at least 15 minutes and consult physician; wash skin thoroughly with soap and water. If drenched, remove and wash clothing before reuse. Ingestion: If victim is conscious, give 2 glasses of water. Call a physician.

SUPPLEMENTAL INFORMATION

To comply with New Jersey DOH Right-To-Know labeling law (N.J.A.C. 8:59 - 5.1 & 5.2)

CAS. No.: 7732-18-5 13463-67-7 1317-65-3

Not Available

CHEMICAL INGREDIENTS: Water

Titanium dioxide Calcium Carbonate Proprietary surfactant* Proprietary resin solids*

Not Available *contents partially unknown

[HMIS HAZARD RATING						
Health 1	Flammability 0	Reactivity 0	Personal Protection E				
	Н	AZARD INDEX					
	0=Minimal, 1=Stigt	nt, 2=Moderate, 3=S	erious, 4=Severe				
	PERSONA	L PROTECTIO	ON CODE				
E=Safe	ly Glasses, Gloves, Du	ist Respirator - for a	irless-spray applications only				

S; or This product contains trianium dioxide pigment classified by ACGIH as a "nuisance dust". Exposure to spray mists or sanding dusts should be controlled to below 10 mg/ m- through usage of NIOSH-approved dust litter respirators, 🗈 Contains 0.04% (Denatonium Bertzoate NF - XVII) as an anti-ingestion agent - yields a very bitter taste.

Highly concentrated LEDIZOLV removes lead-contaminated dust on any surface—yet it has a mild pH, is phosphate-free and completely biodegradable

THE result of extensive research and development, LEDIZOLV is a liquid, phosphate-free, leaddissolving, controlled-foam anionic detergent.

LEDIZOLV has outstanding metalion solubilizing properties at concentrations as low as 2% even at ambient temperatures.

Although concentrated, LEDIZOLV has a mild pH, excellent health-safety and handling characteristics and is biodegradable and readily disposable.

LEDIZOLV reduces costly clearance-testing failures Unlike trisodium-phosphate (TSP) detergents, LEDIZOLV is free-rinsing.* While TSP actually precipitates lead—it won't solubilize or hold it in solution— LEDIZOLV has been formulated to

exhibit very high complexing, sequestering and metallic-ion solubilizing with many di-valent, tri-valent and tetra-valent metallic ions, combined with excellent hard-surface detergency.

As a result, LEDIZOLV helps reduce clearance-testing failures, eliminating additional costs for recleaning and retesting as well as reoccupancy delays.

In addition, LEDIZOLV's zero-phosphate level and near-neutral pH reduce disposal difficulties.


And, as a hard-surface cleaner LEDIZOLV exhibits good wetting, emulsifying, sequestration, chelating, soil deflocculating and rinsing properties-to reduce additional environmental concerns in lead abatement.

Physical Data


Property pH (1% in DI water)	Typical Result
pH (1% in DI water)	5.4
(2% in DI water)	5.4
(as is)	5.3
Surface Tension (1% in DI water)	34.0 dynes/cm.
Phosphate Content	0
Solubility in Water	Complete in all
•	proportions
Specific Gravity	1.080
Biodegradability	Complete
	_

Health Safety Information


OSHA Hazardous Ingredients: Flammability: Oral Toxicity:	None Non-Flammable No ingredient defined
F 1 1 1 1 1	as an oral toxicant by OSHA
Eye Irritation:	Moderate eye irritant
Inhaled Irritant:	Non-Irritating
Carcinogenicity:	No
NTP:	No
IARC:	No
OSHA:	No
National Fire Protection Associati	ion
704 Degree of Hazard Labeling	
Fire:	0
Reactivity:	0
Health:	0
Other:	None

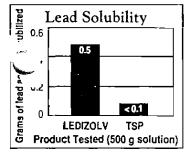

Lead Solubility—LEDIZOLV also exhibits a far greater capacity to solubilize lead. Other products, in fact, do not solubilize any lead at all but form an insoluble precipitate, lead phosphare.

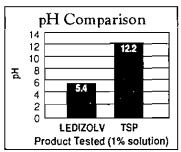

pH—At 1% LEDIZOLV has a pH of approximately 5.4, very near the neutral pH of 7. In addition to mildness of product, LEDIZOLV requires fewer adjustments prior to disposal.

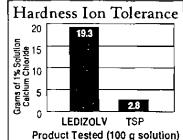


Hardness Ion Tolerance-LEDIZOLV has a substantially higher tolerance to calcium. In areas where hard water is common, LEDIZOLV possesses sufficient water softening properties to maintain its capacity to remove lead even when mixed with hard water.

LEDIZOLV beats all other

lead-abatement solutions 50 to 1

50 gallons of lead dissolving cleaner

(2% solution)—making LEDIZOLV (2 the cost-effective solution to your d-contaminated dust problems

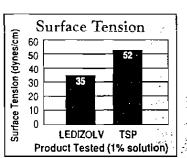

Surface Tension—LEDIZOLV has a lower water surface tension, effectively making water "wetter". This results in a greater ability to penetrate and spread out evenly and thor oughly on a given surface



128 Wharton Road Bristol, PA 19007 800/827-2338 - 800/827-8036 FAX



TSP is also highly alkaline with a pH over 12, and its residue can drastically decrease the adhesion properties of encapsulants.

MATERIAL SAFETY DATA SHEET

LEDIZOLVTM

HIN-COR INDUSTRIES, INC.

136 Sea Island Parkway Suite #10502 Beaufort, South Carolina 29902

I-IDENTIFICATION

Product Name (As appears on label)

CAS Registry Number

Effective Date

Chemical Family

LEDIZOLV"

Not Applicable

March 1, 1993

Anionic Liquid Detergent

II-HAZARDOUS INGREDIENTS/IDENTITY INFORMATION

There are no hazardous ingredients in LEDIZOLV* as defined by the OSHA Standard and Hazardous Substance List 29 CFR 1910 Subpart Z.

220°F

No data

No data

No Data

Not Applicable

1.080

III-PHYSICAL/CHEMICAL CHARACTERISTICS

Boiling Point (F)

Vapor Pressure (mm Hg) Vapor Density (AIR = 1) Specific Gravity (Water = 1)

Melting Point

Evaporation Rate (Butyl Acetate=1)

Appearance and Odor

Solubility in Water

1-FIRE AND EXPLOSION DATA

Fiash Point (Method Used)

Flammable Limits Extinguishing Media

Special Firefighting Procedures

None (Open cup)

LEL No Data UEL No Data

Water, dry chemical, CO2, foam

Completely soluble in all proportions Amber liquid-slight ammonia odor

Self-contained positive pressure breathing apparatus and protective clothing should be worn in fighting fires involving

chemicals.

None Unusual Fire and Explosion Hazards

V-REACTIVITY DATA

Stability

Hazardous Polymerization

Incompatibility (Materials to Avoid)

Hazardous Decomposition or Byproducts

Stable

Will not occur

Strong oxidizing agents

May release ammonia, mrbon monoxide or carbon dioxide on

burning

<u>VI-HEALTH HAZARD DATA</u>

Route(s) of Entry

Inhaiation?

No

Skin?

Yes

Ingestion?

Yدs

Health Hazards (Acute and Chronic)

Material may cause eye irritation and/or burns. May muse

skin irritation.

Curcinogenicity

NTY!

Ňο

LARC Monographs?

No

OSHA Required?

No

Material Safety Data Sheet

PAINT STRIPPER

Date last reviewed: June 30, 1997

I. General Information

Chemical Name & Synonyms	Trade Name & Synonyms
Proprietary Blend	Peel Away 1
Chemical Family	Formula
Alkaline	Mixture
Proper DOT Shipping Name	DOT Hazard Classification
Sodium Hydroxide Solld Mixture, UN1823	Containers smaller than 25 lbs (11 kg) - ORM-D. Containers greater than 25 lbs (11 kg) - Corrosive Material
Manufacturer	Manufacturer's Phone Number
Dumond Chemicals, Inc.	(212) 869-6350
Manufacturer's Address	Emergency Number:
1501 Broadway, New York, NY 10036	(800) 457-4280

11. Ingredients

Principal Hazardous Components	CAS#	Percent	PEL.	TLV
Calcium Hydroxide	1305-62-0	21	5 mg/m³ TWA (respirable fraction)	5 mg/m³ TWA
Magnesium Hydroxide	1309-42-8	16	None Established	None Established
Sodium Hydroxide	1310-73-2	9	2 mg/m³ TWA	2 mg/m³ Ceillng
Non-hazardous Ingredients	N/A	Balance	None Established	None Established

SARA 313: This product contains no chemicals that are regulated under SARA Title III, section 313.

III. Physical Data

Boiling Point (*F)	Specific Gravity (H ₂ 0 =1)
Greater than 212	1.33
Vapor Pressure (mm Hg)	Percent Volatile by Volume (%)

@ 20°C same as water 51.5

Vapor Density (Air=1) Evaporation Rate (Butyl Acetate =1) same as water same as water

Solubility in Water Complete

Appearance & Odor

White paste, no odor.

IV. Fire & Explosion Hazard Data

pН

13

Flash Point (Test Method	Autolgnition Ten	perature	
None	None		
Flammable Limits	LEL	UEL	
None	N/A	N/A	

Extinguishing Media

This material is not combustible. Use media appropriate for the surrounding fire.

Special Fire Fighting Procedures

Vear full emergency equipment and NIOSH approved positive pressure SCBA. Cool ontainers with water.

Unusual Fire & Explosion Hazards

At elevated temperatures containers may rupture. Contents are corrosive. All personal contact should be avoided: ...

LINE DANKA Daniel L. 2

(PG2)

Ther Precautions

Use only with appropriate protective equipment. Wash thoroughly after use.

PEERAWAY I PAINTSTRIPPER

Data Sheet

,	l, Gener	al Information		
emical Name & Synanyms Acetic Acid Solution		Trade Name & Syna Peel Away h	Meutralize	* (2) 10Y)
emicel family Organic acid	Formula COOH -	H ₂ O		
oper DOI Shipping Name !Acetic acid solution, UI	¥ 2790	DOT Hezard Cleuille Corrosive n	cailon	
Dumond Chemicals, Inc.		Manufacture's Phon (212) 869-1	5350	
Abaufacturer's Address 1501 Broadway, New York	, NY 10036	(800) 457-4	OOX Emerg 1280	gency Number:
:	II. In	gredients		
frindpol Hazardov	Cemponents	Percent	PEL/Th	reshold Limit Value (units)
Acetic Acid (80%)	64-19-7	30	10 pr	an 10 ppm
Water	7732-18-5	70	N	one Established
·			-	
SARA 313: This product	contains no chemica	ils that are regula	ated under	r SARA Title III,
section 313.				
1				
	III. Ph	ysical Data		
eiling Point (°F) 224F	4-4-4-1	Spedic Gravity (Hic	1.04	
(aper Pressure (mm Kg.) 6 20C 11.8		Percent Volatile By V		
Veger Dendity (Air = 1) 2.07		fraporation Rate (B	utyle 1)	
Selybillry in Water Complete		рH	1	ox. 3.0
Appearance & Odor	, characteristic od	or of vinegar.		
	سري استحجازات واستحجاجات	losion Hazard D)ata	
Flash Folia (Test Method) NODE	· · · · · · · · · · · · · · · · · · ·	Auto Ignition Tampe		
Flammable Umits None		IEL N/A		UEL N/A
Exingulating Medic This materia	l is not combustible	. Use any media a	ppropriat	<u> </u>
petal Fre Fighting Procedures	rotective equipment			
containers with water.		wie contract contract		
usi fire & Explosion Hazards	temperatures contai	ners nev runture.		
AL GIGINGO	,			and the second

SEP 20 '91 04:08 HARVEST ADVERT	732 865
	PG-2) PEELAWAY
	Hazard Data (NENTRACIZER)
OSHA Permissible Exposure Limit See Section II	ACOIN Threshold Umit Value 5 10 1
Carcinogen · NTP Program	Careinagen - LARC Program
Symptoms of Exposure	l No
	ikin: irritation or burns, Inhalation: irritat
. to eyes & upper respiratory tract. Impart	
Medical Canditions Approvated by Exposure Chronic respiratory or skin diseases.	Michigan Palitania, participal
	•
Primary Route(s) of Entry Eyes, skip, inhalation, ingestion	
Well with soap a water. Remove contaminated	tes. Get immediate medical attention. Skin: w clothing. Inhalation: Remove to fresh air. Sc glasses of water. Do not induce vomiting. Ge
immediate medical attention.	granges of water. 20 feet makes void ting. G
VI. Rea	ctivity Data
Stability X Stable Conditions To Avoid N/A	
Materials Te Avaid	The state of the control of the state of the
11ncomposability 8th	ong alkalies, oxidizers, reducing agents.
Polymerization X Will Not Occur Conditions To Avail N/A	• •
Hazardaus Decomposition Products	The state of the same of the s
Carbon monoxide, carbon dioxide, oxides of	Protection Procedures
Sell Response	I Frojection Procedures
Wear appropriate protective equipment. Ne	utralize with baking sods and collect, Flush
area with water.	
White Dispose in accordance with all state, loca	l and federal regulations,
•	
VIII. Special Pro	tection Information
Evè Pratection	Skin Protection
Chemical googles/Face shield	Ventilation Recommended
Respiratory Protection (Specific Type) Organic Vapor or self-contained	Adequate general or local exhaust
Other Pretection Impervious apron, boots, eye wash, safety	shower as needed.
IX. Specie	al Precautions
Hygienic Fractices in Handling & Storage : Store in a cool, well ventilated area away	
	•
mannagersongancheanongammannessanappan Prevent eye and skin contact. Avoid brest	Work Practices:
: and appropriate protective equipment	ermente de la companya del companya del companya de la companya de
Other Precoutient	والمراقع والمستخفظ فالمرافع المراجع والمنطقة والمراجع والمراجع والمراجع والمراجع والمراجع والمراجع والمراجع والمراجع
Wash thoroughly after use. Empty contains	
•	

PRODUCT DATA

P-III Neutralizer

DESCRIPTION

P-III Neutralizer is an organic solution used to neutralize surfaces after the application of Piranha III and Piranha V paint strippers. It is pre-mixed and ready to use.

PREPARATION

Remove as much leftover residue as possible by scraping and wiping. Wear proper respiratory equipment prior to spray application.

APPLICATION

Apply the P-III Neutralizer by spray application. Wipe down the surface and allow it to dry. If a white film forms on the surface, repeat the process. Test the pH level if possible. Allow surface to dry thoroughly before applying Fiberlock's Lead Shield or any other approved lead based paint post removal lockdown.

P-III Neutralizer can be successfully applied in a one coat application with most airless spray equipment including Graco*, Wagner*, Titan*, Binks* and Hero*.

COVERAGE

400 sq.ft/gal.

CLEAN UP

Clean up tools and drippings with soapy water. Properly dispose of waste in accordance with local, state and federal regulations. Keep container closed when not in use.

FIRST AID

For skin irritation, wash with water immediately. If irritation persists seek medical attention. In case of eye contact, flush thoroughly with water. Get medical attention. If ingested, drink water or milk and seek medical attention.

CAUTIONS

Spray mists from the P-III Neutralizer may be irritating to the nose and throat. Wear protective clothing and rubber gloves. Wear eye protection at all times. P-III Neutralizer can be slippery when spilled on the floor.

Recommended settings for airless spray equipment:

Pressure: 1800 - 2000 psi Hose length: 50 - 100 feet Hose diameter: 1/4 inch Tip orifice size: 0.021" - 0.025" (ideal setting: 0.023") Tip fan size: 521

KEEP FROM FREEZING FOR PROFESSIONAL USE ONLY KEEP OUT OF REACH OF CHILDREN

There suggestions and data are based on information we believe to be reliable. They are offered in good faith, but without guarantee, as conditions and methods of use of this product are beyond our control. Neither Fiberiock Technologies, inc., nor its agents shall be responsible for the sam or results of use of this product or any injury, loss or damage, direct or consequential. We recommend that the prospective user should determine the suitability of P-III Neutralizer for each specific project and for the health and safety of personnel



FIBERLOCK TECHNOLOGIES, INC.

MATERIAL SAFETY DATA SHEET

(Essentially similar to OSHA form 174, Sept. 1985

For compliance with OSHA's Hazard Communication Standard, 29CFR 1910.1200)

SECTION I: PRODUCT IDENTITY:		Piranha III™ Neutralizer # 5735		
Company Name:		Date of Preparation: 2/27/95		
Fiberlock Technologies, Inc.		mation Phone Number: / (61	7) 876-8020	
/630 Putnam Avenue		rgency Phone Numbers:	•	
Cambridge, MA 02139-0802		kdays 617-876-8020		
		kends & Holidays (508) 887-5		
		EM-TEL" Emergency Contac	t Number	
	(800)	255-3924		
SECTION II: HAZARDOUS INGREDI	ENTS/ID	ENTITY INFORMATION		
Hazardous Common	%	ACGIH (TLV-TWA)	OSHA PEL	
Components: Names:			or ACGIH TLV:	
Citric Acid (77-92-9)		None Established		
Nonyiphenol ethoxylate (127087-87-0)		None Established		
Polyethylene Glycol (25322-68-3)		None Established		
SECTION III: PHYSICAL/CHEMICAL	CHARA	CTERISTICS		
Boiling points of Major Constituent(s):		212°F		
Specific Gravity (Water=1) lbs/gal:		1.05		
Vapor Pressure (mm Hg) at 100°C:		ND		
Vapor Density (AIR=1):		ND		
% Volatile:		85		
Solubility in Water:		Soluble		
Donabinity in Travell		7714010		

SECTION IV: FIRE AND EXPLOSION HAZARD DATA

Flash Point: None

Flammable Limits in Air, % by weight: LEL: ND UEL: ND

Extinguishing Media: Regular Foam or Carbon Dioxide or Dry Chemical

DOT Proper Shipping/Hazard Name (49 CFR 172.101): Compound, cleaning liquid, 8, NA 1760,III (contains Citric Acid)

DOT ID# (49 CFR 172.101): NA 1760

DOT Hazard Class (49 CFR 172.101): Corrosive

Special Firefighting Procedures: Wear self-contained breathing apparatus with a full face piece operated in the positive pressure demand mode when fighting fires.

Unusual Fire and Explosion Hazards: None.

SECTION V: REACTIVITY DATA

Hazardous Polymerization: Will not occur

Stability: Material is stable

Incompatibility (Materials to Avoid): Strong oxidizers, metallic Nitrates.

Hazardous Decomposition Products: Thermal decomposition results in acid fumes, carbon monoxide, carbon dioxide.

SECTION VI: HEALTH HAZARD DATA/TOXICITY DATA

Primary Route of Exposure: Ingestion, inhalation, eyes, skin

EFFECTS OF ACUTE OVEREXPOSURE: Inhalation: May cause irritation of upper respiratory system, coughing and shortness of breath. Eve Contact: Can cause irritation. Skin Contact: Prolonged or repeated contact can cause moderate irritation, defatting, dermatitis. Ingestion: May cause abdominal pains, nausea, vomiting.

EMERGENCY AND FIRST AID PROCEDURES: Inhalation: Remove to fresh air. Eve Contact: Flush with water for at least 15 minutes. If irritation persists seek medical attention. Skin Contact: Flush with water then wash with mild soap and water. If irritation persists seek medical attention. Investion: Give solution of vinegar and water followed by clear water. Do not induce vomiting. Get medical attention. CHRONIC EFFECTS: NA

PIRANHA III NEUTRALIZER (PG.)

Page 2.

SECTION VII: PRECAUTIONS FOR SAFE HANDLING AND USE

850-243-6051

STEPS TO BE TAKEN IN CASE MATERIAL IS RELEASED OR SPILLED: Absorb liquid on vermiculite, floor absorbent, or other absorbent material.

Waste Disposal Method: Small Spill: Dispose of remaining material in accordance with applicable

regulations. Large Spill: Destroy by incineration.

SECTION VIII: CONTROL MEASURES

RESPIRATORY PROTECTION: If workplace exposure limits of product or any component is exceeded a NIOSH/MSHA approved air supplied respirator is advised in absence of proper environmental control. OSHA regulations also permit other NIOSH/MSHA respirators (negative pressure type) under specified conditions. Engineering or administrative controls should be implemented to reduce exposure.

VENTILATION: Provide sufficient mechanical ventilation to maintain exposure below TLV.

PROTECTIVE GLOVES: Wear chemical resistant gloves.

EYE PROTECTION: Wear chemical eplash goggles.

SPECIAL PRECAUTIONS OR OTHER COMMENTS: Containers of this material may be hazardous when emptied. Emptied containers retain product residues. All precautions given in this data sheet must be observed.

REFERENCES:

- 1. Sax, N.I., "Dangerous Properties of Industrial Materials", 8th ed., Van Nostrand Reinhold Company Inc., N.Y., 1982.
- .. American Conference of Governmental Industrial Hygienists, "TLV's and Biological Exposure Indices" for the current year (published annually).
- U.S. Code of Federal Regulations (CFR) U.S. Dept. of Labor, No.29, Parts 1900 to 1910.1200. OSHA. Communications Standard 29 CFR 1910.1200.
- 4. Sax, N.I., R.J. "Hazardous Chemicals Desk Reference", Van Nostrand Reinhold Co., Inc., N.Y., 1987.
- Fire Protection Guide to Hazardous Materials, 10 ed., National Fire Protection Association, Quincy, MA, 1991.
- 6. Title III List of Lists, U.S. Environmental Protection Agency publication EPA 550/4-90-011, Jan. 1990.

Supplemental Information

to comply with New Jersey DOH Right-To-Know Labeling Law (N.J.A.C. 8:59 -5.1 & 5.2)

HMIS	
HEALTH	1
FLAMMABILITY	0
REACTIVITY	1
PERSONAL	C

CAS No.:	Chemical Ingredients:
77.92.9	Citric Acid
127087-87-0	Nonylphenol ethoxylate
25322-68-3	Polyethylene Glycol

MATERIAL SAFETY DATA SHEET

(Essentially similar to OSHA form 174, Sept. 1985 - For Compliance with OSHA's Hazard Communication Standard, 29CFR 1910.1200)

Section I - Product Identity:

Piranha[®] III (5730)

nufacturer's Name:

rlock Technologies, Inc.

) Putnam Avenue ∪ambridge, MA 02139-0802 Mail Address:

P.O. Box 390432

Cambridge, MA 02139-0802

Date of Preparation: February 20, 1997

Information Telephone Number:

(617) 876-8020

Emergency Telephone Numbers: Weekdays: (617) 876-8020 (After hours, weekends & holidays)

(508) 887-5926, or "CHEM-TEL" Emergency

Contact Number: (800) 255-3924

SECTION II: HAZARDOUS INGREDIENTS/IDENTITY INFORMATION

Hazardous	Common	%	ACGIH (TLV-TWA)	OSHA PEL
Components:	Names:			or ACGIH TLV:
*Sodium Hydroxide	(1305-73-2)	<20		2 ppm
Calcium Hydroxide	(1305-62-0)	<30		5 p p m
Magnesium Hydroxide	(1309-42-8)	<10		Not Est.

SECTION III: PHYSICAL/CHEMICAL CHARACTERISTICS

Boiling Points of Major Constituent:	Not Established	Specific Gr	ravity (H ₂ O=1) Wgt./gal.	1.2 lbs /gal.
Vapor Pressure (mm Hg) @ 100°C	Not Applicable	Meltin	g Point Water (Ice)	N/A
Vapor Density (AIR=1) Heavier Lighter	Not Applicable	Evaporation Rate (Butyl Acetate≍1)		1
Solubility in Water	Dispersible	Appearance; Odor:	White Paste Slight odor	

SECTION IV: FIRE AND EXPLOSION HAZARD DATA

	sh Point:	Flammable Limits:	DOT Proper Shipping Name:	DOT ID#:	Marking:
A	Applicable	LEL: N/A UEL: N/A	Corrosive liquids, n.o.s. 8	UN-1760	"Keep from Freezing"

🛩 .ial Firefighting Procedures: Wear NIOSH approved breathing apparatus and full protective gear when fighting fires. Spray containers with water to keep cool and prevent ruptures.

Unusual Fire and Explosion Hazards: Avoid exposure to aluminum, acid products.

SECTION V: REACTIVITY DATA

Hazardous Polymerization: Will not occur

Stability: Material is stable

Incompatibility (Materials to Avoid): Contact with strong acids can cause violent reaction generating large amounts of heat. Aluminum.

Hazardous Decomposition Products: Hydrogen gas

SECTION VI: HEALTH HAZARD DATA/TOXICITY DATA

Primary Route of Exposure: Dermal, Inhalation, Eye

PHYSIOLOGICAL EFFECTS: Inhalation: Aspiration of the product will cause irritation and possible burning of the nose and throat. Eye Contact: This material is an eye irritant and will also cause severe burns. Skin Contact: Will cause severe burns. Ingestion: Ingestion of this product may cause severe burns to internal organs. Inhalation: Aspiration of the product will cause irritation and possible burning of the nose and throat. Chronic Effects: Eye, mucous membrane imitation.

EMERGENCY AND FIRST AID PROCEDURES: Inhalation: Leave contaminated area immediately; breath fresh air. Seek immediate medical attention. Eye Contact: Immediately flush eyes with plenty of water for at least 15 minutes and seek medical attention. Skin Contact: Remove contaminated clothing, wash skin with water for 15 minutes. Ingestion: Give large quantities of water. Do not induce vomiting. Seek immediate medical attention.

CHRONIC EFFECTS: Eye, mucous membrane irritation.

SUPPLEMENTAL INFORMATION

To comply with New Jersey DOH Right-To-Know labeling law (N.J.A.C. 8:59 - 5.1 & 5.2)

CASNO.	CHEMICAL INGREDIENTS
7732-18-5	Water
1305-73-2	Sodium Hydroxide
1305-62-0	Calcium Hydroxide
12-8	Magnesium Hydroxide

	HMIS HAZARD RATING						
Health	3	Flammability 0	Reactivity 1	Personal Protection D			
		1	AZARD INDE	X			
		0=Mmmal, 1≖Slig	ht, 2=Moderate, 3=	Senous, 4=Severe			
		PERSON	AL PROTECTION	ON CODE			
		0 ≖ Face S	Shield, Synthetic Apr	ron, Gloves			

^{*}Note: This product contains this toxic chemical subject to the reporting requirements of section 313 of the Emergency Planning and Community Right-To-Know Act of 1986 and of 40 CFR 372.

(H57186)

HATERIAL SAFETY DATA SHEET

SENTINEL CHEMICAL COMPANY, INC. 7714 BEECH STREET, N.E. HINNEAPOLIS, MN 55432 (612) 571-0630

ISSUE DATE: 1-01-93

PRODUCT NAME: SENTINEL 805 TSP FINAL WASH
CHEMICAL NAME AND SYNONTHS: DETERGENT
24 HOUR EHERGENCY MEDICAL AND SPILL NUMBER: 1-800-228-5635

DOT HAZARDOUS CLASS, NOT A REGULATED MATERIAL DOT SHIPPING NAME, CLEANING COMPOUND, CLASS 55 NOT

SECTION I HAZARDOUS IDENTIFICATION EXPOSURE LIHITS TRISODIUM PHOSPHATE 6 100% HUISANCE DUST TLV. TWA 8hr 10 mg/m(3) This product contains the following chemicals subject to the reporting requirements of SARA 312:

TRISODIUM PHOSPHATE

CAS# 010101-89-0

SECTION II EHERGENCY AND FIRST AID PROCEDURES
EYE CONTACT

If this product comes in contact with eyes, gently flush with large quantities of water for at least 15 minutes. If irritation persists, seek immediate medical attention.

SKIN CONTACT

Remove contaminated clothing. Cleanse affected area(s) thoroughly by washing with mild soap and water. If irritation or redness develops and persists, seek medical attention.

INHALATION (breathing)

If breathing difficulties, dizziness, or light-headedness occur when working in areas with high vapor concentration, victim should seek air free of vapors. If breathing stops, begin artificial respiration and seek immediate medical attention.

INGESTION (swallowing)

If this product is swallowed, induce vomiting. Seek immediate medical advice and/or attention.

SECTION III

HEALTH HAZARDS/ROUTES OF ENTRY

EYE CONTACT

This product may cause irritation. Direct contact with the liquid or exposure to its' vapors or mists may cause burning, tearing or redness.

SKIN CONTACT

This product may cause skin irritation. Prolonged or repeated exposure to this material may cause redness, burning, drying or cracking of the skin or dermatitis. Persons with pre-existing skin disorders may be more susceptible to the effects of this material.

CTION III HEALTH HAZARDS/ROUTES OF ENTRY 805

pg. 2

NHALATION (breathing)

If breathing difficulties, dizziness, or lightheadedness occur when working in areas with high vapor concentrations victim should seek air free of vapors. If victim experiences continued breathing difficulties, administer oxygen until medical assistance can be rendered. If breathing stops, begin artificial respiration and seek immediate medical attention.

INGESTION (swallowing)

If this product is swallowed, induce vomiting. Seek immediate ---medical advice and/or attention.

COMMENTS

THIS SUBSTANCE HAS NOT BEEN IDENTIFIED AS A CARCINOGEN OR PROBABLE CARCINOGEN BY NTP, IARC, OR OSHA.

SECTION IV

SPECIAL PROTECTION INFORMATION

VENTILATION .

If current ventilation practices are not adequate for minimizing exposures, additional ventilation or exhaust systems may be required. Other special precautions such as respiratory masks or environmental containment devices may be required in extreme cases.

RESPIRATORY PROTECTION

Respiratory protection may be necessary to minimize exposure to vapors. The use of respiratory protection depends on vapor concentration above the time-weighted TLV; use a NIOSH approved cartridge respirator or gas mask.

PROTECTIVE GLOVES

The use of gloves impermeable to the specific material handled is advised to prevent skin contact and possible irritation.

EYE PROTECTION

Approved eye protection to safeguard against potential eye contact, irritation or injury is recommended.

OTHER PROTECTIVE EQUIPMENT

It is suggested that a source of clean water be available in the work area for flushing eyes and skin. Impervious clothing should be worn as needed.

SECTION V

REACTIVITY TATA

Stable

INCOMPATIBILITY (materials to avoid)
None known.

(#57186)

TION IX

PHYSICAL DATA

80

pg. 4

APPROX. BOILING POINT ---- 215-290 DEGREES P.

VAPOR DEHSITY (AIR = 1)---- HOT KNOWN

VAPOR PRESSURE ---- NOT KNOWN

EVAPORATION RATE----SLOWER THAN ETHER

t VOLATILE ---- 1985

WEIGHT PER GALLON----8 6 LBS.

SPECIFIC GRAVITY (TEHP) ---- HEAVIER THAN AIR

APPEARANCE----GREEN

ODOR----SLIGHT/CHARACTERISTIC

SOLUBILITY IN WATER ---- COMPLETE

SECTION X DOCUMENTARY INFORMATION DISCLAIMER OF EXPRESSED AND IMPLIED WARRANTIES!

The information in this document is believed to be correct as of the date issued. However, no warranty of merchantability, fitness for any particular purpose, or any other warranty is expressed or is to be implied regarding the accuracy or completeness of this information, the results to be obtained from the use of this information or the product, the safety of this product or the hazards related to its use. This information and product are furnished on the condition that the person receiving them shall make his own determination as to the suitability of the product for his particular purpose and on the condition that he assume the risk of his use thereof.

SECTION V

REACTIVITY DATA (continued)

805

Pg. 3

HAZARDOUS DECOMPOSITION PRODUCTS

Primarily carbon dioxide and some oxides of sulfur.

HAZARDOUS POLYMERIZATION

Will not occur.

SECTION VI

SPILL OR LEAK PROCEDURES

PRECAUTION IN CASE OF RELEASE OR SPILL

Hop up as much as possible, then flush.residue with a large volume of water. (Product is biodegradeable)

WASTE DISPOSAL HETHOD

Dispose of product in accordance with applicable local, county, state and federal regulations.

SECTION VII

STORAGE AND SPECIAL PRECAUTIONS

HANDLING AND STORAGE

Keep containers tightly closed. Keep containers cool and dry.

SECTION VIII

PIRE AND EXPLOSION HAZARD

HAZARD RANKING

0-LEAST

1-SLIGHT

2-HODERATE

3-HIGH

4-EXTREME

HEALTH HAZARD . - 1

FLAHMABILITY: : 6

INVINUABILITIES.

REACTIVITY: 0

PLASH POINT: NONE TO BOILING

EXTINGUISHING HEDIA

Use foam, CO2 or dry chemical fire fighting apparatus.

PIRE AND EXPLOSION HAZARD NOT DETERMINED

FIRE FIGHTING PROCEDURES

The use of a self-contained breathing apparatus is recommended for fire fighters. Water may be unsuitable as an extinguishing media, but helpful in keeping adjacent containers cool.

MATERIAL SAFETY DATA SHEET This MSDS complies with OSHA'S Hazard Communication Standard 29 CFR 1910.1200 and OSHA Form 174

SPILAY ADITESIVE

IDENTITY AND DISTRIBUTOR'S INFORMATION NFPA Rating: Health-2; Flammability-4; Reactivity-0; Special-0 HMIS Rating: Health-2; Flammability-4; Reactivity-0; Personal Protection-B DOT Hazard Classification: ORM-D Manufactured For: Aramsco Address: 1655 Imperial Way Identity (trade name as used on label): Thorofare, NJ 08086 RAM-TACK ddress: MSDS Number: 6365 SBA 1-800-767-6933 hone: Revision- 1 Date Prepared: 08/10/95 Prepared By: ES/KD Emergency Response Number: NOTICE: JUDGEMENT BASED ON INDIRECT TEST DATA Information Calls: (404)422-2071 SECTION 1 - MATERIAL IDENTIFICATION AND INFORMATION Carcinogen COMPONENTS-CHEMICAL NAMES AND COMMON NAMES CAS Number SARA OSHA PEL **ACGIH** Hazardous Components 1% or greater; Carcinogens 0.1% or greater) III LIST (ppm) TLV (ppm) Ref. Source ACETONE 67-64-1 No 1000 750 đ HEXANE 110-54-3 Yes 50 50 d ISOBUTANE / PROPANE BLEND 75-28-5 No 800 800 d 74-98-6 No 1000 1000 d SECTION 2 - PHYSICAL/CHEMICAL CHARACTERISTICS Specific Gravity (H2O=1); Concentrate Only = 0.853 Bolling Point: N/A Vapor Pressure (Non-Aerosols)(mm Hg and Temperature): N/A Vapor Pressure: PSIG @ 70°F (Aerosols): Max.80 = 1); N/E Vapor Density (Air = 1): N/E Evaporation Rate (Solubility in Water: Pamal Water Reactive: No Appearance and Odor: Straw colored liquid with ketone solvent odor. SECTION 3 - FIRE AND EXPLOSION HAZARD DATA FLAMMABILITY as per USA FLAME PROJECTION TEST Flammability Limits in Air by % in Volume: Auto Ignition Temperature (aerosols) EXTREMELY FLAMMABLE N/E % LEL: N/E % UEL: N/E SPECIAL FIRE FIGHTING PROCEDURES: Self-contained breathing apparatus. FLASH POINT AND METHOD USED (non-aerosols): N/A Use water tog to cool containers to prevent rupturing & exploding containers. Provide shielding for personnel. EXTINGUISHER MEDIA: Foam, dry chemical, carbon dioxide, water. Unusual Fire & Explosion Hazards: Do not expose aerosols to temperatures above 130°F or the container may rupture. **SECTION 4 - REACTIVITY HAZARD DATA** HAZARDOUS POLYMERIZATION [] WILL [X] WILL NOT OCCUR ABILITY [X] STABLE [] UNSTABLE compatibility (Mat. to avoid): Strong oxidizing agents. Conditions to Avoid: Open flame, welding arcs, heat, sparks. Hazardous Decomposition Products: Carbon dioxide, carbon monoxide SECTION 5 - HEALTH HAZARD DATA PRIMARY ROUTES OF ENTRY: [X] INHALATION [] INGESTION [X] SKIN ABSORPTION [] EYE [] NOT HAZARDOUS ACUTE EFFECTS Inhalation: Excessive inhalation of vapors can cause nasal & respiratory irritation, dizziness, weakness, nausea, headache, possible unconsciousness or asphyxiation Eye Contact: Irritation. Skin Contact: Irritation due to defatting of skin. Ingestion: Possible chemical pneumonitis if aspirated into lungs. CHRONIC EFFECTS: (Effects due to excessive exposure to the raw materials of this mixture). Excessive inhalation of hexane may cause nerve damage. Medical Conditions Generally Aggravated by Exposure: May aggravate existing eye, skin, or upper respiratory conditions. **EMERGENCY FIRST AID PROCEDURES** Eye Contact: Flush with water for 15 minutes. If irritated, seek medical attention. Skin Contact: Wash with soap and water. If irritated, seek medical attention. Inhalation: Remove to fresh air. Resuscitate if necessary. Get medical attention. ingestion: DO NOT INDUCE VOMITING. Drink two large glasses of water. Get immediate medical attention. SECTION 6 - CONTROL AND PROTECTIVE MEASURES Respiratory Protection (specify type): If vapor concentration exceeds TLV, use respirator approved by NIOSH in positive pressure mode. Protective Gloves: Neoprene. Eye Protection: Salety glasses recommended Ventilation Requirements: Adequate ventilation to keep vapor concentration below TLV. Other Protective Clothing & Equipment: None Hygienic Work Practices: Wash with soap and water before handling food. Remove contaminated clothing. SECTION 7 - PRECAUTIONS FOR SAFE HANDLING AND USE Steps To Be Taken If Material is Spilled Or Released: Absorb with suitable medium. Incinerate or landfill according to local, state or lederal regulations. DO NOT FLUSH TO SEWER. Waste Disposal Methods: Aerosol cans when vented to atmospheric pressure through normal use, pose no disposal hazard. Precautions To Be Taken in Handling & Storage; Do not puncture or incinerate containers. Do not store at temperatures above 130°F. her Precautions &or Special Hazards: KEEP OUT OF REACH OF CHILDREN, Avoid food contamination. Avoid breathing vapors, Remove ignition sources

Delieve the statements, technical information and recommendations contained herein are reliable, but they are given without warranty or guarantee of any kind. Chemical Listed as Carcinogen or Potential Carcinogen. [a] NTP [b] IARC Monograph [c] OSHA [d] Not Listed [e] Animal Data Only

Appendix

Lead-Based Paint Management Plan
For

Lead-based Paint Abatement and Disposal
Charleston Naval Shipyard Complex
Officer Single Family Housing
Units J and B

Prepared by:
Michael D, Mount, CIH, OHST
Manager Health and Safety
Cape Environmental Management Inc
2302 Parklake Drive, Suite 200
Atlanta, Georgia 30345

Lead-Based Paint Management Plan

Date: 10/10/99

This plan has been developed to comply with the OSHA Construction Lead Standard, 29 CFR 1926.62 and serves as the OSHA required written compliance plan.

1. Location of Project:

This job will take place at a private residence located at the Charleston Naval Shipyard Complex Officer Single family Housing, Charleston, SC. A previous lead inspection of this residence was performed by the Supervisor of Shipbuilding, Conversion and Repair, Environmental Detachment, Charleston, South Carolina, revealed that designated architectural components, walls, ceilings and floors in the Officers Quarters are coated with lead-based paint. The existing lead-based paint is deteriorated in places with loose and peeling paint chips. The existing lead-based paint represents a hazard to workers who may disturb it during lead hazard control or renovation activities.

2. Description of the Job:

The Scope of Work for this project includes removal with a caustic solution and wet scraping of various components in the Officers Single Family Housing Quarters of the Complex. The houses (Quarters) are historical buildings and abatement methods must not degrade the historical significance of the surfaces abated.

Remove lead based paint and prepare surfaces for repainting Quarters J and B of the Officer Single Family Housing located at the former Charleston Naval Shipyard Complex. Perform minor repairs as stipulated or necessary to assure compliance with paint manufacture's specification for surface preparation.

Reapply paint to areas indicated. The paint to be applied will be the 20 year encapsulating paint known as Lead Barrier Compound, unless indicated specifically to be "regular" paint. Clean entire areas of the lead based paint removal (abatement) to ensure Lead based paint dust hazards have been eliminated. Conduct clearance testing (dust wipe and soil samples) for lead based paint after abatement is completed.

The abatement job will involve the following treatment as per the Technical Specification for Lead-Based Abatement and Disposal for Charleston Naval Shipyard Complex, Officer Single Family Housing of Contract No. N62467-99-D-1035, Delivery Order No. 0007.

Exterior Treatment:

- Eaves: Remove any flaking or peeling LBP and repaint with regular paint only those areas where paint was removed. Abatement Method: wet scrape.
- Windows: Plane or strip sash edges, remove LBP only on chewable window surfaces.
 Abatement Method: removal with caustic solution.
- **Doors**: Plane or strip door edge and remove LBP 2 inches around edge on front and back. Feather and repaint. This eliminates chewable, friction and impact surfaces. Abatement Method: removal with caustic solution.
- Garage exterior: Perform surface preparation and paint <u>only as necessary</u> exterior with regular paint. Abatement Method: wet scrape.
- Screen Porches: Remove flaking or peeling LBP paint and repaint with regular paint. Abatement Method: wet scrape.
- Exterior Screen Doors: Remove and replace unless door has historic features. Abatement Method: removal with caustic solution.

Interior Treatment:

- Walls: Remove any flaking or peeling LBP. Surface preparation will include removing flaking or peeling LBP and encapsulate 5 feet up from floor (impact surface). Abatement Method: wet scrape.
- **Baseboards**: Perform surface preparation and paint <u>only as required</u>. Surface preparation will include removing flaking or peeling LBP and encapsulate (impact surface). Abatement Method: wet scrape.
- Windows: Plane or strip sash edges, remove LBP only on chewable window surfaces. Abatement Method: removal with caustic solution.
- Doors: Plane or strip door edge and remove LBP 2 inches around edge on front and back. Feather and repaint. This eliminates chewable, friction and impact surfaces. Abatement Method: removal with caustic solution.
- **Bathroom vanity**: Strip LBP 2 inches from edge of vanity and encapsulate. Abatement Method: removal with caustic solution.
- Ceiling: Remove any flaking or peeling LBP and repaint with regular paint. Abatement Method: wet scrape.

All surfaces will be encapsulated with non-lead latex paint and or a lead-based paint encapsulant.

3. Equipment and Materials:

"LBC" encapsulant, "Peel Away" paint stripper, HEPA vacuums, Lead Dissolve cleaning agent, disposable clothing, cotton work gloves, nitrile gloves, electric power saws, hammers, wrecking bars, pry bars, screwdrivers, plastic sheeting, scrapers, and other hand tools as needed.

4. Crew:

The replacement of windows and encapsulation enclosure will each be completed by a crew of:

No.	Position	Assignment
6	Worker	Removal, encapsulation,
		cleaning and packaging
		LBP, and debris
1	Supervisor	Supervises the crew
1	Project Manager	Overall Project
		Management

5. Competent Person:

Mr. Mayro Hidalgo, a licensed lead abatement supervisor, will be onsite at all times and will act as the competent person for lead safety issues. Mr. Hidalgo's lead supervisor license number is 96006. Mr. Hidalgo will conduct daily inspections of the work areas to ensure that control measures, work practices, personal protective equipment and hygiene facilities are used as prescribed in this document.

6. Control Measures

The primary control method for this project is chemical removal with subsequent encapsulation.

During chemical removal, architectural components will be wetted with "Peel Away" prior to removing the paint. Paint will be removed to the wood substrate. Generation of airborne dust is not expected. During both scraping or sanding all surfaces will be wetted. All debris will be wetted down before handling. Wet methods (mopping) and HEPA vacuums will be used during cleaning to minimize worker exposures to lead.

To reduce generation of leaded dust in the work areas, paint chips and dust will be vacuumed on at least a daily basis with HEPA-filtered vacuums. Final cleaning will be

accomplished by cleanings consisting of HEPA vacuuming alternated with wet mopping with Lead Dissolve solution. The use of HEPA vacuums and wet cleaning methods will minimize worker lead exposures.

7. Technology Considered in Meeting the Permissible Exposure Limit:

The HUD Guidelines for Evaluation and Control of Lead Hazards in Housing and other publications were reviewed to determine the appropriate engineering controls to be used in this project. The specialized equipment that will be utilized for this project are HEPA-filtered vacuum cleaners and air-powered water pumps attached to aerosol-generating nozzles (for water misting of surfaces). HEPA-filtered exhaust ventilation fans will be utilized used to prevent migration of lead containing dust to areas outside the containment.

Removal methods utilized during this project will be non-dust generating both chemical removal and wet scrape methods will be utilized. Based on the exposures documented during the abatement of other housing units at the Charleston Naval Shipyard, similar in design and construction, exposure are not anticipated to be in excess of the Permissible Exposure Limit (PEL).

8. Respirators:

All individuals in the work area will be provided with a half-mask, air-purifying respirator equipped with HEPA cartridges. Respirators will be provided in the context of a complete respiratory protection program. See attachment A for a copy of CAPE's Written Respirator Program.

Respirators will be required during paint removal, surface preparation for encapsulation, any sawing or use of power tools, manual scraping, cleaning activities, and final cleanup. Respirator use during other activities, including initial setup (such as laying down plastic for containment), and enclosure and encapsulation after surface preparation is not necessary, *unless* other workers nearby (same interior room or outside wall) are performing activities for which respirators are required.

9. Protective Clothing:

Disposable protective clothing will be worn at all times inside the work area. Protective clothing will be made of breathable fabric to reduce the potential for worker heat stress. If visibly contaminated with paint dust or chips, protective clothing will be vacuumed before it is removed.

10. Hygiene Facilities:

A three stage decontamination unit (decon) will be used to decontaminate workers. The decon will be located at one or more of the entrances to consist of a clean room, shower room and dirty room and benches. Labeled plastic bins with covers will be used to

separate disposable protective clothing from street clothing. Hot water, soap, and towels will be provided. Hands and face will be washed before all breaks and at the end of the day. Wastewater will be collected, pretreated onsite with filtration, and disposed of in accordance with prior arrangements made with the Municipal Wastewater Treatment Facility.

11. Air Monitoring Data:

CAPE has performed lead paint abatement using the techniques described in this plan. Therefore, CAPE has exposure assessment or prior air monitoring data to estimate potential worker exposures. Since the removal will be accomplished using wet methods, airborne concentrations of lead are not expected to exceed the action level of 30 micro grams per cubic meter of air ($\mu g/m^3$). Air monitoring will be conducted at the beginning of the project to establish worker exposures and determine appropriate respirator selection. Air monitoring will be conducted in accordance with OSHA 1926.62 paragraph (d) and the written sampling plan presented in Attachment B.

12. Medical Surveillance Program:

A medical surveillance program is already in place for this work crew. It is supervised by Dr. Jeff Dutton, a board certified occupational health physician with Concentra Medical Centers. (phone 770-242-7744). Worker blood lead levels are measured initially before beginning the project and at the end of the project. Blood lead levels for current employees who will be assigned to this job are 2-18 μ g/dL. Worker blood lead increase of 15 μ g/dl or more will trigger an investigation of protective equipment and work practices. All workers on this project are informed of their blood lead levels as soon as they are received.

13. Training:

All workers, supervisors, and IH Competent Person(s) have been trained in accordance with the requirements of 29 CFR Part 1926, Sections 62 and 59; 29 CFR Part 1910.120(e); and 49 CFR Part 172, and those required by EPA or the state LBPA course for the work to be performed. Training will be provided prior to the time of job assignment and at least annually thereafter (if required by regulations). Training certificates will be available onsite from the project manager.

14. Waste Management Plan:

LBP debris and items (rags, filters, etc.) potentially contaminated with lead will be treated as lead contaminated and disposed of as lead contaminated waste (LCW). LCW will be segregated according to the type of waste and likelihood of contamination. (i.e. Paint debris will be placed in one container and all other potentially contaminated materials will be placed in another container.)

The containers will consist of plastic lined 55-gallon steel drums. LWC will be placed in the plastic liners and transferred to the steel drums prior to removal from the work area. The drums will be labeled lead containing waste and moved to a temporary storage area located between each house. The storage area will be marked with red danger tape. 00

Contaminated waste

Lead-contaminated waste, scrap, and debris will be disposed of as follows:

- Lead-contaminated waste, scrap, debris, bags, containers, equipment, and lead-contaminated clothing,, which may produce airborne concentrations of lead particles will be stored in U.S. Department of Transportation 49 CFR Part 178 approved 200 liter (55 gallon) drums. Each drum will be labeled to identify the type of waste as defined in 49 CFR Part 172 and the date lead-contaminated wastes were first put into the drum. Uniform Hazardous Waste Manifest forms from federal and state agencies will be obtained and completed. Hazardous and non-hazardous waste will be coordinated with SPORTENVDETCHASN. Dumpsters and drums will be provided and Lead-Based Paint Abatement Project Manager contacted to coordinate pickup. Lot deliveries of hazardous wastes will be made as needed to ensure that drums do not remain on the work site longer than 90 calendar days from the date affixed to each drum.
- Lead-contaminated waste will be handled, stored, transported, and disposed of in accordance with 40 CFR Parts 260, 261, 262, 263, 264, and 265. Land disposal restriction notification will be as required by 40 CFR Part 268.

Disposal documentation

Written evidence that the hazardous waste treatment, storage, or disposal facility is approved for lead disposal by the EPA and state or local regulatory agencies will be provided. One copy will be submitted of the completed manifest, signed, and dated by the initial transporter in accordance with 40 CFR Part 262.

Uncontaminated waste

The contractor will be responsible for the segregation, storage (on site), and disposal of all uncontaminated solid waste. Disposal will be in accordance with all local, state, and federal regulatory requirements.

15. Emergency Response Plan:

All accidents will be reported the Project manager immediately. In the event of a serious accident or injury contact the numbers listed in The Emergency Response Plan presented in Attachment C.

·**, .	Workers will be trained in the procedures to follow in the event of an emergency. following emergencies may be anticipated during this project	The
No		

Attachment A Respiratory Protection Program

A. PURPOSE

Cape Environmental Management Inc (CAPE) has determined that employees performing field activities during the course of their work may potentially be exposed to respiratory hazards if not properly protected during routine operations. These hazards may include asbestos, heavy metals and organic vapor and in some cases Immediately Dangerous to Life or Health (IDLH) conditions. The purpose of this program is to ensure that all CAPE employees are properly protected from exposure to these respiratory hazards.

Engineering controls are the first and preferred method to eliminate respiratory hazards, however, engineering controls are not always feasible for some of our operations, or have not always completely controlled the identified hazards. In these situations, respirators and other protective equipment must be used. Respirators are also needed to protect employees' health during emergencies. The work processes requiring respirator use at CAPE include asbestos surveys and abatement, lead surveys and abatement, and environmental investigations and remediation. During these types of work or other unidentified types of work, CAPE's employees may be exposed to respiratory hazards. Respirator use will be determined during the task hazard analysis performed during project planning.

In addition, some employees have expressed a desire to wear respirators during certain operations that are not indicated by hazard analysis to require respiratory protection. As a general policy CAPE will review each of these requests on a case-by-case basis. If the use of respiratory protection in a specific case will not jeopardize the health or safety of the worker(s), CAPE will provide respirators for voluntary use. Voluntary respirator use is subject to certain requirements of this program.

This program has been developed to comply with 29 CFR 1910.134 Respiratory Protection..

B. SCOPE AND APPLICATION

This program applies to all employees who are required to wear respirators during normal work operations, and during some non-routine or emergency operations such as a spill of a hazardous substance. All employees working in or around hazardous or toxic materials must be enrolled in the company's respiratory protection program. The program was last revised in March of 2000.

Employees participating in the respiratory protection program do so at no cost to them. The expense associated with training, medical evaluations and respiratory protection equipment will be paid by CAPE.

C. RESPONSIBILITIES

1. Program Administrator

The Program Administrator is responsible for developing, monitoring, revising and administering the respiratory protection program. He may administer by delegating his duties to qualified individuals working under his direction. Duties of the program administrator include:

- Assisting safety specialist, Site Safety Officer and Supervisors in identifying work areas, processes or tasks that require workers to wear respirators, and evaluating hazards.
- Selection of respiratory protection options.
- Evaluating the effectiveness of the program through audits of site work and documentation.
- Updating the written program based on periodic evaluations.

The Respiratory Program Administrator for CAPE is the Corporate Safety and Health Manager.

2. Safety Specialist

Each Safety Specialist at CAPE area or regional offices will assist the Program Administrator in implementing the Respiratory Protection Program at that location. Specific duties of the Safety Specialist include:

- Monitoring respirator use to ensure that respirators are used in accordance with their certifications.
- Arranging for and/or conducting training.
- Conducting spot checks to determine proper use, storage and maintenance of respiratory protection equipment and documentation of fit tests and medical evaluations.
- Conducting respirator fit tests.
- Maintaining records required by the program.
- Compiling and forwarding fit test and training records to the Program Administrator.

3. Project Superintendents/Project Managers/Project Leads

Supervisors are responsible for ensuring that the respiratory protection program is implemented on their job sites. In addition to being knowledgeable about the program requirements for their own protection, supervisors must also ensure that the program is understood and followed by the employees under their charge. Duties of the supervisor include:

- Ensuring that employees under their supervision (including new hires) have received appropriate training, fit testing, and medical evaluations prior to being placed on job sites.
- Ensuring the availability of appropriate respirators and accessories.
- Being aware of tasks requiring the use of respiratory protection.
- Enforcing the proper use of respiratory protection.
- Ensuring that respirators are properly cleaned, maintained, and stored according to the respiratory protection plan.
- Ensuring that respirators fit well and do not cause discomfort.
- Continually monitoring work areas and operations to identify respiratory hazards.
- Coordinating with the Program Administrator on how to address respiratory hazards or other concerns regarding the program.

4. Employees

Each employee has the responsibility to wear his or her respirator when and where required and in the manner in which they were trained. Employees must also:

- Care for and maintain their respirators as instructed, and store them in a clean sanitary location.
- Inform their supervisor if the respirator no longer fits well or is in need of repair, and request a new one that fits and works properly.
- Inform supervisor of any changes in their physical facial features that may affect respirator fit or function such as dental work, weight change or vision correction.
- Inform their supervisor or the Program Administrator of any respiratory hazards that they feel are not adequately addressed in the workplace and of any other concerns that they have regarding the program.

D. PROGRAM ELEMENTS

1. Selection Procedures

The Program Administrator or his designee will select respirators to be used on site, based on the hazards to which workers are exposed and in accordance with all OSHA standards. The selection process includes conducting a hazard evaluation for each operation, process, or work area where airborne contaminants may be present in routine operations or during an emergency. The hazard evaluation will include:

- 1) Identification and development of a list of hazardous substances used at the jobsite or in the work process.
- 2) Review of work processes to determine where potential exposures to these hazardous substances may occur. This review shall be conducted by surveying the workplace, reviewing records, and talking with employees and supervisors.
- 3) Exposure monitoring to evaluate and document actual hazardous exposures. Monitoring will be conducted by qualified personnel.

2. Hazard Assessment

Hazard assessments will be performed prior to performing field activities. The hazard assessment must be revised and updated any time work process changes may potentially affect exposure. If an employee feels that respiratory protection is needed during a particular activity, he/she is to contact his or her supervisor immediately. The Supervisor will evaluate the potential hazard and will arrange for outside assistance as necessary. The Supervisor will then communicate the results of that assessment back to the employees and the Program Administrator. If it is determined that respiratory protection is necessary, all other elements of this program will be in effect for those tasks and this program will be updated accordingly. If any employee feels risks are not properly evaluated they should immediately contact the Program Administrator.

3. NIOSH Certification

All respirators must be certified by the National Institute for Occupational Safety and Health (NIOSH) and shall be used in accordance with the terms of that certification. Also, all filters, cartridges, and canisters must be labeled with the appropriate NIOSH approval label. The label must not be removed or defaced while it is in use.

4. Medical Evaluation

Employees who are either required to wear respirators, must pass a medical exam before being permitted to wear a respirator on the job. Employees are not permitted to wear respirators until a physician or a licensed healthcare professional (PLHCP) has determined that they are medically able to do so. Any employee refusing the medical evaluation will not be allowed to work in an area requiring respirator use.

Medical evaluation procedures are as follows:

- The medical evaluation will be conducted using the questionnaire provided in Appendix C of the respiratory protection standard. The Corporate Occupational Medical Physician (COMP) or PLHCP will provide a copy of this questionnaire to all employees before the physical exam.
- To the extent feasible, the company will assist employees who are unable to read the questionnaire (by providing help in reading the questionnaire).
- Medical exams will be granted to employees as required by the standard,

and/or as deemed necessary by the COMP or PLHCP.

- All employees will be granted the opportunity to speak with the PLHCP about their medical evaluation, if they so request.
- The Program Administrator has or will provide the PLHCP with a copy of this program, a copy of the Respiratory Protection Standard, the list of hazardous substances by work area, and for each employee requiring evaluation: his or her work area or job title, proposed respirator type and weight, length of time required to wear respirator, expected physical work load (light, moderate, or heavy), potential temperature and humidity extremes, and any additional protective clothing required.
- Any employee required for medical reasons to wear a positive pressure airpurifying respirator will be provided with a powered air-purifying respirator.
 For areas normally classified for negative pressure respirators or assumed to areas that don't require respirator use.
- After an employee has received clearance and has begun to wear his or her respirator, additional medical evaluations will be provided under the following circumstances:
 - Employee reports signs and/or symptoms related to their ability to use a respirator, such as shortness of breath, dizziness, chest pains, or wheezing.
 - The PLHCP or supervisor informs the Program Administrator that the employee needs to be reevaluated;
 - Information from this program, including observations made during fit testing and program evaluation, indicates a need for re-evaluation;
 - A change occurs in workplace conditions that may result in an increased physiological burden on the employee.
 - All examinations and questionnaires are to remain confidential between the employee and the COMP or PLHCP except for the COMP's or PLHCP's written opinions on work restrictions.

5. Fit Testing

Fit testing is required for employees wearing half-facepiece or full facepiece respirators.

Employees who are required to wear respirators will be fit tested using one of the methods listed in Appendix A of 29 CFR 1910.134, "Fit Testing Procedures (Mandatory)":

Prior to being allowed to wear any respirator with a tight fitting facepiece.

- Annually.
- When there are changes in the employee's physical condition that could affect respiratory fit (e.g., obvious change in body weight, facial scarring, etc.).

Employees will be fit tested with the make, model, and size of respirator that they will actually wear. Several models and sizes of respirators will be made available for fit testing so that they may find an optimal fit. Fit testing of PAPRs is to be conducted in the negative pressure mode. The Program Administrator or his designee will conduct fit tests following the OSHA approved QLFT (qualitative fit test) protocol in Appendix A of the Respiratory Protection Standard.

The Program Administrator has determined that quantitative fit test (QNFT) is not required for the respirators used under current conditions at CAPE. If conditions affecting respirator use change, the Program Administrator will evaluate on a case-by-case basis whether QNFT is required.

E. RESPIRATOR USE

Respiratory protection is required for all personnel engaged in field activities where potential exposure to toxic hazardous substances or waste exists.

1. General Use Procedures:

- Employees will use their respirators under conditions specified by this
 program, and in accordance with the training they receive on the use of each
 particular model. In addition, the respirator shall not be used in a manner for
 which it is not certified by NIOSH or by its manufacturer.
- All employees shall conduct user seal checks each time that they done their respirator. Employees shall use either the positive or negative pressure check (depending on which test works best for them) specified in Appendix B-1 of the Respiratory Protection Standard.
- All employees shall be permitted to leave the work area to go to maintain their respirator for the following reasons: to clean their respirator if the respirator is impeding their ability to work, change filters or cartridges, replace parts, or to inspect respirator if it stops functioning as intended. Employees should notify their supervisor before leaving the area.
- Employees are not permitted to wear tight-fitting respirators if they have any condition, such as facial scars, facial hair, or missing dentures, that prevents

them from achieving a good seal. Employees are not permitted to wear headphones, jewelry, or other articles that may interfere with the facepiece-toface seal.

2. Emergency Procedures:

Emergency procedures will be developed for site-specific situations.

3. Respirator Malfunction

a. APR Respirator Malfunction:

For any malfunction of an APR (e.g., such as breakthrough, facepiece leakage, or improperly working valve), the respirator wearer should inform his or her supervisor that the respirator no longer functions as intended, and go to the designated safe area to maintain the respirator. The supervisor must ensure that the employee receives the needed parts to repair the respirator, or is provided with a new respirator.

b. Atmosphere-Supplying Respirator Malfunction:

All workers wearing supplied-air respirators (SAR) will work with a buddy. Buddies shall assist workers who experience an SAR malfunction as follows:

If a worker experiences a malfunction of a SAR, he or she should signal to the buddy that he or she has had a respirator malfunction. The buddy aid the worker in immediately exiting the work area.

4. IDLH Procedures

The Program Administrator has identified the following area as presenting the potential for IDLH conditions:

Confined Space:

Workers will be periodically required to enter the confined spaces to perform their duties. In such cases, workers will follow the permit required confined space entry procedures specified in CAPE's Confined Space Program. As specified in these procedures, the actual hazard will be assessed before entering the space. In addition, an appropriately trained and equipped standby person shall remain outside the space and maintain constant communication with the worker. In the event of an emergency requiring rescue, the standby person will immediately initiate the call for rescue operations in accordance with rescue procedures

outlined in the Confined Space Program.

F. AIR QUALITY

Grade D breathing air shall be used in the cylinders or be provided by compressor systems for supplied-air respirators. If necessary, the Job Superintendent will coordinate deliveries of compressed air with the company's vendor and require the vendor to certify that the air in the cylinders meets the specifications of Grade D breathing air.

G. CLEANING, MAINTENANCE, CHANGE SCHEDULES AND STORAGE

1. Cleaning

- Respirators are to be regularly cleaned and disinfected.
- Respirators issued for the exclusive use of an employee shall be cleaned as often as necessary.
- SAR's and emergency use respirators are to be cleaned and disinfected after each use.
- The following procedure is to be used when cleaning and disinfecting respirators:
- Disassemble respirator, removing any filters, canisters, or cartridges.
- Wash the facepiece and associated parts in a mild detergent with warm water. Do not use organic solvents.
- Rinse completely in clean warm water.
- Wipe the respirator with disinfectant wipes (70% Isopropyl Alcohol) to kill germs.
- Air-dry in a clean area.
- Reassemble the respirator and replace any defective parts.
- Place in a clean, dry plastic bag or other airtight container.

Note: The Supervisor will ensure an adequate supply of appropriate cleaning and disinfecting materials at the job site. If supplies are low, employees should contact their supervisor.

a. Maintenance

Respirators are to be properly maintained at all times in order to ensure that they function properly and adequately protect the employee.

Maintenance involves a thorough visual inspection for cleanliness and defects. Worn or deteriorated parts will be replaced prior to use. No components will be replaced or repairs made beyond those recommended by the manufacturer. Repairs to regulators or alarms of atmosphere-supplying respirators will be conducted by the manufacturer.

The following items/parts will be inspected before each use of a respirator:

- Facepiece: cracks, tears, or holes; facemask distortion; cracked or loose lenses/faceshield
- Headstraps: breaks, tears or loss of elasticity; broken buckles
- Valves: residue or dirt; cracks, tears or loss of elasticity in valve material
- Filters/Cartridges: approval designation; gaskets; cracks or dents in housing; proper cartridge for hazard; end of use indicator
- Air Supply Systems: breathing air quality/grade; condition of supply hoses; hose connections; settings on regulators and valves.

Employees are permitted to leave their work area to perform limited maintenance on their respirator in a designated area that is free of respiratory hazards. Situations when this is permitted include to wash their face and respirator facepiece to prevent any eye or skin irritation, to replace the filter, cartridge or canister, and if they detect vapor or gas breakthrough or leakage in the facepiece or if they detect any other damage to the respirator or its components.

3. Change Schedules

Employees wearing APRs or PAPRs with P100 filters for protection against particulate (asbestos, lead, etc.) shall change the cartridges on their respirators when they first begin to experience difficulty breathing (i.e., resistance) while wearing their masks or more often as required by project specifications or site specific plans. Organic vapor cartridges or other similar type cartridges changes will have a change schedule developed by a Safety Specialist based on anticipated concentrations and capacities recommend by the cartridge manufacturer the schedule will be printed in a project specific Site Safety and Health Plan.

4. Storage

Respirators must be stored in a clean, dry area, and in accordance with the manufacturer's recommendations. Each employee will clean and inspect their own air-purifying respirator in accordance with the provisions of this program and

will store their respirator in a plastic bag kept in their possession. Each employee will have his/her name on the bag and that bag will only be used to store that employee's respirator.

The Program Administrator or his designee will store CAPE's supply of respirators and respirator components prior to issue to employees in their original manufacturer's packaging.

5. Defective Respirators

Respirators that are defective or have defective parts shall be taken out of service immediately. If, during an inspection, an employee discovers a defect in a respirator, he/she is to bring the defect to the attention of his or her supervisor. The Supervisor will decide whether to:

- Temporarily take the respirator out of service until it can be repaired.
- Perform a simple fix on the spot such as replacing a headstrap.
- Dispose of the respirator due to an irreparable problem or defect.

When a respirator is taken out of service for an extended period of time, the respirator will be tagged with "Do Not Use" printed on the tag, and the employee will be given a replacement of similar make, model, and size. All tagged out respirators will be evaluated by a qualified inspector to determine whether they can be used for spare parts or disposed of immediately.

H. TRAINING

The Program Administrator or his designee will provide training to respirator users and their supervisors on the contents of the Respiratory Protection Program and their responsibilities under it, and on the OSHA Respiratory Protection standard. Workers will be trained prior to using a respirator in the workplace. Supervisors will also be trained prior to using a respirator in the workplace and prior to supervising employees that must wear respirators.

The training course will cover the following topics:

- CAPE's Respiratory Protection Program
- the OSHA Respiratory Protection Standard
- potential respiratory hazards and their health effects
- proper selection and use of respirators

- limitations of respirators
- respirator donning and user seal (fit) checks
- fit testing
- emergency use procedures
- maintenance and storage
- medical signs and symptoms limiting the effective use of respirators

Employees will be retrained during annual fit testing or as needed. Employees must demonstrate their understanding of the topics covered in the training through hands-on exercises. The Safety Specialist will document respirator training on the fit test form. The documentation will include the type, model, and size of respirator for which each employee has been trained and fit tested.

I. PROGRAM EVALUATION

The Program Administrator and his designees will conduct periodic evaluations of the workplace to ensure that the provisions of this program are being implemented. The evaluations will include regular consultations with employees who use respirators and their supervisors, site inspections, air monitoring and a review of the air monitoring records. Problems identified will be noted in an inspection log and addressed by the Program Administrator. These findings will be reported to management, and the report will list plans to correct deficiencies in the respirator program and target dates for the implementation of those corrections.

J. DOCUMENTATION AND RECORD KEEPING

A written copy of this program and the OSHA standard is to be kept in the Program Administrator's office and each location of and shall be available to all employees who wish to review it. Also maintained in the Program Administrator's office are copies of training and fit test records. These records will be updated as new employees are trained, as existing employees receive refresher training, and as new fit tests are conducted.

The Program Administrator will also maintain copies of the medical records for all employees covered under the respirator program. The completed medical questionnaire and the physician's documented findings are confidential and will remain at the medical clinic. The company will only retain the physician's written recommendation regarding each employee's ability to wear a respirator.

Attachment B Standard Operating Procedures (SOP's)

STANDARD OPERATING PROCEDURES

Lead Wipe Sampling OSFH, Charleston Naval Shipyard Prepared by Michael D. Mount, CIH, OHST

Materials:

Non lanolin baby wipes (it best to call lab and follow their

recommendation for brand), ruler or measuring tape, masking tape,

sharpie pen and zip lock type storage bags

Method:

HUD Protocol. (See attached HUD sampling guidelines).

Pre-Abatement

- A) Collect wipe samples at the following locations:
 - 1) Outside the lead based paint control area (LBPCA) at critical barriers (within 10 feet of barrier).
 - 2) Clean Room or change area or wash area.
 - 3) Travel path used by lead workers to and from the work area

II) Post-Abatement

- A) Collect wipe samples at the following locations in each abated house for "on site paint removal in limited areas".
 - 1) One sample from a window sill or one sample from a window well for a total of four window sill and window well samples.
 - 2) One sample from the floor of the rooms with windows sampled for a total of four floor samples.
 - 3) Outside the containment near pre-abatement location within 10 feet of the barrier (in only 20% of the units)
- B) Collect wipe sample(s) at the following location in each abated area for "Replacement and/or encapsulation only in limited areas".
 - 1) Three wipe composite sample divided equally between window wells, window sills and floors.
 - 2) Outside the containment near pre-abatement locations within 10- feet of a barrier (in only 20% of the units).
- C) Collect wipe sample(s) at the following locations in each abated area for "Exterior abatement".
 - 1) One wipe from a horizontal surface such as a swing, railing or floor within the area abated.
 - 2) One window trough composite if not sampled for interior clearance.

Table 15.1 Recommended Minimum Number and Location of

ĺ	e-Surface	Dust	Samples
	,		

Clearance Category	Category Description	Number and Location of Single-Surface Wipe Samples in Each Area¹	Number and Location of Composite Wipe Samples
1	Interior treatments	Two dust samples from at least four rooms in dwelling (whether treated or untreated):	Three composite samples for every batch of four rooms (whether treated or untreated):
		One interior window sill or window trough,	One floor composite.
		alternating between rooms.	 One interior window sill composite.
	No containment within	◆ One floor.	 One window trough composite.
	dwolling	AND	AND
		◆ For common areas, one for every 2,000 ft² of a, common area room floor (if present).	 For common areas, one floor subsample for every 2,000 ft² (if present); up to 8,000 ft² can be sampled for each composite.
2	Interior treatments	Same as Category 1 but only in every treated room (up to four rooms)	Same as Category 1 but only in every treated room
!	•	AND	AND
	With containment (plastic sheeting as airlock on doors between treated and untreated areas)	One floor sample outside the containment area but within 10 feet of the airlock to determine the effectiveness of the containment system. This extra single-surface sample is recommended in 20 percent of the troated dwellings in multifamily housing and all single-family homes.	One floor sample outside the containment area but within 10 feet of the airlock to determine the effectiveness of the containment system. This extra single-surface sample is recommended in 20 percent of the treated dwellings in multifamily housing and all single-family homes.
		For common areas, one floor sample for every 2,000 ft² and one floor sample outside containment. The sample outside containment is a sample outside containment.	 For common areas, one floor subsample for every 2,000 ft² (up to 8,000 ft² for each composite) and one floor sample outside containment.
3	Exterior treatments	Two dust samples as follows:	Two dust samples as follows:
		 At least one dust sample on a horizontal surface in part of the outdoor living area (e.g., a porch floor or entryway). 	 One composite on a horizontal surface in part of the outdoor living area (e.g., a porch floor or entryway).
		 One window trough sample on each floor where exterior work was performed. An additional trough sample should be collected from a few lower floors to determine if troughs below the area were contaminated by the work above. 	 One window trough composite for every four floors where exterior work was performed, including lower floors where exterior work was not done, if present.
4	Routine maintenance work	At least 1 floor dust sample for every 20 high-hazard jobs near the work area (see Chapter 17 for definition of "high hazard").	Same as single-surface sampling.
5	Soil treatment	One dust sample from the entryway.	One dust sample from the entryway.

A room includes a hallway or a stainway. If no window is present, collect just one floor sample. When a closet is treated, the room to which it is attached should be tested. A closet is not considered to be a separate room. If all rooms received similar treatments and cleaning, only four rooms need to be sampled for clearance purposes. More rooms may need to be sampled in larger dwellings. The room to be sampled should be selected based on where most of the dust-generating work was down in the judgment of the clearance examiner.



STANDARD OPERATING PROCEDURES

Soil Sampling OSFH, Charleston Naval Shipyard Prepared by Michael D. Mount, CIH, OHST

Sampling Protocol: Lead Based Paint Risk Assessment Model Curriculum (attached)

Materials: Zip lock bags, latex gloves, wide mouth jars, plasic spoon

(Check with lab for proper sampling containers, they may supply for free)

- I) Pre-Abatement Composite soil samples will be collected near the immediate area of abatement using EPA Method 7240 from:
 - A) Two building drip lines on each side of the building being abated.
 - 1) Use plastic spoon for each sample to collect the top ½ inch of soil.
 - 2) Collect 3 to 10 sub samples along the drip line roughly an equal distance from each other (approximately 4 feet apart).
 - 3) Collect a total of 10 grams (about a tablespoon full) of soil for analysis.

STANDARD OPERATING PROCEDURES

Personal Air Monitoring OSFH, Charleston Naval Shipyard Prepared by Michael D. Mount, CIH, OHST

Sampling Method – OSHA Technical Manual, Personal Monitoring for Air Contaminants

Analytical Method – NIOSH 7300

Materials: Personal air sampling pump, tubing, and 37 mm closed face cassette, precision rotometer and watch.

- A) During the 1st full day of chemical stripping and wet scraping/sanding the following personal samples will be collected to indicate worker exposure to airborne lead.
 - 1) Collect samples in breathing zone of employee.
 - 2) Sample volumes should be greater than 1000 liters and collected at 1-4 L/m
 - 3) Sampling times should reflect 8-hour TWA's or at least 7 hours of an 8 hour work shift or 9 hours of a 10 hour work shift.
 - 4) Sampling strategies and should comply with OSHA 1926.62 paragraph (d). Sample results should represent the highest expected exposure to each type of work being conducted and should be representative of a full shift expsure on at least two employees.

Attachment C Emergency Response Plan

EMERGENCY PHONE LIST

Serious Accident- Dial 911

Roper North Hospital Emergency Room - (843)-745-2787

Project Address – 1455 Hobson Avenue Charleston Navy Shipyard North Charleston, S.C.

Other Emergency Phone No.'s

Job Site: 1 (843) 744 1230

Supervisor: Mayro Hidalgo - 1 (800) 590 3560 (pg)

Supervisor: Jesus Uriosti – 1 (800) 5903583 (pg)

Onsite Project Manager - Howard Frost - (770) 377-0532 (cell) 1-877-344-3307 (pager)

Office Project Manager - Jeff Shannon (877) 541-0571(pg)

Appendix A

Results of Air Monitoring Analysis






A Division of Azimuth, Incorporated 9229 University Blvd.

1221	Onive	4314)	DIVG.
Charl	ecton	90	29406

Name Address	CAPE Envi	EKCONE du.			14-1230 14-1230 3day
	•	Phone No.	# of Sample	Date Shi	P.O.
DBERT I Instructions	BENS Ly / Unusual Conditions / Po	ssible Interferences:	1-1230		
Lab Use Only	Sample Number or Area	Sample Volume or Time	Date Sampled	Media Type	Analysis Requested
	11-11-01	1155	11-11-99	37mm	DIR
	11-11-02		1		
	11-11-03		V	<i>V</i>	<u> </u>
V	11-15-01	1008	1/15-99	37 mm	NIK
	11-15-02				
	11-15-03		1	V	
					<u> </u>
	11-16-01	1016.4	11-16-99	37mm	Nin
	11-16-02				
	11-16-03				V

C		/400		
CHAIN	Relinquished by: TABERT BERSIL	1 Date/Time-17-99	Received by.	Date/Time
OF	Religionshed by:	Date/Time	Received at Lab by Mucht	Date/Time 11/17/59 157(1
CUSTODY	Method of Shipment:		Sample Condition Upon Receipt: O Acceptable	Other (explain)
Authorized	(Client Signature Must Abompany Request)	Date 11-17-99		
	+			

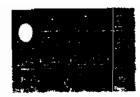

Client Name:

Project Name/Number:

Date Collected:

Project Location:

CHAS NAU BARR DO 33.102 11-11-99 Shift: 13+

SUMMARY OF LEAD (MONITORING RESULTS

SAMPLE TYPE:

AIR WATER TCLP

								OAMI'LL		7.11	WAILK	102
						AIR				Water	TOLP	Reg. Limi
,												
-11-01 7	Jose Gones	100	2.1	0740	#55	1155						
	FINE CHAMIN	6	2.1	1650]							T
	Magpine Floors	2000										
	walls.	,	1				 					
	531-66-35	K-										
			+		╁──	 	 	 		+	 	
1-11-02	Blank		 			 	├─ ─	+ +		<u> </u>	-	⊢ —
			-	<u> </u>	- 1	=:	<u> </u>	1	• .·•	ali atmorta. I cana		
1-11-03	Blank				<u> </u>							
							T					
			 	-				-		1	t	
				-		 	 -	╅		╂──	f	
				·		 	 					
						<u> </u>	<u> </u>				<u> </u>	
												
	-		 			 	 			1		
						 	 	 -		╂	 	╂
			 			ļ <u>.</u>				ļ	<u> </u>	
	<u> </u>						<u> </u>				<u> </u>	
OLLECTION:		ANALYSI	IS: ,				x	The second of				
	SERT M. BOTT	ANALYZED	BY: ML	wht.		AMB	AMBIEN"			Р	PERSONA	1
	-29		Moutho	JDQ SH	when	BG	BACKGR			CL	CLEARAN	
					1	1						
ILTER LOT NO: 9	1359/18	ANALYTE:	_ Lec	20		IWA		WORK AREA		FB	FIELD BLA	NK
	ANALYZED IN ACCOL	SDANCE W	/ITH·			OWA	OUTSIDE	E WORK AREA	A			
OLLECTED AND						J	0010101	2	•			
IR => NIOS	H 7300 METHOD STION: EPA 3050	TCLP=>	DIGESTIO	N: EPA 1311 : EPA 6010								

ANALYSIS: EPA 6010

Other:

WATER⇒ DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xls



Client Name: Project Name/Number: **Date Collected: Project Location:**

HAD IVAV DAG Shift:

SUMMART UP LEAD MONITORING RESULTS

SAMPLE TYPE:

AIR WATER TCLP

AIR Water TCLP Reg. Limit 480 1000 JOSE GONSALO 07/0 EXTERIOR FINE CLOSE 1510 11-15-02 BL Blank 11-15-03 BC Blon K COLLECTION: ANALYSIS: COLLECTED BY: ROBERT BEAS ANALYZED BY: **AMB** AMBIENT Р PERSONAL. ROTOMETER NO: R-29 brac BY: Martholmas BG **BACKGROUND** CL CLEARANCE Lead FILTER LOT NO: 9 7339718 ANALYTE: AWI INSIDE WORK AREA FB FIELD BLANK COLLECTED AND ANALYZED IN ACCORDANCE WITH: OWA OUTSIDE WORK AREA AIR => **NIOSH 7300 METHOD** TCLP#> DIGESTION: EPA 1311 DIGESTION: EPA 3050 ANALYSIS: EPA 6010

ANALYSIS: EPA 6010

Other:

WATER=> DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form xis



Project Location:

900 B.103 11-16-99 Shift: 15+ HOUSING VAT B

SUMMARY OF LEAD

MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER TCLP

							AIR			Water	TCLP	Reg. Limit
21.14	٠.											
1-16-01	17	Vincent Hoe 472-87-2	MGA	2.1	07/5	484	10164					
		472 - 87 - 2	<u> 37.5 </u>	2.1	1519			<u> </u>				<u> </u>
	 	Unit B GOLAN	se									<u> </u>
-16-02	BL	Blank						<u> </u>			1	
	<u> </u>					 -						
1-16-03	BC	Blank		 		 		 				<u> </u>
				<u> </u>		_		.				╂
		ļ <u>-</u>						1				}
				<u> </u>						_		├
					·	 		 			₩	
				ļ				-				<u> </u>
	—			1			<u> </u>	1	<u></u>		 	-
		1		,				ļ <u></u>			 	<u>. </u>
		<u> </u>				 		├ ──├			4	-
						Total College						
77.E. 2 T. C. T. C. L.												
			T									
OLLECTIC	$\overline{}$		ANALYS	is:								
	٠,)	BERT BENSLA	ANALYZE		White		AMB	AMBIENT		P	PERSON	AL
	YKE				n A-1	- 1 .	100	BACKGRO	LIAID	CI.	CLEARA	·CE
		2-29	QAVQC BY:	Macthe	imati	phenix	BG	BACKGRU	CND	CL	CLEARAI	NCE
OLLECTED B	vo: F	2-29				iphenis						
OLLECTED B OTOMETER I	vo: 6 o: 97		ANALYTE:	Lead		pheno	IWA OWA	INSIDE WO		FB	FIELD BL	

DIGESTION: EPA 3050

ANALYSIS: EPA 6010

ANALYSIS: EPA 6010

Other:

WATER=>

DIGESTION: EPA 3010

ANALYSIS EPA 6010

lead-field-form.xls



CLIENT: CAPE Environmental

2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9911090

Received: 11/18/1999 8:01:00 AM

Received by: Pfaff J

Validated: 11/22/1999 8:32:00 AM

Validated by: Pfaff J

Approved: 11/22/1999 8:32:00 AM

Approved by: Pfaff J

Client Sample ID: 11-11-01

Azimuth ID: 9911090-01

Collection Date: 11/11/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 1155 Liters

Te Method Detection Limit Sample Result Concentration

Lea (Filter) mNIOSH 7082 0.5 mg/L <5 ug <4.3 ug/m3

Client Sample ID: 11-11-02

Azimuth ID: 9911090-02

Collection Date: 11/11/1999

Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NA ug/m3

Client Sample ID: 11-11-03

Azimuth ID: 9911090-03

Collection Date: 11/11/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

TestMethodDetection LimitSample ResultConcentrationLead (Filter)mNIOSH 70820.5 mg/L<5 ug</td>NAug/m3

Report Printed 11/22/1999

Page 1 of 3

Chent Sample ID: 11-15-01 Collection Date: 11/15/1999

Azimuth ID: 9911090-04 Media: 37 mm 0.8 μ MCE

Sample Volume: 1008 Liters

Test Method Detection Limit Sample Result Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</th>
 <5 ug/m3</th>

Client Sample ID: 11-15-02 Collection Date: 11/15/1999

Azimuth ID: 9911090-05 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug NAug/m3

Client Sample ID: 11-15-03 Collection Date: 11/15/1999

Azimuth ID: 9911090-06 Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

Test Method Detection Limit Sample Result Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</th>
 NA ug/m3

Client Sample ID: 11-16-01

Azimuth ID: 9911090-07 Media: 37 mm 0.8 μ MCE

Elificati D. Correct of

Sample Volume: 1016.4 Liters

Collection Date: 11/16/1999

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L 6.8 ug 6.7 ug/m3

Client Sample ID: 11-16-02 Collection Date: 11/16/1999

Azimuth ID: 9911090-08 Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug NAug/m3

Cherit Sample ID: 11-16-03

Azimuth ID: 9911090-09

Collection Date: 11/16/1999

Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

Test Method **Detection Limit** Concentration Sample Result

Lead (Filter)

mNIOSH 7082

0.5 mg/L

<5 ug

NAug/m3

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052 ELLAP Laboratory ID Number:100624

Date: 112999



Test Request Form

Date/Time

Acceptable

Date/Time ///

Other (explain

A Division of Azimuth, Incorporated

9229 University Blvd.

Charleston, SC 29406

CHAIN

CUSTOD

Authorized by

(800) 968-3565 I Name Address	Fax (843) 569-8792 CAPE Ent. 2302 PARI ATERNIA 6	c conce	to 1 Due		Vert Fax		4-1230 4-1230 1: 3 day
Project No. 920 33 . /0		e Type Lebod		# of Sa	imples		P.O.
Contact Name Koper	M Bensh		Phone No.	4-12	30	Date \$	Shipped 1-23-99
Special Instructions /	/ Unusual Conditions /	Possible In	terferences:				
1-5-0	10.000			Τ			
Lab Use Only	Sample Number or Area	Sa	mple Volume or Time	Dete Sample:	d N	Media Type	Analysis Requested
	11-17-01	1-	245. 3	11-174	39 3	7mm	Lend in RIKE
	11-17-02		1/4	11-17-9	9	/	
	11-17-03	- 4	n/a	11-17-9	79 /		
	11-18-01	10	18.5	11-13-	1 99 3	7 m m	Lead in Air
- X boled	11-18-02		n/n	11-18-1	79	1	
10 Page	11-18-63		n/a	11-19-4	79	<u>. </u>	1
✓	11-22-61	12	30.6	11-27-	9 3	7 mm	Lead in Aire
$\mathcal{L}_{\mathcal{L}}$	11-22-02		N/A	11-22-	77	1	
	11-22-03		N/A	11-27-	79 1	/	
American Industrial H	ygiene Association: Lab	oratory Ac	creditation #36	7			

Received by:

Received at Lab by.

Sample Condition Upon Receipt



CLIENT: CAPE Environmental

2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9911109

Received: 11/23/1999 10:51:00 AM

Received by: Pfaff J

Validated: 11/29/1999 3:55:00 PM

Validated by: Pfaff J

Approved: 11/29/1999 3:55:00 PM

Approved by: Pfaff J

Client Sample ID: 11-17-01

Azimuth ID: 9911109-01

Collection Date: 11/17/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 1245.3 Liters

Test Method Detection Limit Sample Result Concentration

(Filter) mNIOSH 7082 0.5 mg/L <5 ug <4 ug/m3

Client Sample ID: 11-17-02

Azimuth ID: 9911109-02

Collection Date: 11/17/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 11-17-03

Azimuth ID: 9911109-03

Collection Date: 11/17/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Report Printed 11/29/1999

Page 1 of 3

Chent Sample ID: 11-18-01 Collection Date: 11/18/1999

Azimuth ID: 9911109-04 Media: 37 mm 0.8 µ MCE

Sample Volume: 1018.5 Liters

Test Method **Detection Limit** Sample Result Concentration

0.5 mg/L Lead (Filter) mNiOSH 7082 <4.9 ug/m3 <5 ug

Client Sample ID: 11-18-02 Collection Date: 11/18/1999

Azimuth ID: 9911109-05 Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

Test **Detection Limit** Concentration Method Sample Result 0.5 mg/L <5 ug Lead (Filter) **mNIOSH 7082** NAug/m3

Client Sample ID: 11-18-03 Collection Date: 11/18/1999

Azimuth ID: 9911109-06 Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

Test Method **Detection Limit** Sample Result Concentration Lead (Filter) **mNIOSH 7082** NAug/m3 0.5 mg/L <5 ug

Client Sample ID: 11-22-01

Collection Date: 11/22/1999

Azimuth ID: 9911109-07 Media: 37 mm 0.8 µ MCE

Sample Volume: 1230.6 Liters

Test Method **Detection Limit** Sample Result Concentration Lead (Filter) <5 ug **mNIOSH 7082** 0.5 mg/L <4.1 ug/m3

Collection Date: 11/22/1999 Client Sample ID: 11-22-02

Media: 37 mm 0.8 µ MCE Azimuth ID: 9911109-08

Sample Volume: 0 Liters

Test Concentration Method Detection Limit Sample Result Lead (Filter) mNIOSH 7082 NAug/m3 0.5 mg/L <5 ug

Chent Sample ID: 11-22-03

Collection Date: 11/22/1999

Azimuth ID: 9911109-09

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

Test

Method

Detection Limit

Sample Result

Concentration

Lead (Filter)

mNIOSH 7082

0.5 mg/L

<5 ug

NAug/m3

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052 ELLAP Laboratory ID Number:100624

Final Approval: De Mi (ruggin, 166 Manaly)

Date: December 1, 1999



Project Location:

13+ Shift:

SUMMARY OF LEAD MONITORING **RESULTS**

SAMPLE TYPE:

AIR WATER TCLP

													
a ac							AIR			,	Water	TCI	Reg. Lin
-17-01		Laus John				593	245 2				7		
- 11-01	-	Lais Locenz 521-47-8532	<u> </u>	2.1	0723	1373	1245 3	-		 		i	<u> </u>
		Prepping Un.	- 1		1110	 		 			1		······································
			T D		+	 		 		 	+		
		and Floor.											
,								I					
1-17-02	BL	Blank				<u> </u>							
		· -, · · · · · · · · · · · · · · · · · ·	·	Ī		<u> </u>	<u>i</u>	<u> </u>	<u> </u>		*******	-	· · · · · · · · · · · · · · · · · · ·
1-17-03	BL	Blank								_			
				<u> </u>		†		1					
					_					† -	—		
				+		+	 	 _	+	1	1	 	
					 			 -		1			
		<u></u> ,				- 			 		_		
		<u>, </u>								_			<u> </u>
		<u>' ' </u>											
DLLECTION	· \		ANALY	SIS:									
LLECTED BY:	— —	3-et Bensy			Auglet		AMB	AMBIEN	т	# # # # # # # #	P	PERSONA	 L
TOMETER NO		29	QA/QC B		8		B G	BACKG			CL	CLEARAN	
TER LOT NO:	97	33718	ANALYTE	:			IWA	INSIDE	WORK ARE	:A	 FB	FIELD BLA	NK
	AND A	NALYZED IN ACCO	RDANCE	WITH:			OWA		E WORK A		'		
} =>		7300 METHOD	TCLP=>		N: EPA 1311								

Other:

ANALYSIS: EPA 6010

WATER=> DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xls



Project Location:

HAS IVAV NASE Shift:

SUMMART UP LEAD MONITORING RESULTS

SAMPLE TYPE:

AIR WATER TCLP

							AIR			Water	TCLP	Reg. Limit
11-18-01	P	Luis Hildren		2.1	0730	485	10/8.5					
	-	0		81	1535		ļ		···-			
		-				 	├					
1/- 10) 00	BL	31 "	1	- 	 -	 	 -	1			-	.
1-19-02	12c	Blank		+		 -	 	ļ			┨	
11-8-03	BC	Blank			 	 	 			_		
, , ,							<u> </u>					
						<u> </u>					† -	
												
												i —
						<u> </u>		<u> </u>	Î	1	1	
												Programme and the second
						1						
OLLECTIO	N:		ANALYS	3IS:						273		
OLLECTED BY	1 to	REKT BEASIN	ANALYZEI	DBY: M	Vinlet		AMB	AMBIENT		Р	PERSONAL	
OTOMETER N		-29	QAVQC BY	,	8		BG	BACKGRO	DUND	CL	CLEARANC	
LTER LOT NO	97	3 39 718	ANALYTE:				IWA	INSIDE W	ORK AREA	 FB	FIELD BLAI	MK
OLLECTED	AND	WALYZED IN ACCO					OWA		WORK AREA	1		
IR ⇔	NIOSH	7'300 METHOD	TCLP=>	DIGESTIC	N: EPA 1311		Y					
	DIGES	TION: EPA 3050		ANALYSIS	S: EPA 6010							

DIGESTION: EPA 3050 ANALYSIS: EPA 6010

Other:

WATER⇒ DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form,xls



Project Location:

MUS IVAY DODE Shift: 700

SUMMAKT UP LEAD MONITORING RESULTS

SAMPLE TYPE:

AIR WATER TCLP

										<u> </u>	Zuix	WAILK	ICLP
**		1						AIR			Water	TCLP	Reg. Lim
Name :													
11-22-01	2	Luis He	roider		2.1	10714	584	1230.6					
		314-91-			2.1	1700							
,			e Peel-A	mmy									
1-22-02		BINNK				<u> </u>	<u> </u>						
1-22-03		Blank					 				-		
-		Diarie						 			+		
				-									
						<u> </u>							
		_				_	<u> </u>	 					
			<u>.</u>					 	 		-	ļ	
						 		 					
						-		1				<u> </u>	
											T		
											Marie Marie Calabora Array Ca		
LLECTION:	1		ANA	LYSK	S:				san en	Secretary and the second	and services.		
LECTED BY	Laki	t Bensky		LYZED	BY: //	Sunt		AMB	AMBIENT		P	PERSONAL	
OMETER NO:		29	QAVO	C BY:		ð		BG	BACKGRO	DUND	CL	CLEARANCE	•
ER LOT NO: 913397/8 ANALYTE:				TU.			IWA		ORK AREA	FB	FIELD BLAN	ĸ	
		300 METHOD	ACCORDAN TCL			N: EPA 1311		OWA	OUTSIDE	WORK AREA			· · · · · · · · · · · · · · · · · · ·
		ON: EPA 3050	ICL			EPA 6010		L					

ANALYSIS: EPA 6010

Other:

WATER=> DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xls





A Division of Azimuth, Incorporated 9229 University Blvd. Charleston, SC 29406

(800) 968-3565 Fax (843) 569-8792

CADE Environnetal PARKLANE Dr. Address .

Special requests:

Verbal results . 794-1230 744-1230

12-21-99

Results needed by: 12-28-99


Project No. Sample Type # of Samples Lend DIR 90033, 103 Contagt)Name Phone No. **Date Shipped** Bonsly 744-1230

Special Instructions / Unusual Conditions / Possible Interferences:

	Lab Use Only		Sample Number or Area	Sample Volume or Time	Date Sampled	Media Type	Analysis Requested
	1		12-13-01	1152.9	12-13-99	37 mm	Lend in AK
	7		12-13-02	Blank		1	1
	3		12-13-03	Blank	7	,	1
Mar. or	4	\checkmark	12-14-01	861	12-14-99	37 mm	Lead in Air
	5	1	12-14-02	NA	1	1	
	6	1	12-14-03	NN	V	V	1
	7	\checkmark	12-15-01	102297777	12-15-99	37 mm	Load in AIR
	8	/	12-15-02	\		1	
	9	\	12-15-03	1	1	V	V
noplugs	10	✓	12-16-01	1134.0	12-16.00	37mm	Lend in Am
		✓	12-16-02	\	1	1	,
	12	/	12-16-03	λ	<i>\</i>	*	<i>\\</i>
70 pluys	13	/	12-20-01	1018.5	12-20-99	37 m m	LOAD IN NIR
- 1	14		12-20-02	1			
	15	1	12-20-03	₩.	V	V	V

American Industrial Hygiene Association: Laboratory Accreditation #367

C	\cap	\cap	1130		
CHAIN	Relinquished by:	1/2/	Date/Time 12-21-99	Received by	Date/Time
OF	Relinquished by:	1 '	Date/Time	Received at Lab by M. Stephens	סבבו 9 מוב Date/Time במו חוד Date/Time
CUSTODY	Method of Shipment:	' //		Sample Condition Upon Receipt:	Other (explain)
Authorized	by to ht	-/5	Date 12-21-99		
	(Client Signature Must Acco	ompany Request			

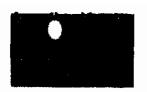

Client Name:

Project Name/Number:

Date Collected:

Project Location:

Shift: 1 1-ST

SUMMART OF

LEAD

MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER

TCLP

Meter TCLP. Pen Limit 549 1/52.9 12-13-01 Luis Hernandez 074 .3 2.1 For Cleaning 314-91-7388 BC 12-13-00 6/mx BC 12.13-03 ANALYSIS: MNIOSH 1082 COLLECTION; COLLECTED BY: KOSINGT BEIG LY ANALYZED BY: AMB **AMBIENT** PERSONAL ROTOMETER NO: QAQC BY: WILLY 11160 ВG BACKGROUND CL CLEARANCE 73397/8 FILTER LOT NO: ANALYTE: **IWA** INSIDE WORK AREA FB FIELD BLANK COLLECTED AND ANALYZED IN ACCORDANCE WITH: OWA **OUTSIDE WORK AREA** AIR -> NIOSH 7300 METHOD TCLP=> **DIGESTION: EPA 1311**

DIGESTION: EPA 3050

ANALYSIS: EPA 6010

ANALYSIS: EPA 6010

Other:

WATER⇒ DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xls



Client Name:

Project Name/Number:

Date Collected:

Project Location:

Shift: 12-14-99

SUMINARY OF

LEAD

MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER TCLP

		 						AR.				Water	TCLR.	Peg Lie
2.14-01	₽ u	15 H	duz	<u> </u>	2.1	0810	410	86			.5			
		me Cle	ראונהיי		2.1	1500			 		-			
	5	<u>88 - 43</u>	3 - 0 9,3	l			<u> </u>		<u> </u>	 		 		
											<u> </u>			<u> </u>
	6e 1	Jorr¥	/	THE WEST SECTION										
12-14-03	BC _	Blant					 			 	 	_		
					†			- 			<u> </u>	+	-	
							-	-		 	┨			
							. _	+	 	┼	┼──			-
_					 					 	┨┈┈	╅		
					-	 		+	 	 	 			
				· · · · ·			-			 		-		
					-		 - -			 	_			
1					 		 						1	
					- 			 	 	 		1		
				_	 					 		 		
COLLECTION:				ANALYS	Is: MN	OP HCO	3)						·	
COLLECTED BY:		r Ben	sley	ANALYZE	BY: H	Milst		AMB	AMBIENT		P	PERSONAL		
ROTOMETER NO:				QAVQC BY	: 2MY	macin		BG	BACKGROUND			CL	CLEARANC	E
FILTER LOT NO:	7339	718		ANALYTE	ρb	0)		IWA	INSIDE V	VORK ARE	A	FB	FIELD BLA	NK
COLLECTED A	AND ANA	LYZED I		RDANCE V	VITH:			OWA	OUTSIDE	WORK A	REA	•		
	NIOSH 7300 DIGESTION			TCLP=>	DIGESTIC ANALYSIS	N: EPA 1311								·

Other:

ANALYSIS: EPA 6010

WATER™ DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xls

CHUIL Maine. Project Name/Number:

Project Location:

Date Collected:

90033-103 HOUSING UNIT B

LEAD

MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER TCLP

							AJR			Water	701.0	T
										Water	TCLP	Reg. Limit
2-15-01	Ρ	Vincinire	13cm 1419	2.1	0803	489	1022.	1	.2			30
		472 - 87	<u> </u>	2.1	1610		 					
	<u> </u>	Fina Clea	M			<u> </u>						
2.15-02	BL	Chon14										
245.03	BL	Blank										
				<u> </u>								
											 	
							 				 	
											 	
_						 						
							 	 				
							├					
						 	<u> </u>	-				
					· 	<u> </u>	ļ	ļ ļ	1	- I		
		,									ľ	
	-		AND THE PERSON NAMED IN COLUMN 2 IN COLUMN									
					Manufacture and the second sec						Martin Commission Commission (Commission Commission Com	
OLLECTIO	V :		ANALYS	s: M\\(1)	32H U083)						
COLLECTED BY	Ro	BERT BERD	RY: MA			AMB	AMBIENT		P	PERSONAL		
OTOMETER N							BG	BACKGROU	ND	CL	CLEARANC	
ILTER LOT NO	12	36714	ANALYTE:	DL	JJ	<u> </u>]				OFFWIN	<i>,</i> E
			CCORDANCE W	TTH:			IWA IOWA	INSIDE WOR		FB	FIELD BLAN	NK
R=>		7300 METHOD	70LP	DICESTION	EDA 1311		LOWA	OUTSIDE W	UKK AREA			
		TION: EPA 3050		ANALYSIS	EPA 6010							

ANALYSIS: EPA 6010

Other:

WATER=> DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xis

CHEIL Hains. Project Name/Number:

Date Collected:

Project Location:

Shift: /SF

LEAD MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER TOLP

							AIR			Wat	er TCLP	Reg. Limit		
#12-6-01	P	JOSE Genzal	<u>a</u>	2.1	0705	480-	1000	1134		5	3. 2.	30		
#12-16-02	BL	Stank		7.1	1605	540				-				
# 12-16-03	12	Blank				Im	3)APC/6							
		531-66-3545												
		Fine Clement					<u></u>			.,				
								†						
					1									
								<u> </u>			- 	 		
					,									
					1	<u> </u>	├							
					 		├				— -			
					 	 -	├	-						
				╅┈┈┈	 		 							
					 -	 	-							
					<u> </u>	<u> </u>	<u> </u>	ļ						
				ļ	 									
														
	<u></u>					<u></u>								
COLLECTION	l:		ANALYSI	s : MN10	SH 7082	-	i							
		soor Bensly		EDBY: Mahaht			AMB AMBIENT			Р	PERSONAL			
ROTOMETER NO): <u>(</u>	-29	QAVQC BY:	muin	<u> 14(?)</u>		ВG	BACKGRO	ONU	CL	CLEARANC	E		
FILTER LOT NO:			ANALYTE:	Pb			IWA	INSIDE WORK AREA		FB	EIEI D DI AA	MIC		
		NALYZED IN ACCO	DANCE W	ITH:			OWA		WORK AREA	1.0	FB FIELD BLANK			
AIR 🖈	NIOSH	7300 METHOD	TCLF	- DIOEOTION	EPA 1311									

ANALYSIS: EPA 6010

Other:

WATER** DIGESTION: EPA 3010

ANALYSIS, EPA 6010

lead-field-form,xls



ANALYSIS: EPA 6010

Other:

Client Name: Project Name/Number:

Date Collected: Project Location:

12.20-11 Housing

9001 8.103 20., Shift: 15T

CHRS NAV BASE

SUIVIIVIAKI UF

LEAD

MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER

TCLP

				AIR							Water	TCLP	Reg. Limit
SAMPLE	57/12	ं वेदल्ली स्विशा⊭०	e/\1(e)\1	Aprile Reosit	ON OTF	TOTAL	VO®UVI≘ (L)	/ (Ú1)	.60% (60%)	DE JECTS LIMITON (ug/Sample)	CONC.	G (E	CONC
12-20-01	ρ	Lus Hernandez		2.1	0715	445	1018-5			A S-Theffer & Manual			
		314-91- 7388		2.1	1620	545	1144.5	-\-					
	1	Fine Chang, ex	Lyor.				Tm	1791PC					
12. 20-02	BC	Blank											
12-20-03	BL	Blonk											
													<u> </u>
			,										
													_
													_
													-
						<u></u>							
COLLECTION	N:		ANALYSIS	s:MNID	H 108	Σ			FATTE	year Pers	EGEND		
COLLECTED BY	: Koo	ert Bensly	ANALYZED	ex: Alest	tit		AMB	AMBIENT			P	PERSONAL	
ROTOMETER NO: \$ - 29 QA/QC				MY (III	aggin		вG	BACKGROUND			CL	CLEARANC	E
FILTER LOT NO:		39718 ANALYZED IN ACCOR	ANALYTE:	())			IWA		ORK AREA		FB	FIELD BLA	NK
AIR =>		7300 METHOD	TCLP=>	DIGESTION:	FPΔ 1311		OWA	OUISIDE	WORK AR	EA			
7411 -F		TION: EPA 3050	1061-2	ANALYSIS: E									

lead-field-form.xls

WATER=> DIGESTION: EPA 3010

ANALYSIS: EPA 6010



CLIENT: CAPE Environmental

2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9912103

Received: 12/21/1999 2:34:00 PM

Received by: McGuiggan T

Validated: 12/29/1999 4:27:00 PM

Validated by: McGuiggan T

Approved: 12/29/1999 4:27:00 PM

Approved by: McGuiggan T

Client Sample ID: 12-13-01

Azimuth ID: 9912103-01

Collection Date: 12/13/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 1152.9 Liters

TeachMethodDetection LimitSample ResultConcentrationLear-(Filter)mNIOSH 70820.5 mg/L<5 ug</td><4.3 ug/m3</td>

Client Sample ID: 12-13-02

Azimuth ID: 9912103-02

Collection Date: 12/13/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 12-13-03

Azimuth ID: 9912103-03

Collection Date: 12/13/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

TestMethodDetection LimitSample ResultConcentrationLead (Filter)mNIOSH 70820.5 mg/L<5 ug</td>NAug/m3

Report Printed 12/29/1999

Page 1 of 4

Chent Sample ID: 12-14-01 Collection Date: 12/14/1999

Azimuth ID: 9912103-04 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 861 Liters

TestMethodDetection LimitSample ResultConcentrationLead (Filter)mNIOSH 70820.5 mg/L<5 ug</td><5.8 ug/m3</td>

Client Sample ID: 12-14-02 Collection Date: 12/14/1999

Azimuth ID: 9912103-05 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 12-14-03 Collection Date: 12/14/1999

Azimuth ID: 9912103-06 Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 12-15-01 Collection Date: 12/15/1999

Azimuth ID: 9912103-07 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 1022.7 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug <4.9 ug/m3

Client Sample ID: 12-15-02 Collection Date: 12/15/1999

Azimuth ID: 9912103-08 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug NAug/m3

Owent Sample ID: 12-15-03 Collection Date: 12/15/1999

Azimuth ID: 9912103-09 Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 12-16-01 Collection Date: 12/16/1999

Azimuth ID: 9912103-10 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 1134 Liters

TestMethodDetection LimitSample ResultConcentrationLead (Filter)mNIOSH 70820.5 mg/L<5 ug</td><4.4 ug/m3</td>

Client Sample ID: 12-16-02 Collection Date: 12/16/1999

Azimuth ID: 9912103-11 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 mNIOSH 7082
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 12-16-03 Collection Date: 12/16/1999

Azimuth ID: 9912103-12 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

TestMethodDetection LimitSample ResultConcentrationLead (Filter)mNIOSH 70820.5 mg/L<5 ug</td>NAug/m3

Client Sample ID: 12-20-01 Collection Date: 12/20/1999

Azimuth ID: 9912103-13 **Media:** 37 mm 0.8 μ MCE

Sample Volume: 1144.5 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug <4.4 ug/m3

nt Sample ID: 12-20-02

Azimuth ID: 9912103-14

Collection Date: 12/20/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug NAug/m3

Client Sample ID: 12-20-03

Azimuth ID: 9912103-15

Collection Date: 12/20/1999

Media: 37 mm 0.8 µ MCE

Sample Volume: 0 Liters

Test Method Detection Limit Sample Result Concentration

Lead (Filter) mNIOSH 7082 0.5 mg/L <5 ug NAug/m3

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number:100624

The volumes for samples 12-15-01, 12-16-01 and 12-20-01 were adjusted based on the times and flow rates provided on Lead Field Form.

Final Approval: 2014 MG (Suggen, Job Manacy)

Date: Delamber 29, 1999



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9912110

Received: 12/22/1999 1:12:00 PM

Received by: McGuiggan T

Validated: 01/07/2000 4:17:00 PM

Validated by: McGuiggan T

Approved: 01/07/2000 4:17:00 PM

Approved by: McGuiggan T

Client Sample ID: 12-21-01

Azimuth ID: 9912110-01

Collection Date: 12/21/1999

Media: 37 mm 0.8 μ MCE

Sample Volume: 1029 Liters

MethodDetection LimitSample ResultConcentrationLead (Filter)NIOSH 73000.5 mg/L<5 ug</td><4.9 ug/m3</td>

Client Sample ID: 12-21-02

Azimuth ID: 9912110-02

Collection Date: 12/21/1999

Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

 Test
 Method
 Detection Limit
 Sample Result
 Concentration

 Lead (Filter)
 NIOSH 7300
 0.5 mg/L
 <5 ug</td>
 NAug/m3

Client Sample ID: 12-21-03

Azimuth ID: 9912110-03

Collection Date: 12/21/1999

Media: 37 mm 0.8 μ MCE

Sample Volume: 0 Liters

TestMethodDetection LimitSample ResultConcentrationLead (Filter)NIOSH 73000.5 mg/L<5 ug</td>NAug/m3

Report Printed 01/07/2000

Page 1 of 2

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052 ELLAP Laboratory ID Number:100624

Final Approval: Drug M'Guggan, Lab Manager

Date: Tirway 9, 2000



Test Request Form A Division of Azimuth, Incorporated 9229 University Blvd. Charleston, SC 29406 (800) 968-3565 Fax (843) 569-8792 Verbal results accor Core 1 ret PARKAINE Address . Results needed by: __ Sample Type In DIK Project No. # of Samples 90033.103 Contact Name Phone No. **Date Shipped** 12-2299 Special Instructions / Unusual Conditions / Possible Interferences: Lab Use Sample Number Sample Volume Date **Analysis** Only or Area or Time Sampled Media Type Requested 12-21-01 12-21-99 7 mm 12-21-02 12-21-03

American Industrial Hygiene Association: Laboratory Accreditation #367

		11.50		
CHAIN	Relinquished by / T	Date / ime - 1047	Received by:	Date/Time
OF	Religiquished by:	Date/Time	Received at Lab by: \(\) (\(\) (\(\) (\(\)))	Date/Time) 23/49/150
CUSTODY	Method of Shipment:		Sample Condition Upon Receipt: 🗥 Acceptable	Other (explain)
Authorized		Date/37299		
	(Client Signature Must Accompany Request)	_		

Cilett Manie. Project Name/Number: **Date Collected:**

Project Location:

Shift:

LEAD

MONITORING

RESULTS

SAMPLE TYPE:

AIR WATER TCLP

							AIR				Water	TCLP	Reg. Limit
												100	reg. cant
			1										
									.				
12-21-01	P	LUIS HINAGO		2.1	0115	490	1029						
	 	Fin Clean		2.1	1525		 	 					
	 				- 		<u> </u>	 			╀	<u> </u>	
12-21-02	bc	Blank	1.		<u> </u>			<u> </u>					
					<u> </u>							<u> </u>	
12-21-03	BC_	Blank											
	1									·			
	1										1	†	1
					<u> </u>		T		† <u>-</u>		1 –	 	
	†		···	 			 	-	†		 		<u> </u>
	+		.,	 		 	+				 	 	
	 			 -	 	-	 	 	+		╂	╂	
. 35 day 5	1			 		 		 			╂		<u> </u>
					- 1			<u>L</u>			. 	}	
	┼	<u> </u>		<u> </u>			 				4	-	
	-										<u> </u>		
	<u> </u>			<u> </u>			<u> </u>					and and are	
COLLECTIO	N:		ANALYS	s:()(Q)	H7300	}							
COLLECTED B	e Rod	BENT BENSKY	ANALYZED	BY: Marl	het m	lepho	AMB	AMBIENT			P	PERSONAL	
ROTOMETER N		-29	OA/OC RV	Îm'L	ille din	, ac p 10	BG	BACKGR					
				γ	Jy '		7	unonon	~014D		CL 	CLEARANC	Æ
FILTER LOT NO	$\frac{93}{93}$	397/8	ANALYTE:				IWA		VORK AREA		FB	FIELD BLAN	NK
		NALYZED IN ACC					OWA	OUTSIDE	WORK AREA	4			
AIR ⇒		7300 METHOD	(CL)		N. EFA 1911		t						
		TION: EPA 3050		ANALYSIS	: EPA 6010								

ANALYSIS: EIPA 6010

Other:

WATER=> DIGESTION: EPA 3010

ANALYSIS: EPA 6010

lead-field-form.xls

Appendix B

Results of Water Sample Analysis



Test Request Form

A Division of Azimuth, Incorporated

NameAddress	5 Fax (843) 569-87 ADC 2 30 3 NTC M	Pos	KIAW Pr.		Fax #	rece conoline
Project No. 90033./	/บ.ร	Sample Ty	NATER	# of Samples	<u></u>	P.O.
Contact Nama + DE RT Special Instruction	M Be	105 Ly	Phone No.		Date S	hipped -22-99
Lab Use Only	Sample Ni or Are		Sample Volume or Time	Date Sampled	Media Type	Analysis Requested
	#/ Vnir	B	~/n	12-2299	WATER	Lend in WATE
	#1 Vair #2 Vair	 ブ	1	1		
	#3 Unir	B	1	V	N. C.	V
			<u> </u>			

CHAIN Relinquished by:

OF Relinquished by:

Date/Time



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9912113

Received: 12/22/1999 1:12:00 PM

Received by: McGuiggan T

Validated: 01/19/2000 12:10:00 PM

Validated by: Pfaff J

Approved: 01/19/2000 12:11:00 PM

Approved by: Pfaff J

Client Sample ID: #1 Unit B

Azimuth ID: 9912113-01

Test

in Water

Method

EPA 239.2

Collection Date: 12/22/1999

Sample Result

6.0 mg/L

Collection Date: 12/22/1999

Client Sample ID: #2 Unit J

Azimuth ID: 9912113-02

Test

Method

Lead in Water

EPA 239.2

Sample Result

6.19 mg/L

Client Sample ID: #3 Unit B

Azimuth ID: 9912113-03

Method

Lead in Water

Test

EPA 239.2

Collection Date: 12/22/1999

Sample Result

6.21 mg/L

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number: 100624

Detection limit: 0.50mg/L

Final Approval: Down M'auggin, Lab Manager

Date: Tinuary 20,2000

Report Printed 01/19/2000

Page 1 of 1

A Division of Azimuth, Incorporated

Appendix C Results of Dust Wipes and Soil Samples



UNIT J

Test Request Form

A Division of Azimuth, Incorporated 9229 University Blvd. Charleston, SC 29406 (800) 968-3565 Fax (843) 569-8792 Verbal results Address Results needed by: _ P.O. Project No. # of Samples 90033.103 Contect Name Phone No. **Date Shipped** 744-1230 Special Instructions / Unusual Conditions / Possible Interferences:

Lab Use Only	Sample Number or Area	Sample Volume or Time	Dete Sampled	Medie Type	Analysis Requested
			11-18-99	DUST WIPE	2 Dust Lead
	2_		1		
	3				
	4				
	5				
	6				
	7				
	В				
	19				
	10				
	//		1	Į.	
	•				

American Industrial Hygiene Association: Laboratory Accreditation #367

-		0	1800		
CHAIN OF	Relinquished by:		Daje/img/5-49	Received by.	Date/Time
CUSTODY	Relinquished by: Method of Shipment:	$\left(\cdot \right)$		Sample Condition Upon Receipt: Acceptable	16.12.1371
Authorized	by: (Client Signature Must Ac	company Request)			
					



Name of prop Property addr Clearance cat 1. Inter 2. Inter 3. Exte	rance examination work on the mainten	ts without containing painted surfaces	TOTING Apt. no. nment.	lay Techn	_	. •	(6)
Sample number	Room number or Identifier	Surface type (floor, interior window stil, window trough)	Clearance category lumber	Dimensions of sample area (inches)	Area (ft²) (can be completed by lab)	Result of lab analysis (µg/ft²) (can ba completed by lab)	Pass or Fail
10	Blonk				O.000		
11	Blank				0,000		
Total number Page 2 Date of samp Shipped by	of _2	on this page 2 1/18/79 M/Son (Signature)	D.ite shipped	to lab // 18 ceived by 10		ure)	



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9911094

Received: 11/18/1999 10:44:00 AM

Received by: Pfaff J

Validated: 11/19/1999 9:36:00 AM

Validated by: Pfaff J

Approved: 11/19/1999 9:36:00 AM

Approved by: Pfaff J

Client Sample ID: 1

Azimuth ID: 9911094-01

Collection Date: 11/18/1999

Media: wipe

Sample Area: 1 Ft2

Ľ(—

Method mNIOSH 7082 Detection Limit

Sample Result 74 ug Concentration

74 ug/Ft2

Client Sample ID: 2

Azimuth ID: 9911094-02

Collection Date: 11/18/1999

Media: wipe

Sample Area: 1.896 Ft2

Test

Method

Detection Limit

Sample Result

Concentration

Lead Wipe

mNIOSH 7082

0.5 mg/L

0.5 mg/L

33 ug

17 ug/Ft2

Client Sample ID: 3

Azimuth ID: 9911094-03

Collection Date: 11/18/1999

Media: wipe

Sample Area: .802 Ft2

Test

Method

Detection Limit

Sample Result

Concentration

Lead Wipe

mNIOSH 7082

0.5 mg/L

<25 ug

<31 ug/Ft2

Report Printed 11/19/1999

Page 1 of 3

Client Sample ID: 5

Chent Sample ID: 4 Collection Date: 11/18/1999

Azimuth ID: 9911094-04 Media: wipe

Sample Area: 1 Ft2

Test Method **Detection Limit** Sample Result Concentration <25 ug/Ft2 Lead Wipe **mNIOSH 7082** 0.5 mg/L <25 ug

Collection Date: 11/18/1999 Azimuth ID: 9911094-05 Media: wipe

Sample Area: 2.167 Ft2

Test Method **Detection Limit** Sample Result Concentration <12 ug/Ft2 Lead Wipe mNIOSH 7082 0.5 mg/L <25 ug

Collection Date: 11/18/1999 Client Sample ID: 6

Azimuth ID: 9911094-06 Media: wipe

Sample Area: 1 Ft2

Test **Detection Limit** Concentration Method Sample Result ead Wipe **mNIOSH 7082** <25 ug/Ft2

0.5 mg/L <25 ug

Client Sample ID: 7 Collection Date: 11/18/1999

Azimuth ID: 9911094-07 Media: wipe

Sample Area: .972 Ft2

Test Method **Detection Limit** Sample Result Concentration Lead Wipe 43 ug/Ft2 **mNIOSH 7082** 0.5 mg/L 42 ug

Collection Date: 11/18/1999 Client Sample ID: 8

Azimuth ID: 9911094-08 Media: wipe Sample Area: 1 Ft2

Test Method **Detection Limit** Concentration Sample Result Lead Wipe **mNIOSH 7082** 0.5 mg/L <25 ug <25 ug/Ft2

Client Sample ID: 9

Test

Lead Wipe

Azimuth ID: 9911094-09

Collection Date: 11/18/1999

Sample Area: 1 Ft2

<25 ua

Media: wipe

Concentration Sample Result

Client Sample ID: 10

Azimuth ID: 9911094-10

Collection Date: 11/18/1999

Media: wipe

Sample Area: 0 Ft2

Test Method **Detection Limit** Sample Result Concentration Lead Wipe **mNIOSH 7082** 0.5 mg/L

Detection Limit

0.5 mg/L

<25 ug NAug/Ft2

Client Sample ID: 11

Azimuth ID: 9911094-11

Collection Date: 11/18/1999

Media: wipe

Sample Area: 0 Ft2

Test Concentration Method **Detection Limit** Sample Result

ead Wipe

mNIOSH 7082

Method

mNIOSH 7082

0.5 mg/L

<25 ug

NAug/Ft2

<25 ug/Ft2

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Numbar: 100624

NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number:100624

The wipes did not digest into solution well, thus sample loss may have occured.

Final Approval: DUK M' Guggin, Lab MM Cyl

Date: NCVCMber 19, 1999

Report Printed 11/19/1999



Date/Time | 1/19/94 /540



CHAIN

OF

CUSTODY

Authorized by:

Relinquished by:

Method of Shipment:

(Client Signature Must Accompany Request)

Name	Fax (843) 569-8792 APE Envilo 2302 Park NTLANTA GA	untal Lane Dr.		Special requests: Verbal results Fax report Fax # Results needed by	165 744-1230 144-1230 24463
ject No. 100 33 . (1) ntact Name 140 BE	KT BEASL	2014 Phone No. 74	# of Sample	Date 5	P.O. 7 Shipped
3 d	/ Unusual Conditions / Poss	1 1	eput	Results	in PPM.
Lab Use Only	Sample Number or Area	Sample Volume or Time	Dete Sampled	Media Type	Analysis Requested
	511 -15-01		11-1599	Soil	Londin
	5 subsimples				
	GAKAJE#1				
	511-15-02		11-15-99	Soil	
	5 Sibsophs				
	pom Dapline 6ALAGE#Z				
	5-11-15-03		11-15-99	Soil	
	5-11-15-03 MAIN House 5 subsniplan Nom dripline				
	nom de solve				

Received by

Date

Received at Lab by: Hught

Sample Condition Upon Receipt. Acceptable



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9911089

Received: 11/18/1999 7:55:00 AM

Received by: Pfaff J

Validated: 11/23/1999 1:44:00 PM

Validated by: Pfaff J

Approved: 11/23/1999 1:44:00 PM

Approved by: Pfaff J

Collection Date: 11/15/1999

Sample Result

Collection Date: 11/15/1999

Client Sample ID: S11-15-01

Azimuth ID: 9911089-01

Test Method

mNIOSH 7082 550 ppm

11111001117002

Client Sample ID: S11-15-02

Azimuth ID: 9911089-02

Test Method Sample Result

Lead mNIOSH 7082 1200 ppm

Client Sample ID: S-11-15-03 Collection Date: 11/15/1999

Azimuth ID: 9911089-03

Test Method Sample Result

Lead mNIOSH 7082 270 ppm

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624 NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number: 100624

Detection Limit - 0.5 mg/L

Final Approval:_

Date: 11 29 99

Report Printed 11/23/1999

Page 1 of 1

A Division of Azimuth, Incorporated



Test Request Form

Name	Fax (843) 569-8 1302 ATCAN	Enu, Porkla	connetal re one		Fax #	770-	C @ CAROL.N -880-9746 -744-1230 108-7219 24465
Project No. 9 00 33 . /	03	Sample Typ	5014	# of Sai			P.O.
Contact Name	KT BE	ash	Phone No	0.744-12	30	Date Shippe	8-99
Special Instructions	/ Unusual Cond	fitions / Poss	ible Interference	!\$:			
Lab Use Only	Sample I		Sample Volui or Time	me Date Sampled	Media	Туре	Analysis Requested
	5-1			11-18-	9 Sol	<u>_</u>	Dyss (un
	<u>-</u>						
American Industrial I	Jugiono Associa	tion: Laborat	na. A coraditation	#267			
American Industrial I	Tygierie Associa	mon. Laborati	1000	1 #30 <i>1</i>			
Relinquistred by:W	- an	Day	6Km/8-99	Received by	Amy		Date/Time
Relinquished by:	7	Da	te/Time	Received at Lab by:	111777	WN	Date/Time () V Z

	-	
	Α₩.	
•		
•	\sim	,

Chapter 15: Clearance



ample number	l costion .	Bare or covered	Lab result (μg/g)
	Location building perimeter	Bale of Covered	Lab result (µg/g)
	building perimeter		
5-1+	See Most	BALE	
-2*		Covered	
-3*		Councid	
5-4-		Bre	
5-5+	V	Bue	
	Samples /		INTED to
	CABOR STORY	as one Compo	SME SAPR
	1 77 2	1	
	 		•



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9911093

Received: 11/18/1999 10:39:00 AM

Received by: Pfaff J

Validated: 11/22/1999 9:56:00 AM

Validated by: Pfaff J

Approved: 11/22/1999 9:56:00 AM

Approved by: Pfaff J

Client Sample ID: S-1

Azimuth ID: 9911093-01

Collection Date: 11/18/1999

Azimuth ID: 9911093-01

Test

Method

mNIOSH 7082

Sample Result

0.0976 % by wt

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number: 100624

Detection Limit - 0.50 mg/L

Final Approval:

Date:

Report Printed 11/22/1999

Page 1 of 1



PS 1800577-7468 pin 2547407

Test Request Form

A Division of Azimuth, Incorporated

	Blvd.		# of Sample / O	Fax # Results needed by	P.O. Shipped -23-99
Lab Use	Sample Number	Sample Volume	F B		Analysis
Only	or Area	or Time	Sampled	Media Type	Requested
	#1 Floor, HAI) 1	12" × 12").00	12-2244	h,pe	Lend
	#2511, Rm#2	37" x 21/4" c	578	<i></i>	
	#3 Traigh , Pmb	27' × 43/4"	0.891		
	#4 Flour KITCH. #5 Flour, Ento #6 Sill, 2nd Flour #7 Trough, 2nd Flour #8 Flour, En1	12" X12").	000	13th	
	#5 Flour, to	12" x 12"].	000 Ch		
	#6 5111, 21d Floor	37" x 214"0	578		
	#7 Trough, 2nd Fran	27" x 434" 0	891		/
✓	#8 Floor and Flor	12" X12" L	20 /		
	#9 Blank	VA 0.000	•		
	#10 Blank	l .		\	1

American Industrial Hygiene Association: Laboratory Accreditation #367 1140

Marchael Comment	1/1/		- 11/0		
CHAIN	Relinguistied by: [~	-/- 0/	Dayle Jimo J.J-17	Received by	Date/Time
OF	Relinquished by:	7 /) "	Date/Time	Received at Lab by // Culture	Date/Tim/2/27/4/
CUSTODY	Method of Shipment:	//2		Sample Condition Upon Receipt. Acceptable	Other (explain)
Authorized	· /	-/ DX	Date/2-2399		
	(Client Signature Must Ag	company Request)			



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN.: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9912111

Received: 12/22/1999 1:12:00 PM

Received by: McGuiggan T

Validated: 12/29/1999 4:23:00 PM

Validated by: McGuiggan T

Approved: 12/29/1999 4:23:00 PM

Approved by: McGuiggan T

Client Sample ID: #1 Floor, Hall 1

Azimuth ID: 9912111-01

Collection Date: 12/22/1999

Media: Baby Wipe

Sample Area: 1 Ft2

Tpont	Method	Detection Limit	Sample Result	Concentration
LewWipe	mNIOSH 7082	0.5 mg/L	<25 ug	<25 ug/Ft2

Client Sample ID: #2 Sill, Rm #2

Azimuth ID: 9912111-02

Collection Date: 12/22/1999

Media: Baby Wipe

Sample Area: .578 Ft2

Test	Method	Detection Limit	Sample Result	Concentration
Lead Wipe	mNIOSH 7082	0.5 mg/L	<25 ug	<43 ug/Ft2

Client Sample ID: #3 Trough, Rm #6

Azimuth ID: 9912111-03

Collection Date: 12/22/1999

Media: Baby Wipe

Sample Area: .891 Ft2

Test Method		Detection Limit	Sample Result	Concentration		
Lead Wipe	mNIOSH 7082	0.5 mg/L	27 ug	30 ug/Ft2		

Report Printed 12/29/1999

Page 1 of 3

Collection Date: 12/22/1999 Charit Sample ID: #4 Floor, Kitch.

Azimuth ID: 9912111-04 Media: Baby Wipe

Sample Area: 1 Ft2

Test **Detection Limit** Concentration Method Sample Result Lead Wipe mNIOSH 7082 <25 ug/Ft2 0.5 mg/L <25 ug

Client Sample ID: #5 Floor (Rm 1) Collection Date: 12/22/1999

Azimuth ID: 9912111-05 Media: Baby Wipe

Sample Area: 1 Ft2

Test Method **Detection Limit** Sample Result Concentration Lead Wipe mNIOSH 7082 0.5 mg/L <25 ug <25 ua/Ft2

Client Sample ID: #6 Sill, 2nd Floor, Rm 3 Collection Date: 12/22/1999

Azimuth ID: 9912111-06 Media: Baby Wipe

Sample Area: .578 Ft2

Test Method **Detection Limit** Sample Result Concentration Lead Wipe **mNIOSH 7082** 67 ug/Ft2 0.5 mg/L 39 ug

Client Sample ID: #7 Trough, 2nd Floor Rm 1

Collection Date: 12/22/1999 Azimuth ID: 9912111-07

Media: Baby Wipe Sample Area: .891 Ft2

Test Method **Detection Limit** Sample Result Concentration

Lead Wipe mNIOSH 7082 0.5 mg/L <25 ug <28 ug/Ft2

Client Sample ID: #8 Floor, 2nd Floor Rm 1 Collection Date: 12/22/1999

Azimuth ID: 9912111-08 Media: Baby Wipe

Sample Area: 1 Ft2

Test Concentration Method **Detection Limit** Sample Result Lead Wipe **mNIOSH 7082** <25 ug/Ft2 0.5 mg/L <25 ug

Cherit Sample ID: #9 Blank

Azimuth ID: 9912111-09

Collection Date: 12/22/1999

Media: Baby Wipe

Sample Area: 0 Ft2

Test Method Detection Limit Sample Result Concentration

Lead Wipe mNIOSH 7082 0.5 mg/L <25 ug NAug/Ft2

Client Sample ID: #10 Blank

Azimuth ID: 9912111-10

Collection Date: 12/22/1999

Media: Baby Wipe

Date: <u>Delomber</u> 29, 1949

Sample Area: 0 Ft2

Test Method Detection Limit Sample Result Concentration

Lead Wipe mNIOSH 7082 0.5 mg/L <25 ug NAug/Ft2

Director of Laboratories: Richard D. Bennett, MSPH CIH

AiHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number:100624

Samples did not fully digest and go into solution; therefore, sample loss may have occurred.

Final Approval: 2014 M. M. Guggin, Comunage

Report Printed 12/29/1999



CHAIN

Relinquished by:

Method of Shipment:

(Client Signature Must Accompany Request)

OF CUSTODY

Authorized by:

Test Request Form

A Division of Azimuth, Incorporated

Name	Fax (843), 569-879 APE 2302. ATEM	ENU, POLICI	pra Or.		Fav #	14-1230
					Results needed by	: Sany
ect No. 90033.	103	Sample Type	16	# of Sample	<u></u>	P.O.
Tact Name KOPSERT	BERSLE	y	Phone No.			hipped -22-99
cial Instructions	/ Unusual Condit	ons / Possit		- B		
Lab Use Only	Sample Nu or Are		Sample Volume or Time	Data Sampled	Media Type	Analysis Requested
	#1-6	gilace#)	5 sibsorples	1275-99	Soil	Lend in Se
		_	1			
	#3 Hu	15e	Λ	V	V	₩
			_			
						-

Received by

Received at Lab by

Sample Condition Upon Receipt

Date/Time

Date 12-00-99

on Receipt Acceptable

Date/Time 2009 172

Other (explain)



2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9912112

Received: 12/22/1999 1:12:00 PM

Received by: McGuiggan T

Validated: 12/30/1999 1:49:00 PM

Validated by: Pfaff J

Approved: 12/30/1999 1:49:00 PM

Approved by: Pfaff J

Collection Date: 12/15/1999

Collection Date: 12/15/1999

Sample Result

Client Sample ID: #1-Garage #1

Azimuth ID: 9912112-01

Test Method

Sample Result **mNIOSH 7082** 0.0607 % by wt

Client Sample ID: #2 Garage #2

Azimuth ID: 9912112-02

Test Method Sample Result

Lead mNiOSH 7082 0.2870 % by wt

Client Sample ID: #3 House

Azimuth ID: 9912112-03

Collection Date: 12/15/1999

Test Method

Lead mNIOSH 7082 0.0529 % by wt

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624 NY State ELAP Lab No. 11052 ELLAP Laboratory ID Number: 100624

Detection limit: 0.50mg/L

Final Approval: Drug M'Guggan, Lab Manage

Date: Junuary 3,2000

Report Printed 12/30/1999

Page 1 of 1



5011

CLIENT: CAPE Environmental

2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN.: Robert Beasley/J. Shannon

Project Info: 90013.010

Purchase Ord:

Workorder: 0001018

Received: 01/10/2000 8:19:00 AM

Received by: McGuiggan T

Validated: 01/12/2000 3:27:00 PM

Validated by: McGuiggan T

Approved: 01/12/2000 3:27:00 PM

Approved by: McGuiggan T

Client Sample ID: Garage #2 Housing Unit B

Azimuth ID: 0001018-01

Collection Date: 01/08/2000

Test

Method

mNIOSH 7082

Final Approval: Drya M'Guggen Joh Mager

Sample Result

0,1054 % by wt

Director of Laboratories: Richard D. Bennett, MSPH CiH

AIHA Laboratory ID Number: 100624

NY State ELAP Lab No. 11052

ELLAP Laboratory ID Number: 100624

Detection limit: 0.50mg/L

Date: January 12,2000

Report Printed 01/12/2000

Page 1 of 1



Test Request Form

A Division of Azimuth, Incorporated

9229 University Blvd.

Charleston, SC	29406	
(000) 0(0 25(5	Tr (0.42) 5(0)	

(Client Signature Must Accompany Request)

Project No. 9013.	010 Sample Typ	d in Son	# of Samples		P.O.
Contact Name	NT BENSLEY /J. Sh	Phone No.	CC 488-43	72 Date Sh	8- 90
Special Instruction	s / Unusual Conditions / Possi	ible Interferences:	11		
	1845	146	Init	<u> </u>	
Lab Use Only	Sample Number or Area	Sample Volume or Time	Date Sampled	Media Type	Analysis Requested
	GALAGE #2		1-8-2000	SOIL	Lerdin
	Housing Unir	B			
	55,160-060				
	5 700311-7103				
					-
American Industria	Hygiene Association: Laborato	ory Accreditation #36	7		

HUD Lead in Drinking Water

Samples were analyzed by Graphite Furnace Atomic Absorption Spectrometry in accordance with EPA Method 239.2.

Values reported as less than (<) indicate that the amount of analyte present was below the established reporting limit.

Analyst:

Roosevelt Mouzan

Date:

Date: 1118100

Reviewer:

Tonya McGuiggan

Appendix D

Results of TCLP Samples



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

2302 Parklake Drive, NE Address:

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

Project: CAPE00399

Client ID: CAPE001

Contact:

Mr. Craig Birch

Project: Charleston Naval Base

Client Sample ID:

Sample ID:

Matrix:

Collect Date: Receive Date:

Collector:

#1 PLASTIC 20019001

Misc Solid

15-DEC-99

03-JAN-00

Client

Parameter	Qualifier	Result Units	Method	Analys	t Date	Time	Batch
Metals Analysis-ICP							
TCLP ICP Metals for Solid							
Lead		26.4 mg/l	SW846 6010B	KAR	01/08/00	2135	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. tandard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

Address: 2302 Parklake Drive, NE

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

CAPE00399

Project:

Client ID: CAPE001

Contact: Project: Mr. Craig Birch

Charleston Naval Base

Client Sample ID:

Sample ID: Matrix: Collect Date:

Collect Date: Receive Date: Collector: #2 SUTTS 20019002 Misc Solid


15-DEC-99 22-DEC-99

Client

Parameter	Qualifier	Result Units	Method	Analys	t Date	Time	Batch	
Metals Analysis-ICP								
TCLP ICP Metals for Solid								
Lead		11.9 mg/l	SW846 6010B	KAR	01/08/00	2140	6039	

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.

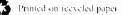



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

2302 Parklake Drive, NE Address:

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

CAPE00399

Project:

Client ID: CAPE001

Contact: Project:

Mr. Craig Birch Charleston Naval Base

Client Sample ID:

Sample ID:

- Matrix: Collect Date:

Receive Date: Collector:

#3 PAINT CHIPS

20019003 Misc Solid

15-DEC-99 22-DEC-99

Client

Parameter	Qualifier	Result Units	Method	Analyst	Date	Time	Batch
Metals Analysis-ICP							
TCLP ICP Metals for Solid							
Lead		24.4 mg/l	SW846 6010B	KAR	01/08/00	2157	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.





Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

Address: 2302 Parklake Drive, NE

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

Project: CAPE00399 Client ID: CAPE001

Contact: Project:

Mr. Craig Birch Charleston Naval Base

Client Sample ID: Sample ID:

Matrix: Collect Date: Receive Date: Collector: #4 RAGS 20019004 Misc Solid

15-DEC-99 22-DEC-99

Client

Parameter	Qualifier	Result Units	Method	Analyst	Date	Time	Batch
Metals Analysis-ICP							
TCLP ICP Metals for Solid							
Lead		37.7 mg/l	SW846 6010B	KAR	01/08/00	2202	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.



Appendix E

Daily Field Report Summaries

CAPE
ENVIRONMENTAL Form Noof
MANAGEMENT
I N C DAILY PROJECT LOG
Monday -10/18/99
PROJECT: CHARLESTON HOUSING J 413
PROJECT ADDRESS: 311 NAVY WAY OSLAGE T
NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.
TIME 7 10 45 FAIR FIRST DAY - WE ARE BACK
Today we one inlooding the Freze with
materials we will be very on B. \$ 5 Houses.
we also recure Supplies from Linco
we also strted to do some ply prep on
Blde # B
Today we also went to be, head of
Zine test. (4 corkers) tomorrow à unil date the rest
we had a Sozety meetling 71 mm this
nearming.
Dory Endang with his Accidents
SIGNED: PROJECT SEPERINTENDENT/DESIGNEE
10/18/59

$\mathbf{C} \mathbf{A} \mathbf{P} \mathbf{E}$	10b No. 90033, 103
ENVIRONMENTAL FORM No.	
MANAGEMENT	
I N C DAILY PROJECT LOG	
Toody 10/19 697	
PROJECT: CHARLESTON HOUSIN J4	<u> 13</u>
PROJECT ADDRESS: 3// MAKY Way	
	-
NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hinng or firing of occurrence which may affect the project. A signature and title must be added following all entries in the spaces between entries.	personnel and any other
TIME 7:00/05/30 Today Au worter's or	hme, we
Continues poly prop using	6mil
Also other 3 year being went to	have Blood
Lead fest wid zinca	
309 pup completed, Decontomination	30,4,0
	-
	·
Electrical Unit with J.F.I. 411 871	ys, And
hed tope posted Amound the House:	
Lody [car Princed tomorra	
No feerants.	
SIGNED: MARY!	
PROJECT SUPERINTENDENT/DESIGNEE	

g-€€11714±11€019±5

DATE:

2,2,1,1,2,0,0			Q:				- · <u>-</u>
C A D	T. :					Job No. 900	33/03
CAP ENVIRONMEN					Form	No1	
MANAGEME		<u>DAI</u>	LY PROJEC	I LOG			
60 Quesdis	 1 10/2019	7				•	
		_	1/		Td		
PROJECT ADDRESS:				- This	J &	/5	
PROJECT ADDRESS:		evr i c	<u>~ </u>			<u> </u>	
NOTE: Fill in GENERA taken, injuries, equipmen occurrence which may a spaces between entries.	nt breakdown, un	usual conditions	or situations,	inspections, h	iring or firing	of personnel and	any other
TIME 7:00 / 5,3	du i	75 f	Day	OF 1	LEAD	PAIRET	<u>. </u>
_ lemo,	CAL- W	e are	U 51!	us p	CE (HW	ite.	
<u>wont</u>	<u>~150</u>	(Smy	mode	echr	Q_ Qu	> 1252L	ble
ONFOR	~5,)	12 FACE	- Bory	21/2	protec	ton u	144
dear	- Mite	-51	ub be	- 6001	13 C	loves	Sorcita
Closs E	Hand 6	rots.		•			
_) Uè	- Wpphy	the C	Miny o	issid to	duy i	tud Kr	nue
the	hert d	luy. P	sel Have	Need	5 1401	e thing	shirs.
to work	5(~ px	ethers!)					<u> </u>
	V		Co d	codo	er fors		
	·						

gs/13/1714u51/forms

PROJECT SUPERINTENDENT/DESIGNEE

SIGNED:

DATE:

02/14/2000	16:47	2054204264	CAPE ENV MGT	PAGE 43
$\mathbf{C}A$	P	<u>E</u>	For	Job No. <u>90033.103</u>
	ONMENT GEME			01
_	N		DAILY PROJECT LOG	•
	•	10/21/89		
PROJECT:	CH	ARLES	ton Housing J ANY way Block J	£13
PROJECT A	DDRESS:	311 NW	ANY way Block J	
NOTE: Fill in taken, injuries	n GENERA s, equipmen nich may aft	L comments on rot	utine progress on this project for the above date. DE wal conditions or situations, inspections, hiring or fir signature and title must be added following all entries	TAIL major problems and action ing of personnel and any other
TIME 7100	to 5139	m we	Confiner with Le	I pout Re-
			- Pirono IV And Ped Ace	
wife	1 pm	feature	disposable unixoms, 42	plie uspitul
			- rebber gloves & Sopre	
·		•	moreony the head po	,
doar	- En	nes Are	Landarg. une Also	will scrape
Cryry	hous	e paint	- from walls and Ceal	ling. Tempetie
15	below	, normal	1. THE Olymical one he	of working
100/0	. ac	- apply	more than one time	و
		DUA	more than one time	rdet 5
	_	<u> </u>		<u> </u>

$\mathbf{C} \cdot \mathbf{A} \cdot \mathbf{P} \cdot \mathbf{E}$	Job No
ENVIRONMENTAL	Form Noof
MANAGEMENT I N C DAILY PROJECT LOG	
monday 10/25/97	
PROJECT: CHARLESTON HOUSING J	#3
PROJECT ADDRESS: 311 NAY 4 WAY	
NOTE: Fill in GENERAL comments on routine progress on this project for the above taken, injuries, equipment breakdown, unusual conditions or situations, inspections, his occurrence which may affect the project. A signature and title must be added followin spaces between entries.	The or firing of personnel and any orba-
TIME 7:40 Parto 5:30 pm ACL workers on	time in Job 8th.
talk about today water on the place	by meething: we
talk about todays water on the place	electrical cords And
The Company,	
. Mu werter's using protective	disposable uniperus,
Sortety gloss Yz face tespitue with org	
and books.	
Le Confines working	on Doors, anders
Brows, we are very Parl Awn	and Proce IV.
we are horry tow tempetule is	nd that does not
help. (Poel from heeds Heat)	
llo Accord	en 45
SIGNED: MANDO	
PROJECT SUPERINTENDENT/DESIGNEE	
DATE:	

<u>C</u>	A	P	\mathbf{E}
ENV	TRON	MEN	TAL
	NAG		
Ţ	N		

Job No. 1/0033. 103

Form No. _____ of ___/

DAILY PROJECT LOG

Tuesday 10/26/99

PROJECT: CHARleston Housing J&B

PROJECT ADDRESS: 311 NAVY WAY

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME FLOGISM. All werters on fine or Job
Site. By 705 thy already on work one
Dons games And worders stell in mocess.
One side of doors will be completed today. And
apply on the other side that we may be abble
to ramove It by thursday, warters flums using
disposable protective uniferns with public books 42 face verpithe protection using Organic filtus saper form. und glass. und glass.
Face verpite protection using Organic Filtus Sapar
gloss, and gloses.
Another Day 100 fooder to
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
10/26/80
DATE:

gWh1714uSIVorms

<u>C</u> :	\mathbf{A}	P	\mathbf{E}
ENV	RON	MEN	TAL
MAN	NAG	<u>EMI</u>	ENT
<u>I</u>	N		<u> </u>

Job No	
Form No.	of

<u>MANAGEMENT</u>
I N C DAILY PROJECT LOG
thursday 10/18/59
PROJECT: CHarlestey Housing. J&13
PROJECT ADDRESS: 311 NAYWAY WAY
NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.
TIME 7'00 + 8,30pm All wester's on true on 506 81 te.
they all vory protective desposable uniproves, ye fore made with vigenic fifty, sopely glass, rebondances.
y reace made with organic Fifty sopely glass rebon
duces.
i we cre 5 till wyking with windows
Formes und dows frames, we this we are dong
morde the worne. it was som work completed. we
One still not having sonny days. We hope that
Monday os a Befferdin.
Illa Accordents.
SIGNED: WHOM
PROJECT SUPERINTENDENT/DESIGNEE
.TE: 10/2819

C	A	P	E
	IRON		TAL
MA	N <u>AG</u>	<u>EM</u>	<u>ent</u>
I	N		<u>C</u>

Job No.__ Form No. _____ of ____

I N C DAILY PROJECT LOG
wedne dry works 9
PROJECT: CHARLESTON HOUSING JEB
PROJECT ADDRESS: 311 NAYAL Why Bdy J
NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.
TIME Fronts 5:39m. westers on 306 Softe or Fine
ue are 8 toll in the process off head
paint londeal from dons, froms polandous
suche Still work. poel hung the Brane IV
today we have 7 working day But
only 5 day OFF Romae al.
this Horse (J). And B. Horse a lot
Of Lead paint Proceed to do, here any other.
hoise that we already did;
No decrart
SIGNED: Who LOC
PROJECT SUPERINTENDENT/DESIGNEE
1 × 10 VI F I

(!	P	E
ONM	EN1	ΊΑΙ
GE	ME.	NT
Ň		(
43	1	i/0
ı		•
<u> </u>	t t c	46
	ONM GE N	PONMENT GEME N

Form No.

PROJECT ADDRESS:

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME 7045130 Today we one working our
Tarky on Blatt J. It's not a good Day: to
Stet worker oct side . I will have Gyng bog
morde. If it not rain we will for forming.
we are Still working on window Frames And
doers from s. we are using peel Away und -
Pironow Workers with protective drops-
Soble uniforms, ye pace respitue protection with
organic files vubber gloves, sojechy gloses.
Dury Ended, No Accident
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
DATE: 110199

gelik/1714uSlVorms

$\mathbf{C} \mathbf{A} \mathbf{P} \mathbf{E}$	300 Hd. 70033.103
ENVIRONMENTAL	Form No of
MANAGEMENT	
I N C DAILY PROJECT LOG	
Tuesday 11/02/99	
PROJECT: CHARIES TON HOUSING. J&B	
PROJECT ADDRESS: 311 NAVY WAY.	
NOTE: Fill in GENERAL comments on routine progress on this project for the above da taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hirin occurrence which may affect the project. A signature and title must be added following a spaces between entries.	g or firing of personnel and any other
TIME 7 TO SIB 9m. Worker's on time o	n Jub Site.
the always using protective	- disposable uni-
forms, yz face respetive protection	n, rebox gloves
boots sorret glass.	·
We have another rainy	dry we are
not able to work octorde	
ocen buddy working marde.	continues with
docr 9 frames and windows frame	
During and Promo IT.	8
Dity Ended, illo	Acgdents
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE	
DATE: 11/02/99.	

\mathbf{C}	\mathbf{A}	P	\mathbf{E}
ENV	IRON	MŒN	TAL
MA	NAG	EM)	ENT
<u>I</u>	N	!	<u>C</u>

Job No. 9033 10 3

DAILY PROJECT LOG

Wednesday 11/03/99		
O(1)	. 1	1

PROJECT: CHARLES TONG HOUSTING. J&B.

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME_	7 %	5. 397	_ <i>V</i>	tno t	h	DAZ	<u> </u>	1744	All	7600	try
	_ برد	Job	8,7	e - 1	na	ly "	ue	hac	e e	2 good	Day.
1+	15_	44°F	Cal	وا . ا	lot	we	one	Wo	rka	of out	e de
001	sly <u>u</u>	G .	eal ;	Awan	On	wn	day	Fre	mes	it ce	III be
Co	ld	Fer	the	Neg	HOR	the	week	- the	& W	ectorel	.#=
1+	75	9	mobl	em;	the	Ped	Aum	do	not	work	100%.
€ر ۱	Y04	and.	QUIL	dave	, Fre	imes	they	Wil	11 al	most 6	se
Con	nole	led	tod	uy.	ەنعا	rter	5. <i>V</i>	lun	٦ 4	rorking	with
Sa	Rom	no	imo	hechi	se.				1	-	
	1 1		- V		Ano	the	· Dil	ry 1	lo a	Accord	a/f5
				.							
			·		_				_		
									-		
		/ 1		1)0							
SIGNE	D:		V	(4)							•

PROSECT SUPERINTENDENT/DESIGNEE

DATE:

1/03/89

g/12/1714451\forms

$\mathbf{C} \mathbf{A} \mathbf{P} \mathbf{E}$	Jo	b No
ENVIRONMENTAL		, of
<u>MANAGEMENT</u>		
I N C	DAILY PROJECT LOG	
Thursday 11/04/59		•
PROJECT: CHarleston		
PROJECT ADDRESS: 311 NA	by way	
taken, injuries, equipment breakdown, unusual co	progress on this project for the above date. DETAIL ma onditions or situations, inspections, hiring or firing of pe ature and title must be added following all entries in the	rsonnel and any other
TIME 700m 5.30m. And	the Day work	-s bock
n time on t	le 506 vite, Toom	ue are
und down we de	on the octorde wind	us franco,
us also apply on a	erndas Screen. ae al	so paritin
	and cejudais Francs. T	
	nd cealing are complet	
We hope ue	are able to start R	endeal on
outside wondars &	^	
	Anothe Ding red Acc	rdets_
	·	
	·	
1/44/69	vT/DESIGNEE	
DATE:	· ·	

CAPE	Job No. 90033, 60 3
ENVIRONMENTAL	Form No of
MANAGEMENT	
I N C	DAILY PROJECT LOG
11/08/59 Monday	
PROJECT: CHARLESTON	Housing J&B
PROJECT ADDRESS: 311 /SA	ort way
taken, injuries, equipment breakdown, unusua	ine progress on this project for the above date. DETAIL major problems and action l conditions or situations, inspections, hiring or firing of personnel and any other gnature and title must be added following all entries in the log. There shall be no
TIME TOUS.30 Ohe	- more week workers back
In fine on Te	16 Site. USing protective
	ins, yr face texptre projection with
	sopely dess books had hots gloves.
4 X 1 B (1 4	tales to remove be peel sun on
	roctside ue stell pembin inside
doors and corndon	frames. The inside of this force
(ASS) is 80% Con	pleted. Abouth 7 andas frames
will be completed o	outsides hely.
	Another Day, No Accordents
- · · ·	
(1)(()	110

PROJECT/SUPERINTENDENT/DESIGNEE

<u>C</u>	\mathbf{A}	P	E
	VIRON	_	
MA	NAG	EMI	ENT
Ī	N	1	Ç
•	۸.		1

Job No. 90033 10 3
Form No. 0f /

I N C DAILY PROJECT LOG	
Woodsy 11/07/89	
PROJECT: CHarleston Housing J&B.	
PROJECT ADDRESS: 311 Navy way	
NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.	I
TIME 7 705 539 Ohe mere Don, worker's Back	
on Jus site on time	_
We Continues with windows froms head	_
paint randeal on the outside Today on the	
Twordus games will be completed we also claring	
gloss cerndays. We confiners painting reamening door	z
And windows formers. We also setting back doors in	
place. And Sterted Gral inside.	
gloss cerndaes. We confined painting reamening door. And windows formers. We also setting back doors in Place. And Sterted Rinal inside. Another Ding 160 Accidents	
	_
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE DATE: U/69/49	
g/th/!714td Vertus	

CAPE ENV MGT

\mathbf{C}	\mathbf{A}	P	E
ENV	TRON	MEN	TAL
MA	NAG	EMI	ENT
T	N	Ī	C

Form No.

DAILY PROJECT LOG

PROJECT ADDRESS: 311 Wary WAY

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

Today we Continues with

outside wridens fromes, we are homowing lead paint
we also centimes with final clear in side:
Wirdows doss taking up poly from the closer painting
doors and windows frames. We also cleaning down
all walls. Workers using prefective disposible
chiferens Yz face respitate matechian with organic
One were Day Wo Accidents
One were Day No Accidents
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
DATE: 1/10/.99

Job No. 90033

Form No. DATLY PROJECT LOG NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

RINTENDENT/DESIGNEE DATE:

\mathbf{C}_{-}	A	P	E
ENVI	RON	MEN	TAL
MAN	IAG	EMI	ENT
Ī	N		C

DAILY PROJECT LOG

11/15/29 Monday

PROJECT CHARLESTON HOUSING J&B

PROJECT ADDRESS: 311 MANY WAY BLOCK J

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME 4" AUTION WOTHER S OVER 1 SON OUR OF THE
It was not posonble to start Blog # B
today. Decare all jurnifure one still on
place we was toll that Compling was gain
to be out uprigg (Finding) it did not Blide B is
now edity behind. Ald J. wype Semplo, will
done tomovore (ouride) we are painting de outsid
window frames. Workers with protective doposeble
onteno, je fore hapor he protection, glaces, sopely glass
books hid hots.
Mother day her Accordits.
SIGNED: Abdal D
PROJECT SUPERINTENDENT/DESIGNEE

g/201714451 Vormes

- 200 C39M. Todia

Job No.______ of _____

DAILY PROJECT LOG

PROJECT: CHOVES for Howsing DEB

PROJECT ADDRESS: 311 May Wy

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME + 103 1000 We are workfring on off 13.
on the garage, Rirnetine 3/11/12/10 Blog 15
Completed by the end of the disy, wipe souple
will be done romanow.
For Blog J. We use 32 drams, for all
boys lette Lood paint mor with suits boly.
Ocrope on Bldy 13, Completed we Hope
Kerntue cord be oct tomerow, we abundan
tuo days Sehuid today.
No Accordents.
(A)(A)(A)(A)
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
DATE: 11/16/29

\mathbf{C}	A	P	\mathbf{E}
	TRON		
MA	<u>NAG</u>	$\mathbf{E}\mathbf{M}\mathbf{I}$	ENT
<u> </u>	N		\overline{C}

Job No. 90033.103 Form No. ____(__of___/

MANAGEMENT
I N C DAILY PROJECT LOG
11/17/9 wednesday
PROJECT: CHURIESTONE HOUSING JEB
PROJECT ADDRESS: 300 / Wary Wify (B)
NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and actio taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.
Ecretative we fendly Abouth 9; som the Ecrevative was take out on ally # 13 we Sterled poly prep with 6mil in side. we have
scruature was take out on ally 43 we
Sterled poly map with 6mil in side, we have
two ple on the Bloom, we are pothers peel
Aug on outside cemdars. Today tomens
and monday will be only pay prep.
Another Dury Me Accordents
<u> </u>
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
DATE:

\mathbf{C}	A	P	\mathbf{E}
ENVI	RON	MEN	\overline{TAL}
MAN	AG	EMI	ENT
I	N		\overline{C}
1			

DAILY PROJECT LOG

Thursday 11/10/99

PROJECT: CHArleston Housing J&B

PROJECT ADDRESS: 200 / Vary way

Form No. ____

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TOME 7100 +5,30/1 Workers on time on 306 Sike
Day mes wify 6 mil poly in side was
Vecen was Borld atta Store, follows
Sorten water Heater and Bir locks. The working
Area is ready for fell stand on monday.
the octarde conderes from we are still
Applyon peel nery.
DAy End No Accidents
SIGNED: Whole CO

DATE:

\mathbf{C}	\mathbf{A}	<u>P</u>	E
ENV	IRON	MEN	TAL
MA	NAG.	<u>EMI</u>	ENT
T -	N	,	

Job No. 7003

Form No.

DAILY PROJECT LOG

2054204264

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

and windows UPERINTENDENT/DESIGNEE

CAPE
ENVIRONMENTAL
MANAGEMENT
I N C

Job No. <u>90033. 10</u> 3

DAILY PROJECT LOG

Tuesday 11/23/99

2054204264

PROJECT: CHARLESTON HOUSING J &B

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

Continues on octside windows from unter Lood paint remdeal, inside Doors Erms and windows fromes pellowing And Some Drono It Completed with applying, we wellso Compines, Led paint rimidal on Decond place on door from 3. workers with doposable protective uniforms ye fore respites protection with organic giters, rellow glass boots, Sopet glass and bland hots.

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

DATE: 11/23/99

DAILY PROJECT LOG

CAPE ENV MGT

Housing J&B.

a county am 111 acts

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME PHO GIRD CO OF 100 3 OK 1 MW.
Another bong day we continued with head
paint home of on outside of anders prous, we also
Wheoday stated with inside winders fromes ted paint
hended. We also Continues with Ledpail heme.
Wal or don froms, Second Flor.
warters alum ismy motective Clathing
disposable. Syrely doss. hobs glaces ports yr Roce
herpstyle motection with arganice filts.
herpstre protection with arganic filts.
SIGNED: Achold ()
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
DATE: 11/24/99
DAIR.

\mathbf{C}	A	P	\mathbf{E}
ENV	IRON	MEN	TAL
MA	NAG:	<u>EMI</u>	ENT
<u> </u>	N		\overline{C}

ENVIRONMENTAL	01
MANAGEMENT I N C	
I N C	DATLY PROJECT LOG
Mondery 1/29/59	DAILY PROJECT LOG
PROJECT: CHARLES TOUS	HOUSTRY J& 13
PROJECT ADDRESS:	y wing By = B
arch, injuries, equipment breakdown difficult	e progress on this project for the above date. DETAIL major problems and action conditions or situations, inspections, hiring or firing of personnel and any other takes and title must be added following all entries in the log. There shall be no
TIME 7 to 513 gm. Inother	week. We so book to normal
Mg. (lon-adm), loon	this with protective disposable
uniterna, ystoce resp	1) the protection, socket glass, rebbu
duces, boots had he	45.
be Continus seite	1 head paint remdeal, outside
window Frames, US	so inside undous frames Doors
	Second place head paint removed
in mogress. Doan	on perst Plan we already stor
fed Lend painil ran	weed, we have able sonny
	ood for the peel sousy
	No Accidents
SIGNED: White	<u>Q</u>
PROJECT SUPERINTENDER	NT/DESIGNEE
DATE:	<u></u>

\mathbf{C}	\mathbf{A}	P	\mathbf{E}
ENV	IRON	MEN	TAL
MA	NAG	EMI	ENT
Ţ	N	•	<u> </u>

Job No.		
Form No.	of	_

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

DATE:

Form No. ___(__

DAILY PROJECT LOG

CAPE ENV MGT

starleston

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME 7 HT134m we one Still working on
octorde ceriday frame removin Les paint
On the inside windows Frames first
flor completed. Doors frames And Doors also
Completed.
friest floor: windows frames, Doors Francis
and Door Still in moces s of Lead
panil vanoral. le also started vanour
o scroping hose point from walls on seemedor
Working Always working with
Sorely
No Accordents
SIGNED: Who was
PROJECT SUPERINTENDENT/DESIGNEE
DATE:

والكا/1711فك الأوليو

DAILY PROJECT LOG CHAILLES70NO NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or sinuations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries. SIGNED: PROJECT SUPERINTENDENT/DESIGNEE

DATE:

12/02/99

C	A	P	E
ENV	TRON	MEN	TAL
MA	NAG	EM	<u>ENT</u>
<u>-</u>		,	

	J	ob No.	1	203	3,	b	3
т			,	_	1		-

DAILY PROJECT LOG NOTE: Fill in GENERAL comments on toutine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

SIGNED:

DATE:

<u>C</u>	A	P	\mathbf{E}
ENV	TRON	MEN	TAL
MA	<u>NAG</u>	EM	ENT
Ţ	N	Į	$\overline{\mathbf{C}}$

Job No. 90833.10 3

PAGE

Form No. _____of____

DAILY PROJECT LOG

Trasdung 12/07/99

PROJECT: CHArlesten

300 Nayy

1005 M

Bldy B

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

decripe the stated final elections. We also stated scraping on because these paint on wolls and earlier on second closed. This week is have only 4 war theres. Lere also con times painting with UB.C. worders and Downs Fromes. And Doors working when we are protective as-

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

DATE:

12/01/29

\mathbf{C}	A	P	\mathbf{E}
ENV	IRON	MEN	TAL
MA	NAG	EΜΠ	ENT
Ī	N	ſ	<u>C</u>

Form No.

DAILY PROJECT LOG

2054204264

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entities.

TIME 7: 40 5130m Ohe More on Bldg 13.
worter on fine on Job 81 Le.
We continues with final clear.
be ge Still Booking white LBIC on
lendaes on door and (froms) inside
and or tside
It file Some time we one Scraping
any Loose paint on walls and Cealing. In
gide partie with LBC will be completed
tomorrue.
No Accident?
SIGNED:
DATE: DO 9 9

<u>C</u>	\mathbf{A}	P	E
ENV	IRON	MEN	TAL
	NAG		
I	N	_	C

Job No. 90633. 103

DAILY PROJECT LOG

Thursday 12/09/81

PROJECT: CHURIESTONE HOUSING 58B

PROJECT ADDRESS: 300 Way way ogly 48

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

The 7000 30 We con times with final clean.

And Scraping any love paint on works

What Cealing on the instruct. My goors (France)

Condoors France are completed painting with

"B.C. white.

We stage & cendors France to be painted

With LB.C- White. My Bogs we put on godons

Lemparan Storage.

Another Dung Alo

Accorder to.

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

TE: THURSDAY

12/07/99

$\mathbf{C}^{\prime}\mathbf{A}$	P	E
ENVIRON		
MANAG I N	EMI	C

Job No. 90033. 103

Form No. _____ of /

DAILY PROJECT LOG

monday 12/13/89

PROJECT: CHARIESTON HOUSING J&B

PROJECT ADDRESS: 200 Navy way

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

\mathbf{C}	A	<u>P</u>	E
ENV	TRON	MEN	TAL
MA	NAG	EM	ENT
T -	N		

Job No. 90033.103

DAILY PROJECT LOG NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries. RINTENDENT/DESIGNEE

下(1714年) [Comm

\mathbf{C}	\mathbf{A}	P	E
ENV	IRON	MEN	TAL
MA	NAG	EMI	ENT
Ī	N		<u>_</u>

DAILY PROJECT LOG

Wednesday 12/15/99

PROJECT: CHARLESTON HOUSING J&B

PROJECT ADDRESS: 200 Wary way (B)

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME I POST - HOUGHE JOB OF WORK ON JOB SI	H
we continues with Final Clean, on walls work	-
drus pulled Mis up also chains in 1811 Fre	-1
ments. Tomerray by work to be done morde	
wid he completed; except Door. They will be pe	- ;
book og monday.	_
We also will start scraping Ann lose point	
on ortside.	_
wore sample will be faten weekt wednesday	<u>.</u>
Day Ends	. '
No Accidents	_
	_
	· -
	_
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE	
PATE: 12/15/199	
7440	

/14/2000	16:	47	2054
\mathbf{C}	4	P	E
ENVIR MANA	ON	MEN' EME	TAL 'NT
I	N	<u> </u>	C
ther	<u>5</u>	Ag	12
	<u> </u>	— 7	

DAILY PROJECT LOG

-14-99

PROJECT ADDRESS:

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

TE:

$\underline{\mathbf{C}}$	\mathbf{A}	P	E
ENV	IRON	MEN	TAL
MA	NAG:	<u>EMI</u>	ENT
I	_ N		C

Job No. 9033 103

DAILY PROJECT LOG

Treadon 12-21-99

PROJECT: CHarleston Housing J&B

PROJECT ADDRESS: 200 Mary Wity

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TIME 1 10g. Warmer south on Jub 51 te on time.
Olean 1111 on the process of final
erely, we are haling wife somple
tomeran Appen noon.
All Brunny work on octside, ocompleted
Today we stated to put in place some
Today we stated to put in place some
sows.
Another Dory
No Acordents
(A)CA, (V)
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
TATE: 12/21-99

16:47 2054204264

\mathbf{C}	\mathbf{A}	P	E
ENV	TRON	MEN	TAL
MA	NAG	EMI	ENT
I	N		C

Job No. 90033103

DAILY PROJECT LOG

Unduesty 122299

PROJECT ADDRESS: 200 May LING B

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TOUTH of our last day, Au Door will put bock in place, windows gramer outside completed with LBC-point. Decentomination Ststem is out. Negative "Aur machine clan out and put in the Stones room.

Au final Clean completed. Inspection was dare by Bob. After wipe Somple were taken, on windows and ploor, first and second ploor.

Descrits from wipe Samples, will be back thursday on Friday.

Nach Day on the Proyect. End 1000

Accidents.

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

DATE:

12/2/99

\mathbf{C}	\mathbf{A}	P	E
	IRON		
MA	<u>NAG</u>	EM1	<u>ENT</u>
<u> </u>		[C

2054204264

JOHN 120 M. 125 Rue

Job No. 90033.10 3

DAILY PROJECT LOG

PROJECT: CHOrleston Hoveny J4B

PROJECT ADDRESS: 200 nay way (B)

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

151 XA

TIME 1 104 OF SUPERIOR
be have a sopely theothop. The Perposer To
Renendom Everything they already now, To oak
sope, and the proper use of Egestmont. We are
cet the final of the job; we do the final
elen Andongtose paint at the ortside of the
horse. We also villes texte to pet Bock in
place Dows (wednesday)
My works ce M be Consplited on
Wednesda.
No Accordent
$\frac{1}{(1)(1,0)}$
SIGNED: PROJECT SUPERINTENDENT/DESIGNEE
17-5
DATE:

PAGE 04

Job No. 90033, 103

Form No. _____ of __/

\mathbf{C}	A	P	E
ENV	RON	MEN	TAI
MAI	NAG	EMI	ENT
Ī_	N		C

DAILY PROJECT LOG

montag 1-03-2000

PROJECT: CHarleston Housing J&B

PROJECT ADDRESS: 200 Way Com

Ceroge on Bly B)

NOTE: Fill in GENERAL comments on rousine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

TOME 7'10313° Today we are back on Bldy B.
Beeoese garage # 1 (trye one) the Sail Somp
Come out high. We are cleaning 2ft arround it
with Stowel and put in bogs.
we will have a Second Sort somple taken
on friday. By Bob Barry, We had 3 worker
with protective disposable unipoms yr face respi-
tre protection rubby books.
tre protection rubbir books. We will have Semple results her week.

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

DATE: ____1 -03 - 2000

CAPE ENV MGT

02/14/2000 16:47 2054204264 MANAGEMEN spaces between entries.

Form No.

DAILY PROJECT LOG

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no

SIGNED:

CAPE
ENVIRONMENTAL
MANAGEMENT
I N C

Job N	(0
Form No.	of

DAILY PROJECT LOG

Undnesday 01-05-00

PROJECT: Chterles ten Ho

PROJECT ADDRESS:

Housing J&13

NOTE: Fill in GENERAL comments on routine progress on this project for the above date. DETAIL major problems and action taken, injuries, equipment breakdown, unusual conditions or situations, inspections, hiring or firing of personnel and any other occurrence which may affect the project. A signature and title must be added following all entries in the log. There shall be no spaces between entries.

Claimy out paint or wolls of Baktrown

that clearly again arround the house

we also not book with fonce on soile

entrance of the hand. Also James 9 hill

working or punchlist, on Bldy J And B

Anothe Disg No


Accidents.

SIGNED:

PROJECT SUPERINTENDENT/DESIGNEE

DATE:

01-05-00



S -	٠. ٠.				CAPE				-	
Ple (Fo	ase pi	rint or type isigned for use on elite (12-pitch) typewriter.)	NFCS		1 10					
<u></u>		NON-HAZARDOUS WASTE MANIFEST	1. Generator's US EPA ID S: C: 0: 1: 7: 0: 0:	-	Panji si Dop. Ng	2. Page 1				
Ĩ	3.	Generator's Name and Mailing Address	SOUTH DIV. NAV CARETAKER'S SI	Y FAC. ENG TE OFFICE			<u> </u>			-
		Generator's Phone (843) 743–9985 Transporter 1 Company Name	P.O. BOX 19001 N. CHARLESTON.		9010	A. Transp	orter's F	Phone		
		SOUTHEASTERN RESEARCE Transporter 2 Company Name	ch G·A·	R · O · O · O · O ·	1.7.7.4.9	B. Transp	(770)4	12-8275	
		FREEHOLD CARTAGE Designated Facility Name and Site Address	l l	D · O · 5 · 4 · 1 · US EPA ID N	2 - 6 - 1 - 6 - 4	C. Facility	((800)4	58-5229	
		SOLID WASTE TECHNOLO 300 SWETT AVENUE AMERICUS. GA 31709	1				('912)9	28-5148	[: : :
	11.	Waste Shipping Name and Description					I2. Con No.		13. Total Quantity	14. Unit Wt/Vol
	a.	NON-REGULATED NON-HAZARDOUS	SHOWER WAT PROFILE AP		02000		6	DM	330	Lbs
GENE	b.									5
GENERATOR	C.		-	•						7.2 Y
	d.							1		
	7	Special Handling Instructions and Additional Info	ormation [DL, SOLID WASTE	TECHNOLOG	HES, INC.		<u>.</u>		tes Listed Above	
		EMERGENCY CONTACT:	STEVE BROCK (80	0)211–9727			00	20	54	aste. / Year
	16.	GENERATOR'S CERTIFICATION: certify the	materials described above on this	_ //	bject to federal regula	ations for rep	orting pro	per dispos		aste.
¥	47	Printed/Typed Name Frierso		illi	D. A	nies	الماك		Month Day	
RANSC	17.	Transporter 1 Acknowledgement of Receipt of Marie Drinted/Typed Name	wateriais	Signature	wests				Month Day	
TRAZMPORTER	18.	Transporter 2 Acknowledgement of Receipt of Merinted/Typed Name	ν_{\parallel}	Signature John	nie L	11-1	M	1	Month Day	Year 6 0 0
FAC	19	. Discrepancy Indication Space			V		-		. = 1.5	
-	 	F-104 Occupancy Operation of Control of Cont					_			
"] T	20	. Facility Owner or Operator: Certification of rece	ipt of waste materials covered	l by this manifest e	xcept as noted in It	em 19.				

SOLID WASTE TECHNOLOGIES INCORPORATED

P. O. Box 409 300 Swett Avenue Americus, GA 31709 (912) 928-5148 FAX (912) 931-0603

South Div. Navy Fac. Eng. Command Caretaker's Site Office P. O. Box 190010 2155 Eagle Dr. N. Charleston, SC 29419-9010

CERTIFICATE OF DISPOSAL

Solid Waste Technologies has received waste material from

SOUTH DIVISION NAVY FACILITY ENGEENERING COMMAND described on Generator's Manifest Document Number 03763 and received on Wednesday, 16 February 00.

<u>Profile</u>	Quantity	Type		
002000	6	DM		

Solid Waste Technologies hereby certifies that the waste material identified above was received and disposed of in compliance with State and Federal Regulations.

AUTHORIZED SIGNATURE: Kay Hodge DATE: 2/16/00



Test Request Form

(Client Signature Must Accompany Request)

Name	Fax (843)-569-8792 APE Enc 2302 Pu NTLANTA	remutal EXCONE Dr.		Fax report	ec@ Conol.
Project No.	Sample 1	Type NATER	# of Samples		P.O.
	M. Bens Ly / Unusual Conditions / Po	Phone No.		Date Si	hipped -22-99
Lab Use Only	Sample Number or Area	Semple Volume or Time	Date Sampled	Media Type	Analysis Requested
	#1 Unir B	N/A	12-2299	WATER	Lendinh
	#1 Vnir B #2 Vnir J #3 Unir B				
	#3 Unir B	<i>\lambda</i>	V	<i>b</i>	V
					
		-			
_					
		-			
American Industrial		ratory Accreditation #36	<u> </u>		
\bigcirc		1/27)			



CLIENT: CAPE Environmental

2302 Parklake Drive STE 200

Atlanta, GA 30345

ATTN .: Robert Beasley

Project Info: 90033.103

Purchase Ord:

Workorder: 9912113

Received: 12/22/1999 1:12:00 PM

Received by: McGuiggan T

Validated: 01/19/2000 12:10:00 PM

Validated by: Pfaff J

Approved: 01/19/2000 12:11:00 PM

Approved by: Pfaff J

Client Sample ID: #1 Unit B Collection Date: 12/22/1999

Azimuth ID: 9912113-01

Test Method Sample Result

1 in Water EPA 239.2 6.0 mg/L

Client Sample ID: #2 Unit J Collection Date: 12/22/1999

Azimuth ID: 9912113-02

Test Method Sample Result

Lead in Water EPA 239.2 6.19 mg/L

Client Sample ID: #3 Unit B Collection Date: 12/22/1999

Azimuth ID: 9912113-03

Test Method Sample Result

Lead in Water EPA 239.2 6.21 mg/L

Director of Laboratories: Richard D. Bennett, MSPH CIH

AIHA Laboratory ID Number: 100624 NY State ELAP Lab No. 11052 ELLAP Laboratory ID Number: 100624

Detection limit: 0.50mg/L

Final Approval: Jonya M'Guggan, Lab Manager

Date: Linuary 20,2000

Report Printed 01/19/2000

Page 1 of 1

HUD Lead in Drinking Water

Samples were analyzed by Graphite Furnace Atomic Absorption Spectrometry in accordance with EPA Method 239.2.

Values reported as less than (<) indicate that the amount of analyte present was below the established reporting limit.

Analyst:

Roosevelt Mouzan

Date:

Date: 11800

Reviewer:

Tonya McGuiggan

FRI 14:05 FAX WASTE MANAGEMENT DIVISION MICHIGAN DEPARTMENT OF ENVIRONMENTAL QUALITY

	NOT WRITE	IN THIS	SPACE	
π.□ `	- DIS. 🗆	REJ.	. 🖸	PR.□

Feilure to file may subject you to criminal and/or civil penaltae under Sections 324,11151 or 324,12116 MCL

'i	ije.	to print or type.		<i></i>		1.1	F	om Approved: OM	E No. 20	50-0039
** 1	A	WASTE MANIFEST	1. Generator's US EP S C O 1 7 O O		Your	Madified Thent No.	2. Pa	ige 1 Informa	tion in	the shaded area ired by Federa
		3. Generator's Name and Mailing Address	OUTH DIV. NAV			OMMAND		ate Manifest Doo		Number
2		PATIN:	CARETAKER'S SI				· ′ N	11 7114	415	2 ::::
[]		LILLIE PETERSON	2.0. BOX 19001	0/2155 F	ACTR	DR.	B. St	ate Generator's	D	
1		4. Generator's Phone (843)743-9985	L CHARLESTON	SC 20/1	0_001)				and the second
ŧ		5. Italisporter i Company Manie	6.	US EPA ID	Numbe	r		ate Transporter's	ID .	
2		SOUTHEASTERN RESEARCH	LG_A	2000	01.7	7 4 9	D. Tr	ansporter's Phor	B (7	70)412-827
•	11	7. Transporter 2 Company Name	8.	US EPA ID				ate Transporters		
•		FREEHOLD CARTAGE	N.T	D.O.5 4	1.26	164	F. Tr	ansporter's Phon	e (80	00) 458-522
	П	9. Designated Facility Name and Site Address		US EPA I	Numbe			ate Facility's ID		7.
1	Ш	CHEM-MET SERVICES, INC.	•				٠. ٠ ٠	Staffyska et a de	· · · <u>-</u>	~ ~ ~ ~ · ~ · . · · · ·
	П	18550 ALLEY ROAD	_	•			H. Fa	cility's Phone	•	
1	П	WYANDOTTE, MI: 48192		7096	953			800)282-92	51	
:		11. US DOT Description (including Proper Ship	ping Name, Hazard C	lass, and		12. Conta	iners	13, Total	14. Unit	I. Waste
ا يُ		HM ID NUMBER	•			: No.	7үрэ	Quantity	Wt/Val	
5	Ш	a. X HAZARDOUS WASTE, SOLI	D, N.O.S. (LE	AD)		1				D008
; ·	11	9, NA3077, PGIII	•			68		-		22
:	G					WO	<u>D</u> M	3740	0	
;	E	[b.]				,				
1	Ē					٠,٠				
	<u> </u>	(c.					······/~	· · · · · · · · · · · · · · · · · · ·		-
<u>.</u> ا	[۵	1-1	,							***
•	R					•			}	
: [a.							-	
	Ш			•		1			1	
		J. Additional Descriptions for Materials Listed	I Above		7**		. :		- ²	K. Handling Co
	Ш	11A. PROFILE APPROVAL:	CHA560FIL R	.R.G. 171	1		, 1 ° ,			
2	11	LEAD CONTAMINATED	DEBRIS	3 /3				in the second of		
				1.00			and section of the se	a Jersey and State of the Control of		
	П		•	i a Freir			wir i	A STATE OF STREET	: P	
ŧ	$\ \ $	15. Special Handling Instructions and Addition	i.							
[]	-	CONTACT: CHRIS HEINDL,	SOLID WASTE	TECHNOLQC	SIES.	DIC. (578)	513-8110	£	
[]		16. GENERATOR'S CERTIFICATION: 1 horoby declare to	hat the contents of this co	nsinoment ara fi	div and an	curately desc	ribed a	hove by proper shi	pping na	me and are classific
5	Н	packed, marked, and labeled, and are in all respect	s in proper condition for t	ngin yd troganer L	MeA eccol	ding to appli	cable in	ternational and nat	ional go	vernment regulation
5		if I am a large quantity generator, I certify that	I have a program to pis	ece to reduce th	e volume	and toxicin	of wa	ste generated to t	hn degn	ce I have determin
-	П	to be economically practicable and that I have present and future threat to human health and	selected the practicable	mothed of tess	atment St	orace, or di	trootal.	currently havilable	to me	which minimizes t
2	ÍΙ	generation and select the best waste managemen	it method that is available	to me and that	I can affo	rd.		inge a good thin	211011 12	
4	Ш	/ Printed/Typed Nome	<u> </u>	····						Date
	¥۱	1 the Decioes).).	Signature 0.0	: /	1 /				Month Day Y
	<u>, </u>	17. Transporter 1 Acknowledgement of Receipt	t of Materials	2 Julia	1_J		$M\nabla$	<u> </u>		ALL LAND
2 2	T R	Printed/Typed Name	r Ci lelercildiz	Signature	—— <i>fi</i>		.			Date
	N	J.C. Sweath			No.	- 6H	=			Month Day Y
	S F	18. Transporter 2 Acknowledgement of Receipt	t of Materials	_ <i>///</i> <u>C</u> .	_gu	THE PLANE				Date
22		Printed/Typed Name	,	jaggatur êy .			7			Month Day Y
1	RTER	William Lish	1011		Olm	,	to	ul		1012/1/5/c
֓֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֞֡֞֡֡֡֡֡֡֡֡	Ä	19. Discrepancy Indication Space					<i>w</i> .			B 5/1/1/C
2 5			_			λ,				•
A L	F	·	_			\ .				
	ç				_					
19	L	20. Facility Owner or Operator: Certification of Item 19.		materials cove	tt yd bere	nis manifes	1 BXCB	pt as noted in		
1	Ť		***		Ar		<u> </u>			Date
		Princed/Typed Na/05	7.79	Signature	K		V		•.	Month Day
[Steven Jodney		1 /2	Eleve	•	سعرل	Calon-		10-4/1016
100		A Form 8700-22 (Rev. 9/88)	SERVICE PARTY OF THE PARTY OF T	TO THE PERSON	A STATE OF THE PARTY.	والا برسيد و وي وي و وي وي	200		-	WALL THE THE THE THE THE



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

2302 Parklake Drive, NE Address:

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

Project: CAPE00399

Client ID: CAPE001

Contact:

Mr. Craig Birch

Project:

Charleston Naval Base

Client Sample ID:

Sample ID:

- Matrix:

Collect Date: Receive Date: Collector:

#1 PLASTIC

20019001 Misc Solid 15-DEC-99

03-JAN-00

Client

Parameter	Qualifier	Result Units	Method	Analyst	Date	Time	Batch
Metals Analysis-ICP							
TCLP ICP Metals for Solid							
Lead		26.4 mg/l	SW846 6010B	KAR	01/08/00	2135	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.

Reviewed by



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

Address: 2302 Parklake Drive, NE

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

CAPE00399

Project:

Client ID: CAPE001

Contact: Project:

Mr. Craig Birch

Charleston Naval Base

Client Sample ID:

Sample ID:

Matrix: Collect Date: Receive Date

Receive Date: Collector: #2 SUITS 20019002

Misc Solid 15-DEC-99


22-DEC-99 Client

Parameter	Qualifier	Result Units	Method	Analyst	Date	Time	Batch
Metals Analysis-ICP						_	
TCLP ICP Metals for Solid							
Lead		11 9 mg/l	SW846 6010B	KAR	01/08/00	2140	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.

Reviewed by

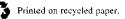



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

2302 Parklake Drive, NE Address:

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

Project: CAPE00399 Client ID: CAPE001

Contact:

Mr. Craig Birch

Project: Charleston Naval Base

Client Sample ID:

Sample ID:

Matrix: Collect Date:

Receive Date: Collector.

#3 PAINT CHIPS 20019003

Misc Solid 15-DEC-99

22-DEC-99 Client

Parameter	Qualifier	Result Units	Method	Analyst	Date	Time	Batch
Metals Analysis-ICP							
TCLP ICP Metals for Solid							
Lead		24.4 mg/l	SW846 6010B	KAR	01/08/00	2157	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.



Meeting today's needs with a vision for tomorrow.

Certificate of Analysis

Company: Cape Environmental

Management

Address:

2302 Parklake Drive, NE

Atlanta, GA 30345

Report Date: January 18, 2000

Page 1 of 1

CAPE00399

Project:

Client ID: CAPE001

Contact: Project:

Mr. Craig Birch

Charleston Naval Base

Client Sample ID:

Sample ID:

Matrix:

Collect Date: Receive Date:

Collector:

#4 RAGS 20019004

Misc Solid 15-DEC-99

22-DEC-99

Client

Parameter	Qualifier	Result Units	Method	Analyst	Date	Time	Batch
Metals Analysis-ICP							
TCLP ICP Metals for Solid							
Lead		37.7 mg/l	SW846 6010B	KAR	01/08/00	2202	6039

The above sample is reported on an "as received" basis.

This data report has been prepared and reviewed in accordance with General Engineering Laboratories, Inc. standard operating procedures. Please direct any questions to your Project Manager, Elise Hanson at 843-556-8171 Ext. 4409.